



ELITE GROUP
INSPECTION PROFESSIONALS



800-494-8998

RESIDENTIAL



PROPERTY LOCATION: 30587 Los Altos Drive Redlands, CA 92373

INSPECTION REPORT

CLIENT: Caroll Brier -AGENT:

Date of Inspection: 3/18/2026 at 10:00 AM

Year Built: 1976 Sq Ft: 3158

Weather: 86, Clear and Dry

Order ID: 393480

Inspector: Dennis Aguilera

(714) 400-1010

dennisaguilera@eliteinspections.com



customer@eliteinspections.com



www.eliteinspections.com



Table Of Contents

Summary Page	5-9
OVERVIEW	10
INTERIOR	11-17
BATHROOMS	18-21
KITCHEN	22-26
LAUNDRY AREA	27-28
HEATING/AIR CONDITIONING	29-33
WATER HEATERS	34-37
ELECTRICAL/GAS SERVICE	38-40
ATTIC AREA	41-43
GARAGE AND/OR CARPORT	44-49
EXTERIOR AREAS	50-52
FOUNDATION	53
GROUNDS	54-60
ROOF	61-66
Glossary	67





Moving is hard work

Save time and leave the utilities and services set up to us while getting the best deals in your area.

HomeBinder Assistant gives you a single point of contact to help you navigate the multitude of options and price for:



TV



INTERNET



UTILITIES



HOME SECURITY



HOMEOWNERS INSURANCE

Shop and compare top service providers all in one place, including:



xfinity



AT&T



vivint.

SimpliSafe

COX.



Contact us at assistant@homebinder.com | homebinder.com

Start your new home ownership journey with HomeBinder



COMPARE PRICES AND OPTIONS

Don't pay more because you are in a rush.

Get multiple quotes and coverage options from the country's top service providers so you can get the best deal.



FREE FOREVER

And no obligation. Yes, really.

Making moving-in less complicated doesn't have to cost an arm and a leg. Make the smartest choice for you and your family with no cost or obligation.



TRUSTED

Because you don't want any nasty surprises.

We only work with the nation's most trusted service providers so that you can confidently review rates and service options.

About HomeBinder

Our goal is to simplify homeownership by centralizing information and connections. With HomeBinder, you can keep everything about your home in one simple and secure platform. Supported by thousands of business partnerships, HomeBinder was founded in 2012 and is a division of iGo.



homebinder.com

Copyright HomeBinder 2023

Contact us to get personalized service:

Call (800) 485-4830 or email us at assistant@homebinder.com





REPAIRS

Trusted Pros.
Vetted by
**THE
ELITE
GROUP**

**Need to Fix Something?
Don't Panic—Start Here**

**VIEW OUR PREFERRED
CONTRACTORS DIRECTORY**



For exclusive access to The Elite Group's trusted contractors,

visit the link: <https://eliteinspections.com/vendors/>

Summary Page

The summary below consists of potentially significant findings. These findings can be a safety hazard, a deficiency requiring a major expenses to correct or items I would like to draw extra attention to. The summary is not a complete listing of all the findings in the report, and reflects the opinion of the inspector. Please review all of the pages of the report as the summary alone does not explain all the issues. Further evaluation is recommended for any item written in red text or marked "needs to be serviced" or "recommend servicing" on this report -- further evaluation often times will allow a contractor to find additional items needing repair beyond the scope of the inspection. Failure to further evaluate any item as recommended releases us of any liability.

INTERIOR		
Page 11 Item: 3	Ceiling Fans	<ul style="list-style-type: none"> • Did not operate - needs to be serviced or further evaluated - kitchen area
Page 12 Item: 4	Floor Conditions	<ul style="list-style-type: none"> • Worn/stained heavily in areas - needs to be serviced
Page 14 Item: 10	Fireplaces	<ul style="list-style-type: none"> • Raised hearth at fireplace in kitchen creates a trip hazard – exercise caution
Page 16 Item: 15	Smoke Detectors	<ul style="list-style-type: none"> • All smoke detectors are visibly too old – not tested – replacement needed • Smoke detector installed to close to ceiling fan blades/HVAC registers - may be problematic - recommend relocating to a more appropriate location, at least 3 feet from fan/register
Page 17 Item: 16	Carbon Monoxide Detectors	<ul style="list-style-type: none"> • No carbon monoxide detector present - we recommend installation per requirements prior to the close of escrow
BATHROOMS		
Page 18 Item: 3	Sinks	<ul style="list-style-type: none"> • Hot fixture handle leaks above countertop when operated – master bathroom, right sink
Page 19 Item: 6	Showers	<ul style="list-style-type: none"> • Shower arm faceplate is loose at the wall - recommend securing and sealing this area - bathroom near kitchen • Showerhead has extremely low water pressure – bathroom near kitchen – service needed • Showerhead not spraying properly – master and hall bathroom – service needed • Spray wand has extremely low water pressure – hall – service needed • Shower diverter to wand/body sprays not operating properly - needs to be serviced
Page 20 Item: 7	Shower Walls	<ul style="list-style-type: none"> • Cracked/loose/missing grout in areas - recommend grout and sealer - master and bathroom near kitchen
Page 20 Item: 9	Toilets	<ul style="list-style-type: none"> • Water shutoff under toilet corroded - needs to be serviced - this will be an ongoing maintenance issue for ALL plumbing valves - master
KITCHEN		
Page 22 Item: 1	Counters	<ul style="list-style-type: none"> • Cracked/loose/missing grout in areas – service needed
Page 23 Item: 6	Dishwashers	<ul style="list-style-type: none"> • Unit not fastened to underside of countertop - tip hazard - needs to be serviced



HEATING/AIR CONDITIONING		
Page 29 Item: 2	A/C Evaporator Coil Box	<ul style="list-style-type: none"> • Air leaking at refrigerant or condensate line connection areas - needs to be sealed to prevent air loss - both
WATER HEATERS		
Page 34 Item: 1	Water Heaters Condition	<ul style="list-style-type: none"> • Unit old and appears to be nearing end of useful life - we recommend that you budget for a replacement
Page 35 Item: 6	Water Heater Temperature	<ul style="list-style-type: none"> • Temperature was above 120 F at one or more fixtures within the structure, this a potential scald hazard - needs to be serviced/adjusted - consult a plumber - both
GARAGE AND/OR CARPORT		
Page 46 Item: 9	Fire Doors	<ul style="list-style-type: none"> • Self-closing device not operating - needs to be serviced • Door sticks when closing – service needed
Page 48 Item: 17	GFCIs	<ul style="list-style-type: none"> • None installed - recommend upgrade for increased safety
EXTERIOR AREAS		
Page 50 Item: 2	Wood Trim	<ul style="list-style-type: none"> • Deteriorated wood - needs to be serviced - consult termite report
GROUNDS		
Page 55 Item: 4	Exterior Electrical	<ul style="list-style-type: none"> • Electrical fixtures need to be caulked/sealed to wall attachments to help prevent moisture entry
Page 57 Item: 8	Water Pressure	<ul style="list-style-type: none"> • Approximate pounds per square inch: 50 - low
ROOF		
Page 61 Item: 1	Condition	<ul style="list-style-type: none"> • Cracked/chipped tiles/mortar - typical for age/materials - recommend seasonal roof maintenance • Vegetation on roof - not fully visible for inspection - recommend servicing/cutting back vegetation away roof areas • Broken tiles - needs to be serviced • Loose/slipping tiles/shingles - recommend servicing
Page 65 Item: 4	Vents and Vent Caps	<ul style="list-style-type: none"> • Mastic at vent(s) is weathered and cracked - needs to be serviced and resealed at all penetration points

ABOUT YOUR INSPECTION - [PLEASE READ ALL OF THE INFORMATION WE PROVIDE BELOW](#)

In order for you to receive the full value of this inspection, please read all of the information we have provided.

ALL ITEMS IN RED PRINT ARE OF IMMEDIATE CONCERN TO THIS STRUCTURE AND SHOULD BE FURTHER EVALUATED BEFORE THE CLOSE IN ESCROW. HOWEVER, THE ENTIRE REPORT MUST BE READ FOR FULL DISCLOSURE, AS OTHER ITEMS WRITTEN IN THE REPORT MAY REQUIRE FURTHER EVALUATION AS DEEMED BY THE OPINION OF THE READER. IF A FURTHER EVALUATION IS NOT PERFORMED AND ADDITIONAL DEFECTS ARE FOUND AFTER THE CONTINGENCY PERIOD HAS EXPIRED, THEN ANY DISPUTES OR CLAIMS AGAINST THE INSPECTION WILL BE DENIED. SIMPLY PUT, IF YOU DO NOT FOLLOW THE ADVICE IN THIS REPORT, THEN YOU CANNOT HOLD THE INSPECTOR OR THE INSPECTION REPORT LIABLE AFTER YOU MOVE INTO THE INSPECTED STRUCTURE OR PROPERTY.

This IS a limited Inspection: It is impossible to inspect every square inch of every area of a home in a limited time frame. A home inspection is designed to reflect, as accurately as possible, the visible condition of the home at the time of the inspection only and does NOT reflect, anticipate or predict future conditions. Conditions at a home for sale can change radically in only a day or two, so a home inspection is not meant to guarantee what condition a home will be in when the transaction closes. It's not uncommon for conditions to change between the time of the inspection and the closing date. During this inspection your inspector did not dismantle equipment, dismantle any structural items, apply stress or destructive testing. Areas that are hidden, painted over, disguised and/or not readily visible are not covered in this report. Our report is not a guarantee or warranty on the condition of your property or its contents. This report provides an unbiased visual inspection only. Elite Group Inspection Professionals inspections are performed with consideration given to the age of the structure. Defects will be indicated and marked as such, even though the condition may be normal for the age, and should be inspected by the appropriate licensed contractor. Opinions vary from person to person and this report is the opinion of the inspector and must be considered as such. The Inspector does not determine the age or remaining life of any system or building material during this inspection. Cosmetic items are considered obvious and are often not included in your report. Your report does not include all items covered in the REAL ESTATE TRANSFER DISCLOSURE FORM. We recommend that you read the Disclaimers page in complete detail to understand the limitations of a Home Inspection.

An attorney and/or real estate broker should be consulted on additional items not included in this report.

ENVIRONMENTAL DISCLAIMER: Mold spores, asbestos, formaldehyde, radon, lead paint, Chinese drywall, poria and all other toxic items of concern cannot be identified as toxic and/or dangerous with this inspection report. Your inspector is not certified to identify any of these toxic or dangerous items and will not include any information on them in this report. It's recommended the client have the property tested by a certified expert in these areas, in all cases.

Houses/structures built between 1965 and 1974 have the possibility of aluminum wiring present throughout structure. It is recommend that a licensed electrician further evaluate houses built in this era for aluminum wiring. Houses/structures with galvanized or cast iron plumbing present are highly recommended to be further evaluated by a plumbing contractor regardless of the age of the plumbing.*

Houses/structures built prior to 1978 can contain asbestos materials. It is recommend that a licensed asbestos contractor/inspector further evaluate houses/structures built in this era for asbestos materials. The Home Inspector will not determine or include in the report if asbestos is present at any structure or in any materials at a structure.*

Houses/structures built prior to 1978 can contain lead paint. It is recommend that a licensed lead inspector further evaluate houses/structures built in this era for lead paint materials.*

***Elite Group Inspection Professionals will not engage in any claims regarding aluminum wiring, asbestos or lead paint.**

PHOTO DOCUMENTATION: Your report may include digitally imaged photos of certain problem areas (should they exist). Also included are pictures (General Views) to establish location and identification. It is not a requirement that your Home Inspector photograph every area or defect of the home; additional photos may be taken and included in your report as a courtesy. The Inspector CANNOT use photos provided by anyone else for the inspection report. Any photos included in the report must be taken by the Inspector only, with the Inspector's camera only!



ABOUT YOUR INSPECTION CONTINUED

Please carefully read your entire Inspection Report. Call your inspector after you have reviewed your report, so we can go over any questions you may have. Remember, when the inspection is completed and the report is delivered, we are still available to you for any questions you may have, throughout the entire closing process.

Properties being inspected do not "Pass" or "Fail." - The following report is based on an inspection of the visible areas of the structure; inspection may be limited by vegetation, height restrictions, weather and possessions. Depending on the age of the structure, some items like GFCI outlets may not be installed; this report will focus on safety and function, not current building codes. This report identifies specific non-building code, non-cosmetic concerns that the inspector feels may need further investigation or repair. It is NOT a requirement that a home being sold be brought up to today's building code standards.

We advise you to check all building permits for all areas of the structures present, a home inspection is NOT a building code violation inspection. If the proper building permits have not been obtained and/or do not have final building inspection signatures, then you cannot assume that these areas were installed to applicable building codes. Further investigation beyond the scope of the home inspection may be needed.

"Needs to be serviced" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed and the item should be further evaluated. Often the items discovered by the Inspector are only clues to a potentially larger issue, further evaluation may uncover other items the inspector did not see or disclose during the inspection.

For your safety and liability purposes, we recommend that licensed contractors further evaluate and repair any and all concerns and defects noted in the report.

Lateral Sewer Line Camera Inspection: Underground drains cannot be viewed by the Inspector and can often have internal issues that do not reveal themselves during the home inspection. We highly advise you to have a sewer camera inspection prior to the release of inspection contingencies.

Every home or structure is different, therefore may be inspected in various formats. Inspections can take anywhere from 1 to 4 hours depending on the size of the structure or the age of the structure being inspected. The condition of the home or structure being inspected may also play a role in the time it takes for the inspection; the more defects there are to document, the longer the inspection will take. Inspection methods are generally the same among all inspectors, however experience and inspector's personal preferences may differ between Inspectors. This is the same for report writing. While Inspectors are provided with common statements to use in their report, they are also given the freedom to narrate or edit comments as they see fit for each inspection. The Inspector cannot predict or find every defect in a structure being inspected. The time frame for an inspection only allows the Inspector to examine areas in a location by location order. If a defect arises in another area of the structure (including the exterior) for which this defect was not present or visible at the time of the inspection, then the Inspector cannot be liable for notifying you of the defect. *For example:* The inspector evaluates the exterior of the home first and finds no defects...but later runs the water at the kitchen sink and the water is not visibly leaking under the kitchen sink, but somehow is leaking through the exterior wall to the exterior, the Inspector will not back-track and re-inspect the exterior and will likely not see this or note the defect.

During the inspection, the water is turned on at all visible and/or accessible fixtures at the structure. In most cases, no water fixtures should be left unattended while turned on. There is no set standard time frame for how long each fixture should be operated. The Inspector will operate the water fixtures as long as is needed to determine if both the hot and/or cold water is operating at the designated fixture. Leaks can only be documented if they are visible at the time of operating the designated fixture. Future leaks cannot be predicted! A home inspector cannot determine if there are plumbing leaks inside walls or ceilings unless visible moisture or explicit signs of moisture are present and visible at the time of the inspection. This inspection does not include confirmation of water conservation devices at any fixture.

Note that this report is a snapshot in time and not a prediction of future conditions. We recommend that you or your representative carry out a final walk-through inspection immediately before closing to check the condition of the property, using this report as a guide. Conditions can change at any time during escrow time periods. You are 100% responsible for verifying all conditions prior to close of escrow.

THIS REPORT IS NON-TRANSFERABLE TO ANOTHER PARTY, NO EXCEPTIONS.

THANK YOU FOR USING ELITE GROUP INSPECTION PROFESSIONALS

INSPECTION AGREEMENT

BY ACCEPTANCE OF OUR INSPECTION REPORT YOU AGREE TO THE TERMS OF THIS AGREEMENT AND THE TERMS AND CONDITIONS OF THE CONTRACT. YOU FURTHER AGREE THAT YOU UNDERSTAND THE LIMITATIONS OF A HOME INSPECTION AND HAVE READ THE DISCLAIMER PAGE OF THIS REPORT.

SCOPE OF THE INSPECTION / REPORT

We will perform a non-invasive visual examination designed to identify material defects in the systems, structures, and components of buildings located on the property to be inspected, as they exist at the time of the inspection. Our inspection will be limited to those specific systems, structures and components that are present and visually accessible. We will only operate components and systems with normal user controls and as conditions permit. Unless we agree otherwise, we will only inspect the primary building, and its associated primary parking structure on the property. Out structures are not included in our inspection: this exclusion encompasses exterior BBQs, appliances, fire pits, fire places, play equipment, ponds or fountains, sheds, workshops, lean-to structures, barns, etc.. We will also provide you with a written report that describes and identifies the inspected systems, structures and components and any visible material defects observed at the time of the inspection. We may amend the report within twenty-four (24) hours after completing the inspection.

RE-INSPECTION: A re-inspection may be scheduled with our office as needed to re-evaluate specific items that may have been repaired since our original inspection or that may have been obstructed and not visible or accessible during the original inspection. The fee for a re-inspection varies upon how many items are to be re-inspected and/or the length of time required to perform the re-inspection. A re-inspection is completed only for the items specified in writing by the buyer or buyer's Agent at the time of the re-inspection. A re-inspection does not include a complete inspection of the entire home or property, however the Inspector may update the inspection report with additional defects observed at the re-inspection that may not have been visible or accessible during the original inspection. It is recommended that you obtain all the necessary building permits, contractor receipts and any warranties provided by the manufacturer/installer/contractor for the repaired or replaced items. Unless we agree otherwise, we will perform the inspection, and issue the report, in accordance with the mandatory parts of the current Standards of Practice (Residential Standards - Four or Less Units) of the International Association of Certified Home Inspectors ("the InterNACHI Standards") and subject to the Definitions, Scope, Limitations, Exceptions and Exclusions in the InterNACHI Standards. Terms in this Agreement have the same meaning as the defined terms in the InterNACHI Standards. The InterNACHI Standards are available from InterNACHI's website: <http://www.nachi.org/>

IF YOU DISCOVER A DEFECT FOR WHICH YOU THINK WE MAY BE LIABLE TO YOU, YOU MUST NOTIFY US AND GIVE US A REASONABLE OPPORTUNITY TO RE-INSPECT THE PROPERTY BEFORE YOU REPAIR THE DEFECT. FAILURE TO FOLLOW THIS PROCESS WILL RESULT IN VOIDING THIS AGREEMENT AND CONTRACT. YOUR NOTICE MUST BE IN WRITING, INCLUDE A SIGNED COPY OF THIS AGREEMENT, AND BE MAILED TO OUR CORPORATE OFFICE:

Elite Group Inspection Professionals/Attn: Inspector Supervisor 9480 Utica Ave Ste 608 Rancho Cucamonga, CA 91730

OUR LIABILITY TO YOU FOR CLAIMS ARISING FROM OUR INSPECTION OR OUR REPORT, WHETHER SOUNDING IN TORT OR CONTRACT, WILL NOT BE MORE THAN THE LESSER OF ACTUAL DAMAGES OR THREE (3) TIMES THE INSPECTION FEE.

TEGPIS (The Elite Group Property Inspection Service, Inc.) AND CLIENT AGREE THAT CLIENT CANNOT FILE A LEGAL ACTION AGAINST TEGPIS OR ITS EMPLOYEES, WHETHER SOUNDING IN TORT OR CONTRACT, MORE THAN ONE YEAR AFTER THE CLIENT DISCOVERS, OR WITH THE EXERCISE OF REASONABLE DILIGENCE SHOULD HAVE DISCOVERED THE BREACH OR MATERIAL DEFECT.

Our report is NOT a warranty of the items inspected. However, The Elite Group may offer you additional warranties through a third party service provider. In all cases, you must contact your home warranty company first for any issues that arise after the date of the original home inspection. Failure to do so may result in voiding your home warranty.

Additional questions or concerns can be addressed through our Customer Service website: <https://eliteinspections.com/explanation-of-limited-guarantee>

Please read the "About Your Inspection" and "Disclaimers" pages prior to filing any online claims as this will help you to determine if your claim is valid and within the scope of the home inspection.

CONFLICT OF INTEREST DISCLOSURE AND STATEMENT OF COMMITMENT

Our goal is to provide valuable and unbiased information that helps consumers make informed decisions. A portion of our business may be based on relationships with other professions- real estate sales professionals, lawyers, lenders, vendors, etc., and our reports sometimes conflict with the business interests of these parties. We do not allow these relationships to compromise the integrity of our service. However, they do enable us to deliver more value to our clients. Our reports are intended to accurately reflect our impartial professional opinion, without exception.

YOU MUST PAY THE INSPECTION FEE AND SIGN THE CONTRACT BEFORE WE CAN DELIVER THE REPORT TO YOU.



OVERVIEW

1. Inspection Package - Directional Marker - Utilities Status - Occupancy - Other Info

Inspection type: **Elite** Home Inspection (Standard Inspection)

Single Family Residence

Front door faces North (approximate)

All Utilities are ON for this inspection

Vacant structure - some areas contain staging materials or personal items left behind - these items are not moved and will prevent a complete inspection and limit visible access to some areas (this applies to all areas inside and outside of the structure being inspected).

2. Main Utilities Location

- Main water valve shut off location: North side of structure
- Main gas valve shut off location: Exterior of garage
- Main electrical panel location: Exterior of garage

3. Who is present at the inspection?

- Buyer not present during inspection
- Buyer's agent not present during inspection
- Seller's agent not present during inspection
- Owner not present during inspection
- Lock box code provided to Inspector

4. Wall materials throughout the structure

Drywall • Wall paper

5. Ceiling materials throughout the structure

Drywall

6. Floor materials throughout the structure

Carpet • Tile

7. Window materials/type throughout the structure

Double pane • Wood framed • Fixed frame or stationary type (does not open or close) • Horizontal sliding type (one window slides while the other remains stationary) • Crank style

8. IMPORTANT NOTES

- This inspection is intended to identify major material defects only. Minor and cosmetic issues are excluded from inspection and report, but may be included in some comments as a courtesy. Small nail holes, drywall nail pops, small cracks, chipped areas, dirty areas and cosmetic blemishes are considered cosmetic in most cases.
- Small cracking may be found throughout the structure, this is normal for California construction and generally caused by settling, earthquake, and wind conditions.
- It is common for many Sellers to patch, paint or touch up areas of the structure prior to selling. Recent paint or patching may cover known past defects not detectable by the Inspector - consult the seller/disclosures for all past repairs. It is beyond the scope of the inspection for the Inspector to note all patched areas locations or to try to determine the reason for any patches or past repairs.
- Additional photos are available upon request, please contact your inspector directly.



INTERIOR

Interior page will include all bedroom items and the walls ceilings, floors, windows, and doors of bathrooms, kitchen, and laundry area. "Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Wall Conditions

Observations:

- No major visible defects observed at the time of inspection

2. Ceiling Conditions

Observations:

- No major visible defects observed at the time of inspection
- Small cracks/holes/chipped/dirty areas/cosmetic blemishes observed - typical for age of structure



Small cracks/holes/chipped/dirty areas/cosmetic blemishes observed - typical for age of structure



Small cracks/holes/chipped/dirty areas/cosmetic blemishes observed - typical for age of structure

3. Ceiling Fans

Observations:

- Note: It is not possible to determine the method of attachment to the ceiling. These units are heavy and due to the designed movement, must have the proper style mounting boxes for correct and safe attachment. Recommend confirming the method of attachment prior to use. This may require the removal of the fan or insulation to visually verify proper support.
- Operated at time of inspection
- Normal wear for age, no major visible defects
- **Did not operate - needs to be serviced or further evaluated - kitchen area**



Did not operate - needs to be serviced or further evaluated - kitchen area



Did not operate - needs to be serviced or further evaluated - kitchen area

4. Floor Conditions

Observations:



- Worn and stained areas - typical for age of the material
- Chipped areas - recommend **maintenance** and fill as needed
- Torn/frayed carpet - typical for age of materials, signs of wear - master
- **Worn/stained heavily in areas - needs to be serviced**




Torn/frayed carpet - typical for age of materials, signs of wear - master

Torn/frayed carpet - typical for age of materials, signs of wear - master

Chipped areas - recommend maintenance and fill as needed

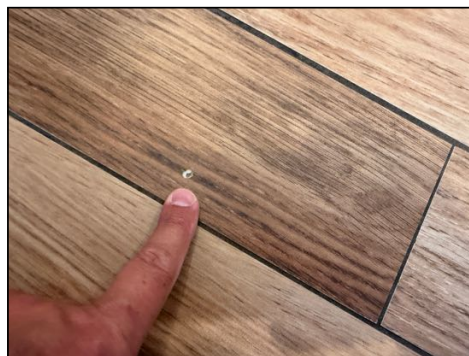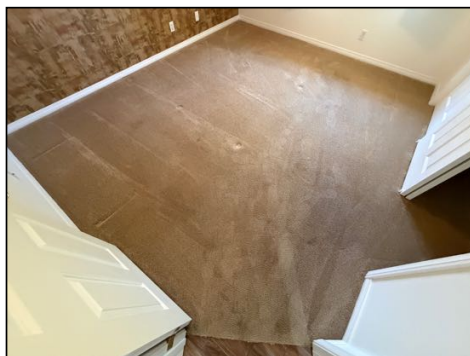

Chipped areas - recommend maintenance and fill as needed

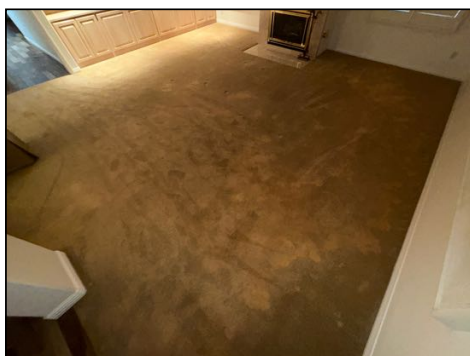

5. Window Conditions

Observations:

- Accessible windows were tested and operated at time of inspection
- Visible/accessible windows show signs of normal wear for age with no major visible defects at the time of the inspection
- Recommend general window maintenance/lubrication and weather tight service
- All crank windows are difficult to close – service needed



All crank windows are difficult to close – service needed




All crank windows are difficult to close – service needed

6. Doors

Observations:

- Operated at time of inspection
- Normal wear for age - no major visible defects at the time of the inspection
- Recommend routine maintenance on hardware and weather seals on all exterior doors
- Door opens into hallway - may be problematic during emergency egress situation - needs to be serviced

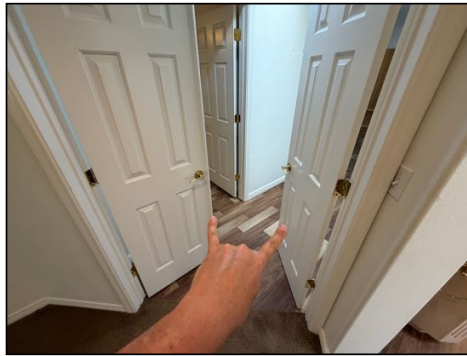

Door opens into hallway - may be problematic during emergency egress situation - needs to be serviced

7. Screen Doors

Observations:

- Operated at time of inspection
- Worn/weathered door - typical for age

8. Sliding Glass Doors

Observations:

- Slider operated at the time of the inspection
- Normal wear at the time of the inspection with no major visible defects
- Tempered glass label observed
- Recommend service/lubrication and general maintenance to extend the life of the slider

9. Sliding Door Screens

Observations:

- Operated at time of inspection
- Normal wear at the time of the inspection with no major visible defects


10. Fireplaces

Location/s: Master bedroom • Living room • Kitchen

Prefabricated Vent Type

Observations:

- Normal wear at the time of the inspection - no major visible defects
- Could not fully inspect due to ash/soot/debris/cosmetic logs/materials inside the fireplace
- Damper stop clamp was present at the time of the inspection
- Small cracks/worn areas present - typical for age
- Recommend fire caulk/sealing any holes/gaps/cracks
- Gas log lighter present
- Gas valve tested and operated at the time of the inspection
- Gas valve key difficult to operate due to location of cabinet door
- Flex/aluminum gas line in firebox without cosmetic logset present - needs to be serviced
- **Raised hearth at fireplace in kitchen creates a trip hazard – exercise caution**

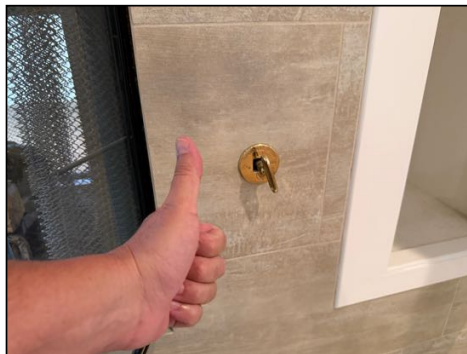





Flex/aluminum gas line in firebox to loglighter without cosmetic logset present - needs to be serviced



Raised hearth at fireplace in kitchen creates a trip hazard – exercise caution



Small cracks/worn areas present - typical for age

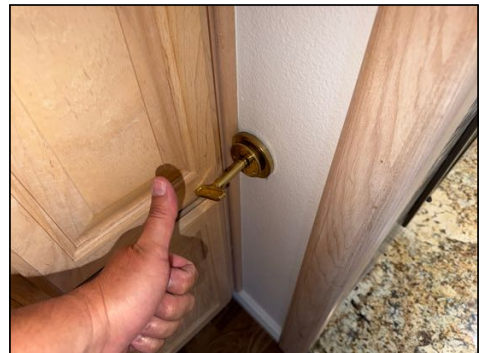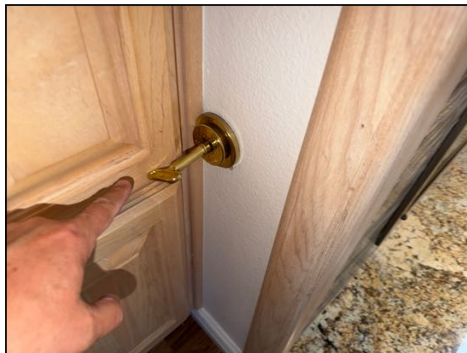

Gas valve key difficult to operate due to location of cabinet door

11. Electrical

Observations:

- A representative number of receptacles and switches were tested and found to be operational at time of inspection
- Some switches have unknown function - not inspected, inquire with seller regarding operation
- Outlets/switches had normal wear for age - no major visible defects
- Some bulbs defective/missing/light(s) did not function - check bulbs/consult electrician to further evaluate



Some bulbs defective/missing/light(s) did not function - check bulbs/consult electrician to further evaluate



Some switches have unknown function - not inspected, inquire with seller regarding operation



Some switches have unknown function - not inspected, inquire with seller regarding operation

12. Closets

Observations:

- Normal wear for age with no major visible defects

13. Cabinets

Observations:

- Normal wear for age of material - no major visible defects

14. Door Bells

Observations:

- Operated at time of inspection front, video type doorbell present


15. Smoke Detectors

Observations:

- For safety purposes we recommend that smoke detectors be placed in all hallways outside of sleeping areas (bedrooms) and on all levels of multi-level dwellings. For longer hallways and/or oddly located bedrooms, multiple smoke detectors are suggested and should be placed at each end of the hallways to ensure optimum safety alert.
- All smoke detectors are visibly too old – not tested – replacement needed
- Smoke detector installed to close to ceiling fan blades/HVAC registers - may be problematic - recommend relocating to a more appropriate location, at least 3 feet from fan/register



All smoke detectors are visibly too old – not tested – replacement needed

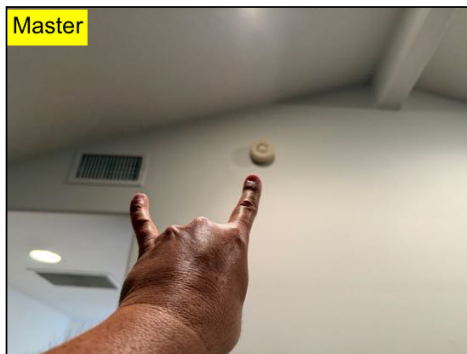

Smoke detector installed to close to ceiling fan blades/HVAC registers - may be problematic - recommend relocating to a more appropriate location, at least 3 feet from fan/register





16. Carbon Monoxide Detectors

Observations:

- For safety purposes we recommend that carbon monoxide detectors be placed in all hallways outside of sleeping areas (bedrooms) and on all levels of multi-level dwellings. For longer hallways and/or oddly located bedrooms, multiple carbon monoxide detectors are suggested and should be placed at each end of the hallways to ensure optimum safety alert.
- **No carbon monoxide detector present - we recommend installation per requirements prior to the close of escrow**

BATHROOMS

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Counters

Observations:

- Some counter areas not visible for inspection due to personal storage
- Counter has normal wear for age at time of inspection with no major visible defects
- Recommend grout/sealer/stone maintenance

2. Cabinets


Observations:

- Some interior cabinet areas not visible for inspection due to personal storage
- Normal wear for age of material - no major visible defects

3. Sinks

Observations:

- Fixture operated at the time of the inspection
- Irregular spray when operated - needs to be serviced - both in hall bathroom
- Drain stopper not operating properly - needs to be serviced - hall bathroom, left sink and bathroom near kitchen
- Hot fixture handle leaks above countertop when operated – master bathroom, right sink

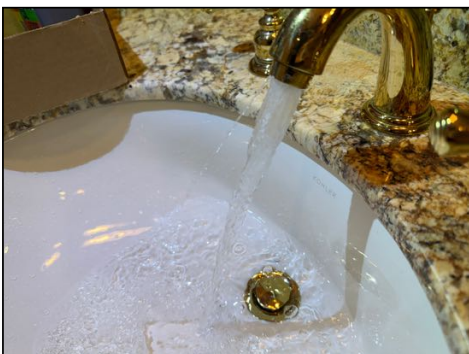

Irregular spray when operated - needs to be serviced - both in hall bathroom




Hot fixture handle leaks above countertop when operated – master bathroom, right sink



Drain stopper not operating properly - needs to be serviced - hall bathroom, left sink and bathroom near kitchen



Irregular spray when operated - needs to be serviced - both in hall bathroom

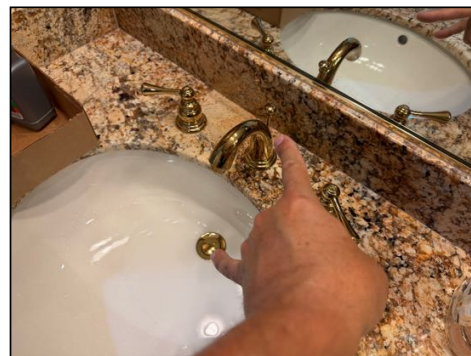

Drain stopper not operating properly - needs to be serviced - hall bathroom, left sink and bathroom near kitchen

4. Mirrors

Observations:

- Mirror functional at time of inspection
- Normal wear for age of material with no major visible defects

5. Bath Tubs


Observations:

- Fixture was tested and operating at the time of the inspection
- Fixture had normal wear for age at the time of the inspection - no major visible defects
- Tub has normal wear for age at the time of the inspection - no major visible defects

6. Showers

Observations:


- Fixture was tested and operating at time of inspection via normal fixture controls
- Fixture had normal wear for age of material - no major visible defects
- Shower arm faceplate is loose at the wall - recommend securing and sealing this area - bathroom near kitchen
- Showerhead has extremely low water pressure – bathroom near kitchen – service needed
- Showerhead not spraying properly – master and hall bathroom – service needed
- Spray wand has extremely low water pressure – hall – service needed
- Shower diverter to wand/body sprays not operating properly - needs to be serviced

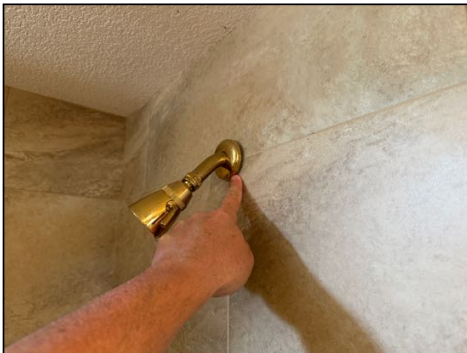

Shower arm faceplate is loose at the wall - recommend securing and sealing this area - bathroom near kitchen




Showerhead not spraying properly – master and hall bathroom – service needed

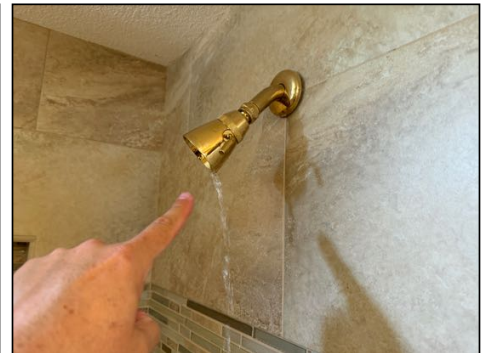

Showerhead has extremely low water pressure – bathroom near kitchen – service needed



Showerhead not spraying properly – master and hall bathroom – service needed

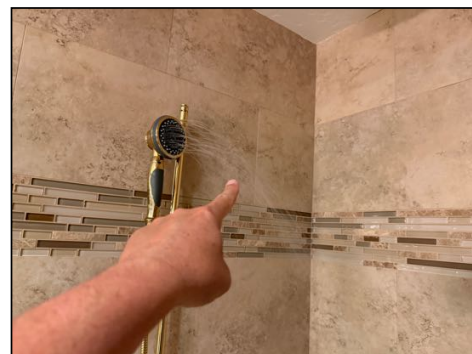

Spray wand has extremely low water pressure – hall – service needed

7. Shower Walls

Observations:

- Tile and grout present
- Worn tile/grout - typical for age - recommend routine grout and sealer maintenance

- Cracked/loose/missing grout in areas - recommend grout and sealer - master and bathroom near kitchen



Cracked/loose/missing grout in areas - recommend grout and sealer - master and bathroom near kitchen

Cracked/loose/missing grout in areas - recommend grout and sealer - master and bathroom near kitchen

8. Enclosures / Shower doors


Observations:

- Operational at time of inspection - Tempered glass label observed
- Normal wear for age at the time of the inspection - no major visible defects

9. Toilets

Observations:

- Tested and operational at time of inspection via normal fixture controls, flush test performed
- Toilet has normal wear for age at the time of the inspection - no major visible defects
- **Water shutoff under toilet corroded - needs to be serviced - this will be an ongoing maintenance issue for ALL plumbing valves - master**

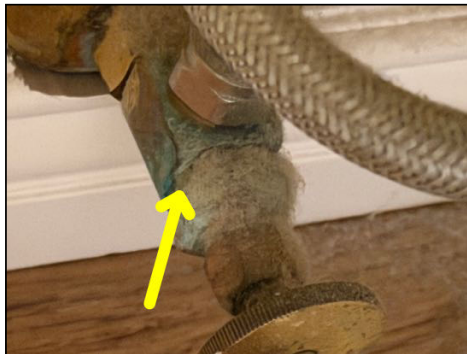

Water shutoff under toilet corroded - needs to be serviced - this will be an ongoing maintenance issue for ALL plumbing valves - master

10. Plumbing

Observations:

- Operational at time of inspection via normal fixture controls with no major visible defects
- Angle stops/hoses/drain pipes are in a normal condition for their age - no major visible defects
- No visible leaks found at the time of the inspection after running water at fixtures

11. Electrical

Observations:

- A representative number of receptacles and switches were tested and found to be operational at time of inspection
- Outlets/switches had normal wear for age - no major visible defects

12. GFCIs

Observations:

- Tested and operational at time of inspection via normal control
- Master control **GFC** located in: master bathroom reset switch is located in electrical subpanel in master closet – reset switch for hallway and bathroom near kitchen is located in main electrical panel



13. Exhaust Fans

Observations:

- Operated at time of inspection
- Normal wear for age with no major visible defects



KITCHEN

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Counters

Observations:

- Counter has normal wear for age at time of inspection with no major visible defects
- Tile and grout is worn - recommend grout and sealer maintenance
- **Cracked/loose/missing grout in areas – service needed**



Cracked/loose/missing grout in areas – service needed

2. Cabinets

Observations:

- Worn cabinets with loose/worn hardware - typical for age



Worn cabinets with loose/worn hardware - typical for age

3. Pantry

Observations:

- Some pantry areas not visible for inspection due to personal storage
- Normal wear for age with no major visible defects

4. Sinks

Observations:

- Fixture operated at the time of the inspection
- Normal wear at fixture/sink for age of material with no major visible defects

5. Spray Wands

Observations:

- Operational at time of inspection



6. Dishwashers

Observations:

- The dishwasher inspection is limited and does not include an inspection of the water pump or any hoses inside or beneath the unit. The home inspector cannot predict the remaining life of the dishwasher or any parts within the dishwasher; nor can the home inspector tell you if or how well the dishwasher actually cleans or dries dishes. This inspection allows for one fill and one drain cycle only, the Inspector does not run the dishwasher for any full cycles.
- Tested and operational (one fill and drain cycle only, not full cycle) at time of inspection via normal controls
- Dishwasher has normal wear for age with no major visible defects
- Drained properly during inspection
- No visible leaks found at the time of the inspection
- **Unit not fastened to underside of countertop - tip hazard - needs to be serviced**




Unit not fastened to underside of countertop - tip hazard - needs to be serviced



7. Garbage Disposals

Observations:

- The garbage disposal has a limited inspection, the Inspector cannot predict the remaining life of the garbage disposal nor determine how well the garbage disposal disposes of food or other items. The sharpness or adequacies of the internal blades is not determined during the home inspection.
- Tested and operational at time of inspection via normal controls
- Normal wear for age - no major visible defects
- No visible leaks at the time of the inspection

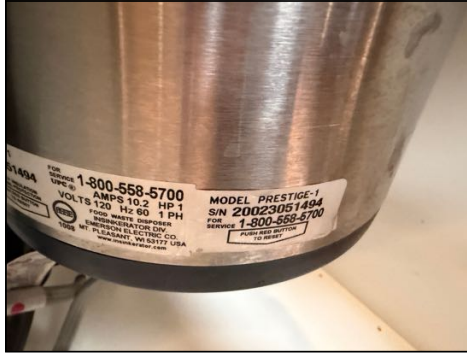

8. Plumbing

Observations:

- Operational at time of inspection via normal fixture controls with no major visible defects
- Angle stops/hoses/drain pipes are in a normal condition for their age - no major visible defects
- No visible leaks found at the time of the inspection after running water at fixtures

9. Ranges

Observations:

- The range or cooktop has a limited inspection, the Inspector cannot predict the remaining life of the unit nor determine the BTUs output by each burner or if/how well the burners will cook food. For gas units - gas leaks cannot be detected with this inspection - a full evaluation by the Gas Company of all gas supplied appliances is recommended beyond this inspection.
- Gas supplied unit
- Tested and operational at time of inspection via normal controls
- Normal wear for age - no major visible defects



10. Ovens

Observations:

- The "Bake" feature is the only feature operated during a home inspection; convection, broiling, roasting, warming drawers and other features are not tested during the oven inspection. Ovens are tested for basic heating element functionality. The oven cannot be tested to each incremental temperature setting or determine if adequate cooking temperatures can be achieved, nor if temperatures are calibrated with oven settings. We cannot determine if or how well the oven cooks food nor can we predict the remaining life left for the unit. For gas units - gas leaks cannot be detected with this inspection - a full evaluation by the Gas Company of all gas supplied appliances is recommended beyond this inspection.




- Electric supplied unit
- Tested and operational at time of inspection via normal controls
- Normal wear for age - no major visible defects



11. Microwaves

Observations:

- The microwave is tested with a microwave tester or damp sponge/cloth only. No other features of the microwave are tested or evaluated for cooking. The home inspector cannot predict the remaining life left in the unit.
- Tested and operational at time of inspection via normal controls
- Normal wear for age - no major visible defects

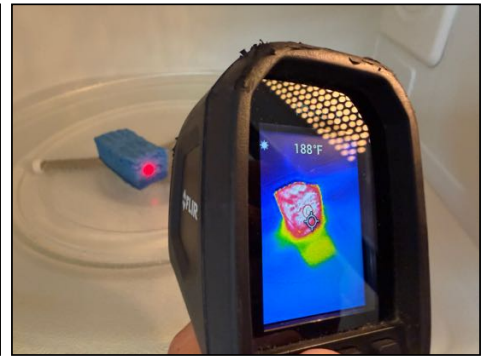

12. Exhaust Vents

Exterior vented • Downdraft system present

Observations:

- The exhaust fan/vent is tested using the normal controls only. No smoke testing or other testing is done to determine the CFMs or how well the unit evacuates air. The home inspector cannot predict the remaining life left in the unit.
- Tested and operational at time of inspection via normal controls
- Normal wear for age - no major visible defects



13. Electrical

Observations:

- A representative number of receptacles and switches were tested and found to be operational at time of inspection
- Outlets/switches had normal wear for age - no major visible defects

14. GFCIs

Observations:

- Tested and operational at time of inspection via normal control
- Master control GFCI located in: breaker inside main electrical panel



LAUNDRY AREA

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Laundry Area Location

Separate laundry room present

2. Counters

Observations:

- Counter has normal wear for age at time of inspection with no major visible defects

3. Cabinets

Observations:

- Normal wear for age of material - no major visible defects

4. Dryer Vent

Observations:

- Dryer vent should be cleaned periodically to prevent lint fire hazards
- Could not fully inspect the dryer vent in the laundry area, it is obscured by cabinetry/washer/dryer
- Normal wear on day of the inspection - no major visible defects



5. Plumbing

Observations:

- Visible fixtures had normal wear for age at the time of the inspection - no major visible defects
- No visible leaks at time of inspection



6. Wash Basin

Observations:

- Operated with normal wear at time of inspection
- There were no visible leaks at the time of the inspection

7. Gas Valve

Observations:

- The inspector does not check for gas leaks, consult the Gas Company to evaluate all gas areas prior to occupancy
- Normal wear at valve - no major visible defects at the time of the inspection



8. Electrical

Observations:

- Visible switches/outlets have normal wear for their age - no major visible defects visible at the time of the inspection

9. GFCIs

Observations:

- Recommend upgrading all receptacle to GFCI protection within 6 feet of all potential wet locations, unless the receptacles are on a dedicated circuit for appliances.
- None visible

10. Exhaust Fan

Observations:

- Operated at time of inspection
- Normal wear for age with no major visible defects



HEATING/AIR CONDITIONING

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Heaters

Location: Garage • Exterior closet/cabinet
Type: Gas fired forced hot air • Split system
Observations:

- Operated at time of inspection
- Visible areas of unit have normal wear for age at the time of the inspection - no major visible defects - recommend seasonal service and maintenance to extend the life of the unit
- Newer unit/not original to the structure - check all installation permits to ensure that this unit was installed to proper code



2. A/C Evaporator Coil Box

Observations:

- The visible areas of the coil box have normal wear at the time of inspection - no major visible defects
- **Air leaking at refrigerant or condensate line connection areas - needs to be sealed to prevent air loss - both**



Air leaking at refrigerant or condensate line connection areas - needs to be sealed to prevent air loss - both



Air leaking at refrigerant or condensate line connection areas - needs to be sealed to prevent air loss - both




Air leaking at refrigerant or condensate line connection areas - needs to be sealed to prevent air loss - both

3. Venting

Observations:

- The visible areas of the vent have normal wear at the inspection - no major visible defects
- Recommend securing and sealing all vent connections

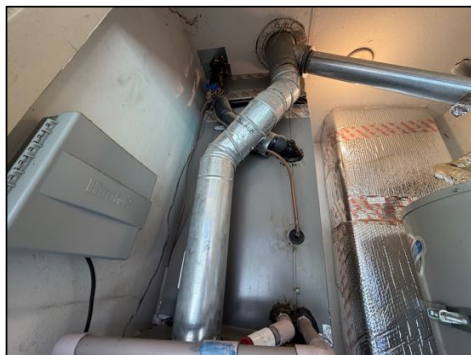

Recommend securing and sealing all vent connections



Recommend securing and sealing all vent connections

4. Air Supply

Observations:

- *Recommend seasonal service and maintenance to ensure that all areas are sealed/cleaned/dry and functioning normally at all times*
- Visible areas have normal at time of inspection - no major visible defects

5. Gas Supply Valves and Pipes

Observations:

- Normal wear at time of inspection - no major visible defects

6. Electrical

Observations:

- Operating properly at the time of the inspection - no major visible defects

7. Thermostats

Observations:

- Digital type present - functional day of the inspection



8. Filters

Location: Located inside heater cabinet below the blower motor • Electronic air filter(s) present - not inspected

Observations:

- A seasonal HVAC service contract is recommended to ensure that all filters are changed/cleaned regularly or as needed
- We recommend that the filters be changed or cleaned every 3 to 6 months depending on the usage of the heating and air conditioning systems



9. Registers

Observations:


- Representative number tested and functional day of the inspection
- All visible register covers have normal wear at the time of the inspection - no major visible defects



Heater Temperature



Temperature at Air Return

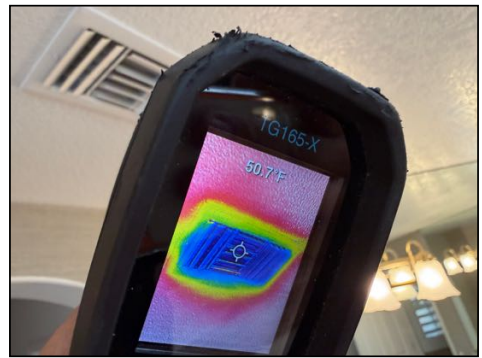

A/C Temperature



Heater Temperature



Temperature at Air Return



A/C Temperature

10. Combustion Air

Observations:

- **Combustion air** appears to be adequate at the time of the inspection

11. Heater Enclosures

Observations:

- Visible areas have normal wear at time of inspection - no major visible defects - recommend seasonal cleaning and maintenance to ensure proper and safe operation
- Visible areas of the enclosure are worn/dirty - typical for age - recommend having this unit and enclosure professionally cleaned and tuned to ensure proper and safe operation

12. Platforms/Bases

Observations:

- Recommend seasonal servicing and maintenance to ensure sealing holes and gaps in the heater base
- Visible areas have normal wear at time of inspection - no major visible defects - recommend seasonal servicing and maintenance to ensure sealing holes and gaps in the heater base
- Visible areas are worn/dirty - recommend cleaning the base areas and sealing the base of the unit as part of the preventative maintenance

13. Refrigerant Lines

Observations:



- Normal wear day of the inspection - no major visible defects - recommend annual/seasonal maintenance to check and service insulation on refrigerant lines as needed



14. Air Conditioning Compressors

Location: Electric unit - exterior west • Electric unit - exterior of garage
Observations:

- Operated at the time of inspection
- Visible areas of unit have normal wear for age at the time of the inspection - no major visible defects - recommend seasonal service and maintenance to extend the life of the unit
- Unit is a newer unit/not original to the structure - check all installation permits to ensure that this unit was installed to code
- Unit is not secured - we recommend strapping the unit to a base

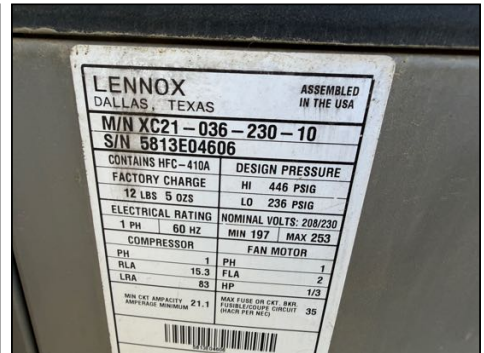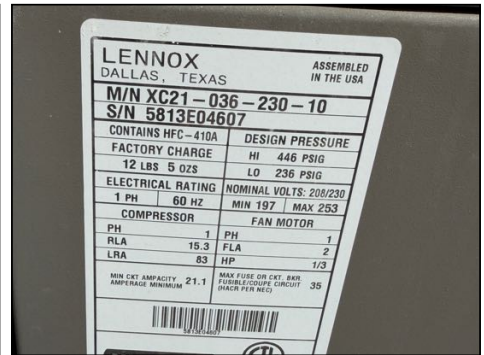

Unit is not secured - we recommend strapping the unit to a base

WATER HEATERS

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required. Please review the manufacturer's specifications for installing water heater vents, condensation drain lines, and gas line requirements, as these can vary by manufacturer and model and not identified by the inspector.


1. Water Heaters Condition

Number of gallons: 50 gallons X2


Location/s: Garage • Exterior closet

Observations:

- Operated at the time of the inspection - Gas unit
- Visible areas of unit have normal wear for the age at the time of the inspection with no major visible defects
- This is a newer unit (not original to this structure) - check all installation permits to ensure that this unit was installed to city code and manufacturer specifications
- **Unit old and appears to be nearing end of useful life - we recommend that you budget for a replacement**

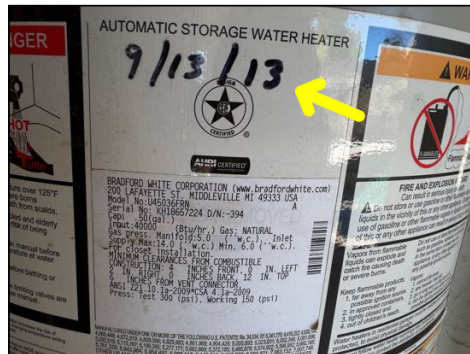

Unit old and appears to be nearing end of useful life - we recommend that you budget for a replacement

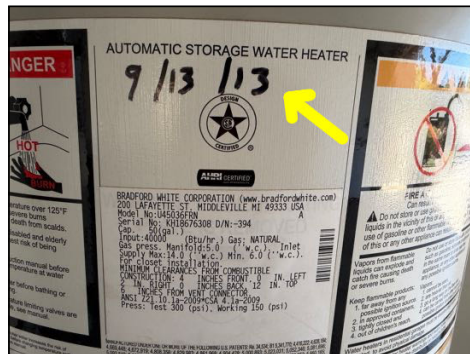

Unit old and appears to be nearing end of useful life - we recommend that you budget for a replacement

2. Venting

Observations:

- Normal wear day of the inspection - no major visible defects
- Recommend sealing all connections at venting



Recommend sealing all connections at venting



Recommend sealing all connections at venting

3. Plumbing

Material type: Copper • Stainless steel flex lines • Partially insulated lines - some plumbing lines are not visible • Recommend installing an **expansion tank** at the water heater due to the presence of a pressure regulator at the main water valve

Observation:

- Normal wear at time of inspection - no major visible defects or leaks found at the time of the inspection



4. Temperature Pressure Release Valves

Observations:

- Normal wear on the day of the inspection - no major visible defects

5. Overflow Line/s

Material type: Copper • CPVC

Observations:

- Normal wear on the day of the inspection - no major visible defects



6. Water Heater Temperature

Observations:

- Temperature was above 120 F at one or more fixtures within the structure, this a potential scald hazard - needs to be serviced/adjusted - consult a plumber - both



Unit in exterior closet
 Temperature was above 120 F at one or more fixtures within the structure, this a potential scald hazard - needs to be serviced/adjusted - consult a plumber - both




Unit in garage
 Temperature was above 120 F at one or more fixtures within the structure, this a potential scald hazard - needs to be serviced/adjusted - consult a plumber - both

7. Strapping

Observations:

- Standard metal type straps present - normal wear on the day of the inspection - no major visible defects
- Recommend blocking in areas where the water heater is not touching the walls

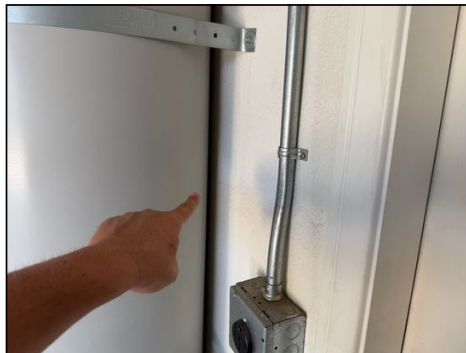


Recommend blocking in areas where the water heater is not touching the walls

8. Gas Supply Valves and Pipes

Observations:

- Normal wear at time of inspection - no major visible defects
- No sediment trap at gas supply - may have not been required at time of original installation, but is recommended

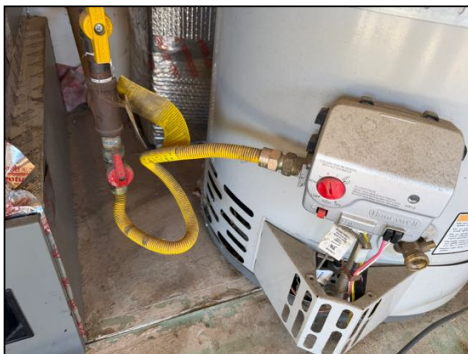

No sediment trap at gas supply - may have not been required at time of original installation, but is recommended



No sediment trap at gas supply - may have not been required at time of original installation, but is recommended

9. Combustion Air

Observations:

- Combustion air appears to be adequate at the time of the inspection

10. Platforms/Bases

Observations:

- Worn/dirty – recommend cleaning
- Recommend catch pan be installed the next time the water heater is changed



Recommend catch pan be installed the next time the water heater is changed



Recommend catch pan be installed the next time the water heater is changed

11. Enclosures

Observations:

- Worn/dirty areas - recommend cleaning
- Recommend sealing any holes/gaps if otherwise discovered in this area

ELECTRICAL/GAS SERVICE

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required. Our company is not responsible for any electrical panels that may be subject to recall, including but not limited to Square D panels or other brands. It is the responsibility of the property owner or installer to verify whether the electrical panel is impacted by any recalls. We recommend checking with the manufacturer or relevant authorities for up-to-date recall information.

1. Main Panel

Location/s: Exterior of garage

Observations:

- Normal wear for age at time of inspection - no major visible defects



2. Sub Panels

Location: Master bedroom closet

Observations:

- Normal wear for age at time of inspection - no major visible defects
- Unused breaker present – consult seller




Unused breaker present – consult seller

3. Panel Wiring

Observations:

- Wiring type: copper
- Wiring method: non-metallic sheathed cable (romex)
- Grounded panel - main ground/bonding wire observed and appears to be normal for the age of the panel
- Visible wiring has normal wear for age with no major visible defects at the time of the inspection
- Evidence of electrical alterations in the panel - **check permits** to ensure that these alterations were installed to proper building/electrical codes.
- Spliced/taped/wire nut connections present are evidence of alterations to panel – consider further evaluation by an electrician to ensure that splices are not bypassing or overloading breakers

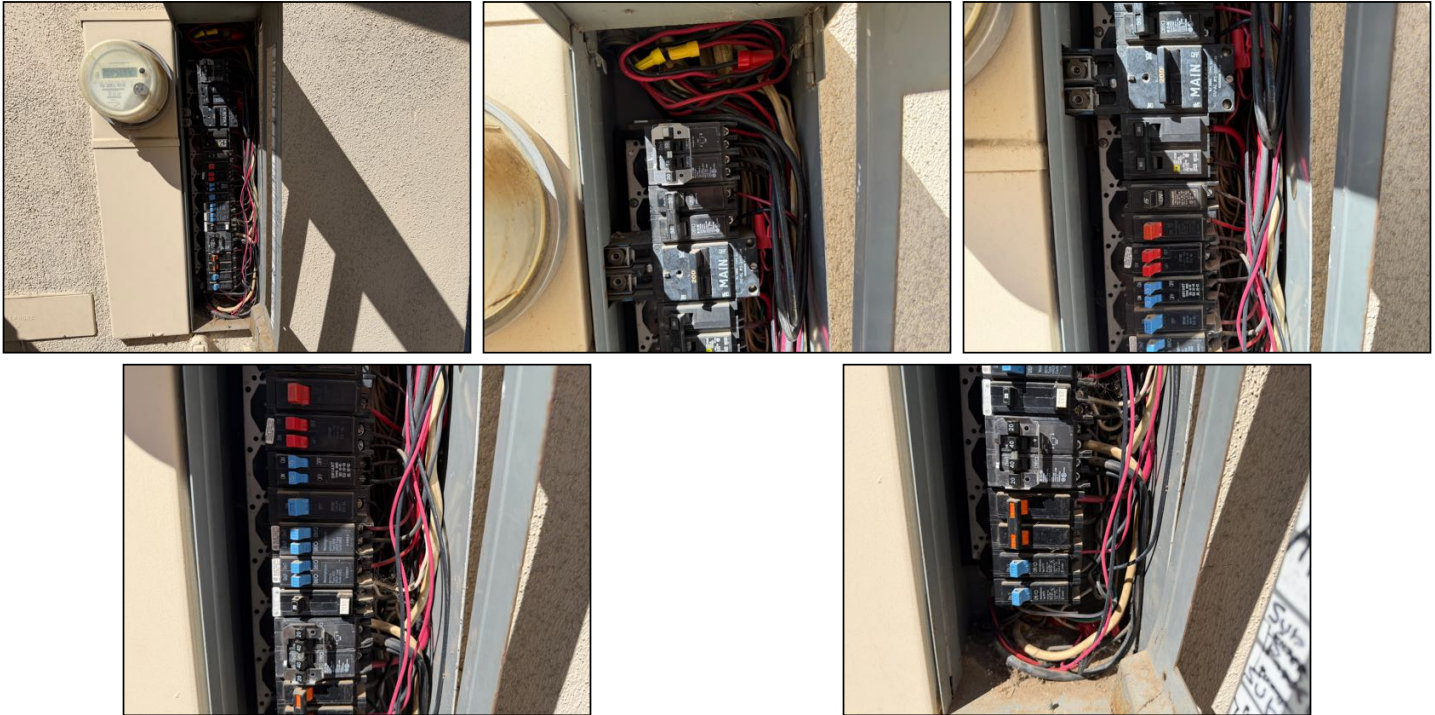

4. Breakers

Observations:

- Labels are present on panel cover - the inspector does not confirm accuracy of labels
- Normal wear for age at time of inspection - no major visible defects

5. Breaker Amp Capacity

Observations:

- Panel rating label not legible or missing - main amp rating is unknown
- Main breaker rating per label: 200 AMPS



6. Cable Feeds

Observations:

- Underground - not accessible for inspection

7. Main Gas Valve

Location: *We recommend the gas supplier be contacted to safety check all fuel gas systems/appliances during the contingency period or at least prior to purchase and occupancy. The Inspector cannot determine if a gas leak is present in any area of the home or underground at any time during the inspection.* • Exterior of garage

Observations:

- Natural gas present
- Valve has normal wear for age at the time of inspection - no major visible defects
- Recommend gas valve wrench be placed near valve for optimal preparedness
- No seismic safety valve present - recommend installation for increased safety



8. Gas Pipes and Valves

Observations:

- Worn meter/piping - typical for age and exterior weathering
- Minor rusting - typical for age - recommend rust treatment



Minor rusting - typical for age - recommend rust treatment

ATTIC AREA

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Access Entries

Observations:

- Inspection method: Partially traversed: some areas not accessible or visible due to access limitations
- Inspection method: Partially traversed: Flooring walk boards not installed in attic - inspection limited due to potential for damage to insulation or other components, areas without walk boards or clear footing were not traversed
- Location of access: Hall ceiling
- Access door is dirty with cosmetic blemishes present





Access door is dirty with cosmetic blemishes present

2. Structure

Observations:

- **Consult termite report for all wood areas in the attic**
- Cracked wood - typical for age
- Older manufactured trusses present, small wood cracking and staining present and typical for age
- No major visible staining found at the time of the inspection

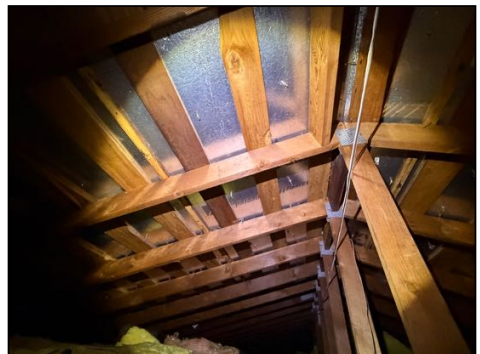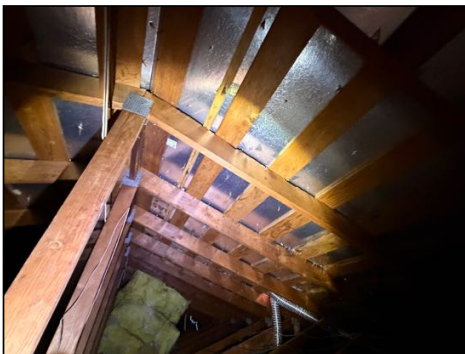



Cracked wood - typical for age



3. Insulation

Material type: Fiberglass batts with kraft paper facing • Blown in fiberglass

Approximate depth: 6-8 inches

Observations:

- No visible signs of rodents at this inspection - we recommend pest services seasonally as part of your regular home maintenance
- All visible insulation is worn/older/dirty - typical for the age of the structure

4. Ventilation

Observations:

- Existing ventilation appeared to be adequate on the day of the inspection

5. Vent Screens

Observations:

- Visible ventilation screens appeared to be functional at time of inspection

6. Exhaust Vents

Observations:

- All visible vents appear to be in normal condition where visible - no major visible defects

7. Duct Work

Observations:

- New/newer duct work present, evidence of alterations observed - check all installation permits to ensure that all areas were installed to city/county building codes

8. Electrical

Observations:

- Evidence of electrical alterations in the attic - check all permits for electrical alterations to ensure that all electrical was installed to city/county electrical code
- Visible electrical areas appear to have normal wear for age with no major visible defects at the time of the inspection
- No attic light is present in the attic

9. Plumbing

Observations:

- Vents only - no other plumbing/piping is visible for inspection
- No visible leaking at the time of inspection

GARAGE AND/OR CARPORT

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Roof Condition

Notes: Roofing area is the same as main structure - see the main roof page

2. Rafters & Ceilings

Observations:

- Drywall present with attic type access (see firewall notes for additional information)
- Cosmetic blemishes observed
- Evidence of alteration present – consult seller
- Loose tape - recommend servicing
- Holes small - recommend patch/paint as needed





Holes small - recommend patch/paint as needed




Loose tape - recommend servicing



Holes small - recommend patch/paint as needed

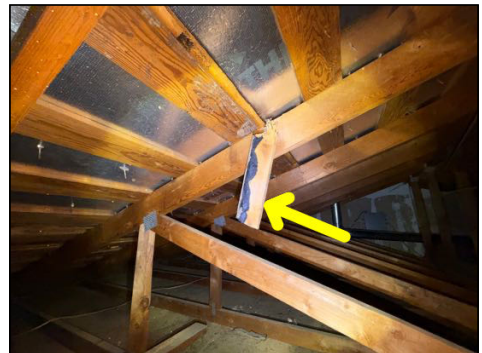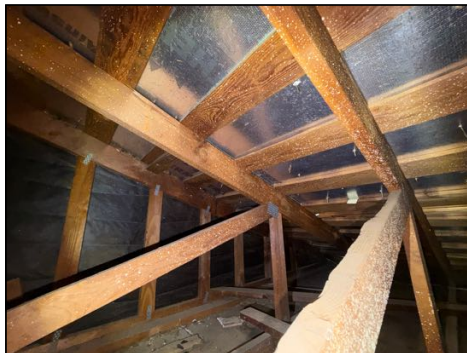

Evidence of alteration present – consult seller

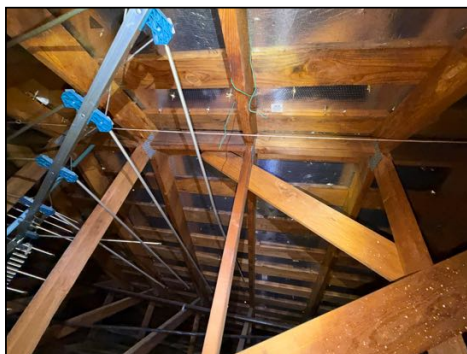

3. Main Automotive Doors

Type: Multiple garage doors present • Metal sectional

Observations:

- Normal wear for age at the time of the inspection - no major visible defects
- Recommend weather tight service/maintenance to prevent moisture intrusion around main door areas
- Door weatherstripping is missing or damaged - recommend servicing



Recommend weather tight service/maintenance to prevent moisture intrusion around main door areas



Door weatherstripping is missing or damaged - recommend servicing

4. Hardware/Springs

Observations:

- ***Garage doors require periodic maintenance and is recommended to ensure that all hardware is properly lubricated and secured***
- Normal wear at time of inspection - no major visible defects

5. Garage Door Openers

Observations:

- Opener(s) were tested using the normal wall button on the day of the inspection (remote controls are not tested)
- One unit present
- Opener(s) operated at the time of the inspection
- Normal wear at time of inspection - no major visible/functional defects



6. Garage Doors Reverse Safety Status

Observations:

- Light beam was tested; the inspector interrupted the beam during closing, the door stopped and reversed back open on the day of the inspection



7. Exterior Doors

Observations:

- Operated at the time of inspection
- Normal wear at time of inspection - no major visible defects
- Visible daylight is present around the exterior door - recommend proper weatherstrip seal and/or maintenance
- **Missing threshold - recommend installing a proper threshold in an effort to prevent weather/pest intrusion**



Visible daylight is present around the exterior door - recommend proper weatherstrip seal and/or maintenance



Missing threshold - recommend installing a proper threshold in an effort to prevent weather/pest intrusion

8. Exterior Door Screens

Observations:

- Operated at the time of inspection
- Worn screen and hardware - typical for age



9. Fire Doors

Observations:

- **Self-closing device not operating - needs to be serviced**
- **Door sticks when closing – service needed**



Door sticks when closing – service needed

Self-closing device not operating - needs to be serviced

10. Firewalls

Observations:

- Normal wear at the time of inspection - no major visible defects



11. Walls

Observations:

- **Personal items/storage/etc. are present and prevent a complete inspection of wall areas**
- Small cracks/holes/chipped/dirty areas/cosmetic blemishes observed - typical for age of structure



12. Anchor Bolts

Observations:

- Could not access or not visible due to wall coverings - **not inspected**

13. Cabinets

Observations:

- **Some interior cabinet areas not visible for inspection due to personal storage**
- Normal wear for age of material with no major visible defects
- Stained/worn areas at interior of cabinets



14. Counters

Observations:

- Counter has normal wear at time of inspection with no major visible defects

15. Slab

Observations:

- Small cracks/chipped areas - typical for the age of the materials
- Worn and stained areas - typical for age of the material



16. Electrical

Observations:

- A representative number of receptacles and switches were tested and found to be operational at time of inspection
- Outlets/switches had normal wear for age - no major visible defects

17. GFCIs

Observations:

- **Recommend upgrading all accessible receptacles below 8 feet to GFCI protection within 6 feet of all potential wet locations or where potential ungrounded power tools may be used, unless these outlets are on dedicated circuits meant for appliances.**
- **None installed - recommend upgrade for increased safety**

18. 240 Volt Receptacle

Observations:

- Has 240v service - tested and operating at time of inspection

19. Ventilation

Observations:

- None present - consult local building department/authority regarding ventilation requirements



EXTERIOR AREAS

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Stucco

Observations:

- Normal wear at time of inspection where visible - no major visible defects
- Recommend sealing any holes/gaps or cracks to prevent moisture or pest entry



Recommend sealing any holes/gaps or cracks to prevent moisture or pest entry

2. Wood Trim

Observations:

- **Consult termite report for all exterior wood**
- Worn/weathered at time of inspection where visible – recommend service and water tight maintenance
- **Deteriorated wood - needs to be serviced - consult termite report**



Deteriorated wood - needs to be serviced - consult termite report

3. Weep Screeds

Observations:

- Normal wear at time of inspection where visible - no major visible defects
- **Weep screeds encapsulated in concrete - needs to be serviced**
- **Weep screeds should be minimum 4-inches from grade - needs to be serviced**



Weep screeds should be minimum 4-inches from grade - needs to be serviced



Weep screeds encapsulated in concrete - needs to be serviced

4. Eaves & Fascia

Observations:

- **Consult termite report for all wood areas at the structure**
- Normal wear at time of inspection where visible - no major visible defects

5. Exterior Paint

Observations:

- Normal wear at time of inspection - no major visible defects
- Recommend caulking around doors and windows as necessary seasonally

6. Exterior Doors


Observations:

- ***Exterior doors require seasonal maintenance to extend lifespan and maintain weather tight seals***
- See interior section for more information
- **Consult the termite report for all wood doors/frames at this structure**
- All visible and accessible doors were tested during this inspection
- Normal wear at time of inspection - no major visible defects
- Maintain weather tight seals at all doors

7. Exterior Windows

Observations:

- ***Exterior windows require seasonal maintenance to extend lifespan and maintain weather tight seals***
- See interior section for additional information - some exterior window areas may not be visible due to height/limited access/vegetation/etc.
- **Consult the termite report for all wood windows/frames at this structure (if wood is present)**
- Windows are not original to structure – check permits for all replacements to ensure proper installation in accordance with local building codes (may not include all windows at the structure)
- Normal wear at time of inspection - no major visible defects
- Recommend weather tight service/maintenance
- Torn/bent/worn screens - needs maintenance/repair

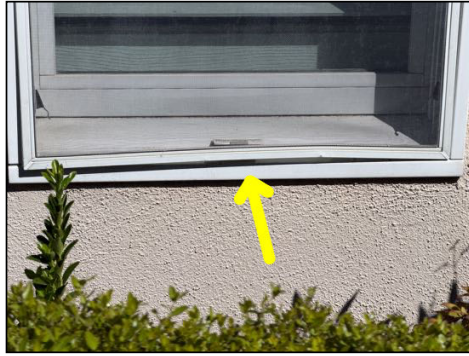

Torn/bent/worn screens - needs maintenance/repair

8. Exterior Closet(s)

Observations:

- ***Some closet areas not visible for inspection due to personal storage***
- Normal wear for age with no major visible defects
- Small holes/cracks/cosmetic blemishes present - typical for age - recommend patching and painting

FOUNDATION

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required before the close of escrow. All River Rock, block, or brick foundations and all foundations prior to 1964 we recommend further evaluation by a licensed foundation contractor. [If you're interested in having your foundation assessed by a local expert, you can find more information and connect with professionals. Click here to open the form](#)

1. Slab Foundation

Observations:

- No determination can be made regarding the condition of the interior concrete slab as it was covered with flooring, expect to find typical cracks up to 1/4-inch when it is exposed. Any cracking larger than 1/4" wide should be addressed upon discovery.
- Slab not visible due to floor coverings - not visible for inspection, see interior floor area notes
- Personal items and/or furnishings prevent complete inspection

2. Exterior Foundation Perimeter

Observations:

- Hillside(s) present on property - we recommend a geological inspection on all hillside areas
- Most perimeter areas are not visible - **N/A**
- Normal wear on the day of the inspection where visible - no major defects visible
- Slab perimeter is covered by stucco - most areas are not visible for inspection - N/A



GROUNDS


"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required.

1. Driveways and Walkways

Constructed of: Concrete • Brick

Observations:

- Worn with common cracks/chips - typical for age of material
- Driveway stained in areas
- Walkways stained in areas
- Walkway displacement/uplifted/uneven areas - potential trip hazard - needs to be serviced

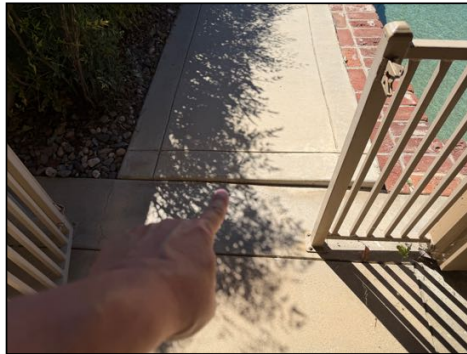

Walkway displacement/uplifted/uneven areas - potential trip hazard - needs to be serviced

2. Patio and Porch Roofs

Constructed of: Rolled material • Wood

Observations:

- Normal wear at time of inspection - no major visible defects
- Consult termite report for all exterior wood conditions



3. Patio and Porch Decks

Observations:

- Worn with common cracks/chips - typical for age of material
- Standing/ponding water in areas – signs of poor drainage
- Stained/worn areas - typical for age and use



Standing/ponding water in areas – signs of poor drainage

4. Exterior Electrical

Observations:

- Accessible lights/switches/outlets were tested on the day of the inspection
- All visible fixtures/switches/outlets were found to be in normal operating condition at the time of the inspection
- Some light(s) did not function (some may be on sensors or timers) - check bulbs first, then consult an electrician to further evaluate as needed
- Some switches have unknown function - not inspected - inquire with seller regarding operation
- Ceiling fans operated properly at the time of inspection – switch located inside heater/water heater closet at exterior of master bedroom suite
- **Electrical fixtures need to be caulked/sealed to wall attachments to help prevent moisture entry**



Some light(s) did not function (some may be on sensors or timers) - check bulbs first, then consult an electrician to further evaluate as needed



Some light(s) did not function (some may be on sensors or timers) - check bulbs first, then consult an electrician to further evaluate as needed



Some light(s) did not function (some may be on sensors or timers) - check bulbs first, then consult an electrician to further evaluate as needed



Some light(s) did not function (some may be on sensors or timers) - check bulbs first, then consult an electrician to further evaluate as needed



Electrical fixtures need to be caulked/sealed to wall attachments to help prevent moisture entry



Ceiling fans operated properly at the time of inspection – switch located inside heater/water heater closet at exterior of master bedroom suite



Some switches have unknown function - not inspected - inquire with seller regarding operation

5. GFCIs

Observations:

- GFCI upgrades are recommended on ALL exterior outlets for increased safety
- Tested and operational at time of inspection via normal control
- Master control GFCI located in: main electrical panel



Master control GFCI located in: main electrical panel

6. Exterior Plumbing and Faucets

Observations:

- Accessible exterior faucets operated with normal wear at time of inspection via normal fixture controls

7. Main Water Valve

Type of plumbing: Copper

Observations:

- Location: north side - near garage main door
- No visible leaking found at the main valve area at the time of the inspection
- Main valve appears to have normal wear at the time of inspection - no major visible defects



8. Water Pressure

Observations:

- Recommended water pressure is between 55 to 80 pounds per square inch (psi)
- Water Pressure can fluctuate depending upon time of day and municipal service adjustments
- Recommend licensed plumber to evaluate low water pressure
- Approximate pounds per square inch: 50 - low



Approximate pounds per square inch: 50 - low

9. Pressure Regulator

Observations:

- Location: at main valve area
- Regulator appears to have normal wear on the day of the inspection - no major visible defects



10. Fencing and Walls

Constructed of: Block • Stucco

- Metal • Chain link

Observations:

- Visible fencing/wall areas are worn and weathered - typical for the age of the materials
- Some wall/fence areas not visible for inspection due to vegetation/personal items
- Cracking/chipping small and typical for age at block - monitor for further cracking and repair as needed
- Loose/missing top caps/materials - recommend servicing
- **Rust/rust damage at metal fence materials - needs to be serviced**
- Metal fence, buried beneath soil in some locations stash recommend service in an effort to prolong life



Metal fence, buried beneath soil in some locations stash recommend service in an effort to prolong life



Cracking/chipping small and typical for age at block - monitor for further cracking and repair as needed



Cracking/chipping small and typical for age at block - monitor for further cracking and repair as needed



Some wall/fence areas not visible for inspection due to vegetation/personal items



Rust/rust damage at metal fence materials - needs to be serviced

11. Gates

Constructed of: Metal

Observations:

- Operated on the day of the inspection
- Weathered and worn materials - typical for age
- **Rust present - recommend rust treatment to prolong material life**



Rust present - recommend rust treatment to prolong material life

12. Planters

Observations:


- Some areas not completely visible for inspection due to soil/plants/vegetation
- Normal wear on the day of the inspection - no major visible defects
- Recommend adding drainage in planter areas to direct moisture away from the structure
- Recommend pruning or remove any plants or trees that are in contact or proximity to structure to eliminate pathways of wood destroying insects and moisture
- Tree limbs within 10 feet of roof should be trimmed away to provide air and sunlight to roof, while minimizing debris & dampness



13. Grading

Observations:

- Underground drains present - not tested for performance, nor is output location confirmed with this inspection. Note underground drains will require periodic maintenance
- Small localized water ponding may occur in areas - monitor these areas as drains may be needed
- **Drain screens are missing/damaged/plugged – recommend drain maintenance/cleaning**

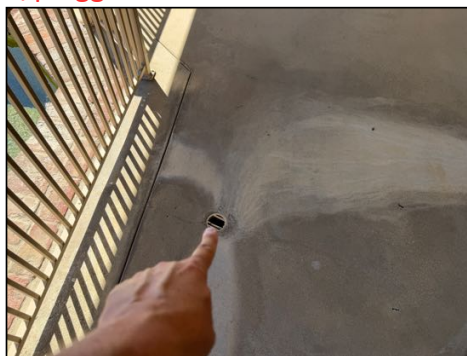

Drain screens are missing/damaged/plugged – recommend drain maintenance/cleaning

14. Out Structures

Observations:

- **Out buildings, detached structures, play equipment, exterior BBQ areas, fire pits, bird baths, fountains/water features and above ground pools are not inspected. You are advised to check permits for any out structure(s) present - the home inspector is not a building code violation inspector**
- Exterior BBQ area present



ROOF

"Needs to be serviced" and/or "recommend servicing" is a common phrase used throughout this report and means, in the Inspector's opinion; maintenance, repair or upgrade is needed. Further evaluation of all items labeled with "needs to be serviced" is highly advised; general maintenance, repair and / or replacement by an appropriate licensed contractor may be required. The inspector cannot determine if a roof (or any part of the roof system) leaks at any time or under any weather conditions, no water or hose testing is performed during this inspection. Roof underlayment cannot be inspected, condition of underlayment cannot be determined with this inspection. Water intrusion and moisture staining is not always visible during the inspection and can appear after rain fall. Remaining roof life can only be determined by a licensed roofer. If there are concerns of possible roof leaks or to determine remaining roof life, please contact a licensed roofer to perform an additional inspection. To schedule a roofing consultation with a licensed roofer please call our office at 800-494-8998. This applies to all roof areas evaluated during this inspection.

1. Condition

Information: Inspection method - from walking on patio cover • Inspection method - Drone camera inspection

Constructed of: Clay/Spanish tile

Observations:

- Worn and weathered materials present - typical for age and weather exposure - roof needs maintenance
- Cracked/chipped tiles/mortar - typical for age/materials - recommend seasonal roof maintenance
- Vegetation on roof - not fully visible for inspection - recommend servicing/cutting back vegetation away roof areas
- Broken tiles - needs to be serviced
- Loose/slipping tiles/shingles - recommend servicing



Loose/slipping tiles/shingles - recommend servicing

Vegetation on roof - not fully visible for inspection - recommend servicing/cutting back vegetation away roof areas



Broken tiles - needs to be serviced



Broken tiles - needs to be serviced





Loose/slipping tiles/shingles - recommend servicing

Loose/slipping tiles/shingles - recommend servicing



Loose/slipping tiles/shingles - recommend servicing



Vegetation on roof - not fully visible for inspection - recommend servicing/cutting back vegetation away roof areas

Cracked/chipped tiles/mortar - typical for age/materials - recommend seasonal roof maintenance



2. Flashings

Observations:

- Normal wear at time of inspection - no major visible defects - recommend seasonal mastic maintenance to prevent moisture intrusion

3. Gutters and Down Spouts

Observations:

- Partial gutter systems in areas – recommend gutters on all feasible sides of structure to help divert water away from the structure
- Normal wear at time of inspection - no major visible defects
- Gutter leaf guards may allow water to bypass - inquire with seller




Gutter leaf guards may allow water to bypass - inquire with seller

4. Vents and Vent Caps

Observations:

- Worn/weathered cap(s) – recommend seasonal maintenance to ensure that caps do not become loose or develop other defects
- **Mastic at vent(s) is weathered and cracked - needs to be serviced and resealed at all penetration points**

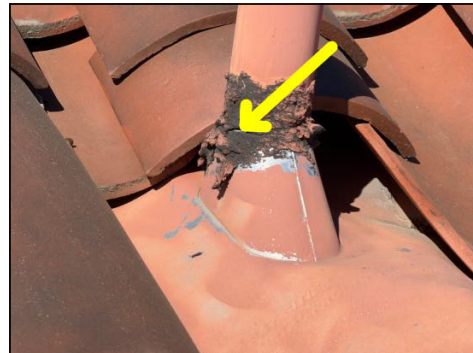

Mastic at vent(s) is weathered and cracked - needs to be serviced and resealed at all penetration points

Mastic at vent(s) is weathered and cracked - needs to be serviced and resealed at all penetration points

5. Chimneys

Observations:

- Normal wear at the time of inspection - no major visible defects





6. Spark Arrestors

Observations:

- Normal wear at time of inspection - no major visible defects

7. Sky Lights

Observations:

- Worn/weathered – recommend seasonal maintenance and sealing of all areas to ensure no water intrusion



Glossary

Term	Definition
A/C	Abbreviation for air conditioner and air conditioning
Check permits	Home Inspectors cannot determine modification or alterations dates within any structure. The Home Inspector cannot determine building code violations. You are advised to check with the local city or county building and safety office regarding any planned or paid for construction/alterations permits to ensure that any alterations made to the structure were installed and or built to the proper building code standards for the date of the alteration. You are further advised to consult with your Realtor and the Seller/disclosures to understand the details of any and all alterations to the structure and/or contractor warranties that may apply to the alterations.
Combustion Air	The air flow openings designed to bring fresh outside air to the furnace and/or hot water heater or other appliances to be used in the combustion of fuels and the process of venting combustion gases. Normally, two separate supplies of air are brought in: one high and one low.
Expansion Tank	An expansion tank or expansion vessel is a small tank used to protect closed (not open to atmospheric pressure) water heating systems and domestic hot water systems from excessive pressure. The tank is partially filled with air, whose compressibility cushions shock caused by water hammer and absorbs excess water pressure caused by thermal expansion.
GFCI	A special device that is intended for the protection of personnel by de-energizing a circuit, capable of opening the circuit when even a small amount of current is flowing through the grounding system.
Maintenance	Performing unscheduled repairs to correct deficiencies that can occur during normal use and wear of building materials and/or systems within a building or home (this is called "corrective" maintenance). "Preventive" maintenance refers to regularly schedule inspections, services, adjustments and replacements to prevent damage or abnormal wear. Recurring maintenance are generally preventive maintenance items suggested by the manufacturer to help maintain life expectancy of building materials or components within a building or home. Emergency maintenance is considered to be an unscheduled repair to correct a deficiency that may lead to personal injury or property damage if left unaddressed.
N/A	Not accessible, not inspected





DISCLAIMERS

Asbestos: The inspector is not licensed by the EPA and cannot determine, report on or test if asbestos materials exist in any area throughout the structure. Any structure built prior to 1978 may contain asbestos in one or multiple building materials used during that era of construction. If you have concerns about possible asbestos, it is solely up to you to arrange for asbestos testing by an appropriate licensed contractor. The Elite Group Property Inspections will not engage in any claims regarding asbestos.

Interior: Limited inspection on all occupied/staged structures. Personal property, furniture, moving boxes or other items are not moved and will prevent a complete inspection (this applies to all areas inside and outside of the structure being inspected). We recommend checking for permits on all additional construction or alterations including, but not limited to: window replacements, patio roofs, out structures, garage and attic conversions, roof alterations, etc. performed on the property after original construction. If multiple people are present at or arrive during this inspection and enter areas or operate appliances or fixtures after they have already been inspected or reported on by the home inspector; the home inspector is not responsible for the condition of these items or areas after they are inspected; the home inspector does not go back and re-inspect the items/areas during this limited time inspection. The Inspector cannot determine if past or present hidden pet damage exists in any part of the structure. The inspector is not a code violation inspector and will not report on building code requirements in any way. Built-in central vacuum systems are not inspected. Interior window shutters/blinds/coverings are not tested or inspected as part of this home inspection (this includes all windows at the structure). Tint/film over windows is not inspected and often is bubbled/loose/peeling/scratched - tint/film (if present) can prevent an accurate inspection of the window glass areas. Only accessible windows and doors are inspected, personal items are not moved to access or test all doors and windows. Broken double pane seals cannot be determined with this inspection, dirty windows can hide signs of condensation between panes. Vertical operating windows are known to have sash cable/spring problems, although the problem may not exist at the time of the inspection, we recommend that you check them often and repair these windows upon discovery of any sash cable or spring problems. Only the visible and accessible switches/outlets are testing during this inspection, personal items are not moved to access any outlets/switches behind them. Fireplace is visually inspected only, the fireplace is not lit to test flame color or condition. The internal cavity of the fireplace is not inspected. It is recommended that you have an internal inspection of the chimney and/or a Gas Company evaluation of the fireplace beyond the scope of this inspection. Ceiling fan mounts cannot be checked by the inspector. Smoke and carbon monoxide detectors that are out of reach are not tested for functionality, all battery operated smoke detectors should be within reach for testing and maintenance. We recommend any mold or moisture damaged areas noted in the report be further evaluated for cause and correction by the appropriate licensed contractor.

Bathrooms: Bathtub and sink overflow drains and spa tub jet hoses are not inspected and leaks in these areas cannot be detected with this inspection. Shower pans are not leak tested and cannot be determined if properly water-proofed by the inspector, consult the termite report for any shower pan tests. Exterior or interior access panels are only inspected if readily accessible and operable (not sealed or painted or screwed shut), second story access panels are not opened. The home inspector cannot determine if shower pans or tubs are properly pitched for drainage. We recommend upgrading all electrical outlets to GFCI protection within 6 feet of all potential wet locations, however this may not be a requirement for the sale of a home based on the age of the home (this also applies to kitchen sinks, wet bar sinks and laundry sinks).

Kitchen: Appliances receive a limited inspection for basic functionality only, additional features are not tested. Appliances are NOT disassembled to evaluate the internal working parts of each appliance. The inspection cannot determine how well the dishwasher cleans the dishes. Disposal blades are not inspected. It cannot be determine how well the oven, range/cook-top or microwave cook food. Age, remaining life, BTU's, CFM's and other forms of efficiency or effectiveness are not determined with this inspection. Water purifying systems, instant hot systems and water softeners are not inspected. Non built-in appliances and built-in refrigerators are excluded from this report.

Laundry: Supply valves, laundry drain, gas valve and dryer vent cannot be tested whether a washing machine is present or not. Washer and dryer units are not inspected or turned on for testing during this inspection and are excluded from this report. Washer and dryers are not moved to inspect the walls/floors/other components behind them. Water supply valves that are left in the on position for a long period of time tend to leak when turned off or do not shut off completely. Drains are not pressure tested.

Attic: The inspector cannot determine, report on or test if asbestos materials exist in any area throughout the structure. When attic insulation is covering ceiling joists, we cannot completely inspect some areas due to inspector safety concerns. Most attics are not completely accessible due to limited space. Attic insulation and limited space will prevent the inspector from performing a complete inspection of the attic area, not all areas are accessible and will be determined at the inspector's discretion. The Inspector does not determine the R-value of insulation present or the efficiency or effectiveness of HVAC duct layout or design. Attic insulation is not touched, moved or otherwise disturbed during the inspection. Temperature sensors and fans for attic exhaust systems are not tested. Rodents: If there is visible evidence of rodents or other pests, it will be noted as such. Most rodent/pest infestation exists under attic insulation, in walls or in areas not visible to the inspector and cannot be identified with this inspection. It's recommended a pest inspection be performed beyond the scope of a home inspection whether or not evidence exists.

Garage: The garage is often the location where most storage occurs and receives a limited inspection when items are present. Personal items or other materials/possessions are not moved in any way to provide access to areas for inspection - areas of rafters, ceilings, firewall(s) or other walls should not be considered fully inspected if personal items or storage is present - defects may be present behind these items and not visible to the inspector at the time of inspection. Doors, windows, cabinets, DISCLAIMERS CONTINUED

counters, closets, slab areas, electrical areas, ventilation, plumbing areas or soffit(s) not fully accessible are not inspected, tested or evaluated. Firewall: fire rating labels are often not visible on finished drywall and cannot be determined with this inspection. Garage doors, hardware, openers and associated safety devices can only be inspected if these areas are clear of stored items and can be safely operated without disturbing other items in the garage. Garage doors, hardware and openers require periodic maintenance and servicing. Remote controls for openers are not tested. Door opener activator button should be minimum 54-inches above floor for safety.

Pressure sensors/systems are generally not tested due to the risk of damage if they are not properly operating - we recommend having a general service completed prior to regular use. We recommend checking permits for any converted garage areas or additional walls/ceilings or other alterations made to the garage.

Heating & Air Conditioning: This report does not indicate if the heater is on recall, a follow up with RecallChek.com is recommended. Electronic or Ultra violet air filters are not inspected. Inspector cannot determine if there is a crack in the firebox or if carbon monoxide is leaking in any part of the system. Not all registers can be tested for pressure flow, due to location, condition and operation of the heating & air conditioning system. Adjustable registers that are closed are not opened by the Inspector. Missing manufacturer labels prevent RecallChek (this is true for all appliances/systems at the structure). Age, remaining life, size or efficiency cannot be determined by the Inspector. The air conditioning system freon or other refrigerant levels are not checked or determined if leaking by the Inspector. Heaters, coil boxes, condensers and air compressors are NOT disassembled to evaluate the internal working parts. This inspection does not determine if the evaporator coil BTU size is the same as condensing unit size or any other mechanical efficiency. Radiant heat is not inspected.

Water Heater: The water heater is visually inspected only, the combustion/pilot doors are not removed for flame or burner condition inspection due to the potential for draft to burn out the pilot flame. Circulation pumps, TPR Valves and pressure tanks cannot be tested with inspection. Solar water heaters are not inspected. Tankless units that are not original to the structure should be further evaluated by a qualified tankless technician as there are many aspects that are beyond of the scope of a general home inspection. Age, remaining life, size or efficiency cannot be determined by the Inspector. Gas lines are not measured or sized for water heater needs. The Inspector cannot light the pilot flame on the water heater or any other appliance where a pilot flame is not already on.

Roof: The inspector cannot determine if a roof (or any part of the roof system) leaks at any time or under any weather conditions, no water or hose testing is performed during this inspection. If there are concerns or signs of possible roof leaks, please contact a licensed roofer to perform an additional inspection. Remaining roof life can only be determined by a licensed roofer. This applies to all roof areas evaluated during this inspection. Tile roofs, metal roofs or roof areas not accessible with a 12-foot ladder will receive a limited inspection from the ground or eaves only. Tile, metal or other materials that can be damaged will not be walked on by the Inspector. Chimney cavities are excluded from this inspection, recommend an internal chimney inspection be performed beyond the scope of the home inspection. Solar panels and tube globes are excluded from this report. Solar panels will prevent inspection of roof areas beneath them.

Electrical/Gas: Electrical panels are visually inspected only, the inspector does not perform a load calculation to determine service capacity adequacy. Some wire types cannot be determined due to wire casings cover wires entering the breakers. Panels with excess wiring are not completely visible due to amount of wires inside panel. Breakers are visually inspected only - the inspector does not perform any electrical stress tests on the system to determine if a breaker trips properly - including AFCI and GFCI breakers (consult an electrician for further evaluation, if this is a concern). Electrical and gas fires due to poor installation of wiring and faulty gas pipes cannot be determined by the inspector. Only accessible GFCLs with test and reset buttons are tested, the inspector does not determine which GFCI outlets may be linked to other areas of the structure. Ungrounded outlets may be present in older structures (pre-1965) even if the main or sub panels have been upgraded. The inspector cannot determine if all wiring has been updated. Expect to find ungrounded outlets in older homes (pre-1965) - this is not a defect. We recommend the gas supplier be contacted to safety check all fuel gas systems/appliances prior to purchase and occupancy. The Inspector cannot determine if a gas leak is present in any area of the home or underground at any time during the inspection. Carbon monoxide poisoning cannot be detected with this inspection, including all gas and propane systems interior and exterior of the structure. Gas supply valves are not turned or operated during this inspection. The internal condition of gas appliance ventilation exhaust pipes cannot be detected. Pilot lights and fire places are not lit by the inspector at any time, for any reason. It is the responsibility of the client to ensure that the main gas and electrical systems are on prior to the inspection. The requirement of gas line sediment traps is not determined by the inspector.

Exterior Areas: For all wood areas or damaged wooden areas and moisture problems (mold/mildew), consult the termite inspection report. See interior section of the report for additional window and door information. In no way, shape or form can the inspector determine if the exterior of the home is water tight or is built to prevent moisture intrusion, no hose or water testing is performed at this inspection. Stucco and siding require periodic seasonal maintenance, consult an exterior finish contractor for maintenance tips/schedules/suggestions. Fire pits, exterior fireplaces and exterior BBQ's are excluded from this inspection. We recommend adding anti-siphon/backflow preventers (if not already present) on all exterior hose bibs for optimum potable water protection. Property boundary lines and encroachment determinations are beyond the scope of a home inspection and are not inspected or included in this report - Consult with another qualified professional as needed for evaluation if concerns exist in this area. Zero lot lines prevent a complete inspection of areas on other properties. Common areas controlled by Home Owner's Associations are not included in this inspection. Areas not visible or accessible due to height/angle/vegetation/other forms of limited access are not included in this inspection. Inspector does not use specialized instruments to detect moisture, if any, under stucco or siding surfaces.

Grounds: This inspection cannot determine if patio and porch roofs, balconies or patio enclosures are water tight, no water/hose

testing is performed. The Inspector does not perform any stress or destructive testing of the electrical system; Yard area electrical that is not readily visible and accessible may not be seen or inspected; Low voltage lighting/electrical systems, motion detectors, intercom, video/audio/security systems and electric outdoor heating systems are not inspected. Generally, it is typical for older homes not to have exterior outlets or switches, this is not a defect. Sprinklers on timers are not inspected, consult DISCLAIMERS CONTINUED

seller/HOA. Above ground pools, ponds, fountains, waterfalls, birdbaths, and associated equipment or pumps used for these items, are excluded from this report. Steep hillsides and inaccessible areas on the grounds are excluded from this report. It is highly recommend that all structures built on hillsides and slopes have a geological inspection performed to determine if the hillside/grading is stable.

This inspection cannot determine ground movement or drainage issues, the addition of drains may be needed in areas. Fences, walls or gates are not evaluated for security or design. The Inspector cannot determine if planter areas are leaking into the structure, consult seller disclosures or obtain further evaluation of these areas for any moisture intrusion issues.

Foundation: Sump pumps, septic tanks and sewer drain pipes from structure to street are excluded from this inspection. The Inspector does not perform calculations to determine exact square-feet of ventilation required at time of construction (this is also true for attic spaces). Some areas of a raised foundation may not be accessible due to limited space, plumbing piping, duct work obstructions, insulation, soil levels and stem walls. The inspector will not traverse any area deemed unsafe or where damage may be caused as a result, this is up to the sole discretion of the Inspector (this is also true for attic spaces). It is not always possible for the inspector to view every side/angle/connection of all plumbing pipes due to plumbing design/layout/approach angle/etc. Underground plumbing/pipes cannot be visually inspected. Pressure testing is not performed during this limited inspection. Drain scope inspections are recommended whether a defect is detected or not. Slab foundations are often covered and not visible; therefore the inspection is limited. Slab foundation leaks cannot be determined by the home inspector.

Pool: Solar panels/heating systems are excluded from report. Valves that are not labeled for the pool and/or spa jets are excluded from this report and may prevent proper testing and inspection. Underground plumbing cannot be inspected. Automatic pool fill float valves and electronic chlorine dispensers are excluded from this report. Ultraviolet light and/or salt chlorine generator type water treatment systems not included in this inspection. Water chemistry is not tested. Control panels/fixtures on the side of the pool or spa and any remote controls are not included in this inspection. Portable spas have a limited inspection - no internal parts are inspected. The inspector cannot determine if a pool or spa leaks. The inspector cannot determine the remaining life of any of the pool equipment. Safety pressure relief valves (if present) are not operated and are excluded from inspection; an internal evaluation of the heater parts is beyond the scope of this inspection. It is the buyer's full responsibility to ensure the pool area is in full compliance with the safety laws and codes. If there is no self containing fence around the pool, all doors from the structure leading to the pool and spa must be equipped with safety alarms and secondary latches above the reach of children. All gates leading to the pool must self close and be equipped with a latch five feet or higher from the ground. The fencing in all cases must be five feet tall.

Plumbing: Plumbing supply valves are visually inspected only and are not tested for functionality due to the potential for leakage - valves that are not used often will seize or freeze and are likely to leak when operated (opened/closed). Corrosion or rust is often a sign of slow leaking and should be further evaluated by a plumber if detected in the inspection or photos. If galvanized or cast iron plumbing is present in any part of the structure it is recommended that plumber further evaluate the plumbing system due to the age of the materials. Underground piping is not visible to the inspector, therefore cannot be evaluated by the inspector. Slab foundation leaks cannot be determined by the home inspector. The "plumbing type" section of the report includes a percentage approximation of the plumbing type, it is not a guarantee of the plumbing type in all areas. The inspector cannot see plumbing type or pinhole leaks inside walls, floors, slabs or other areas that may be covered. Leaks can occur after the inspection and are not the responsibility of the Inspector. Existing leaks, hidden leaks, or other leaks that occur from normal testing/inspection and subsequent damage from plumbing leaks are not the responsibility of the Inspector. This inspection also does not determine or identify geographic areas that are prone to defective materials or pinhole leaking issues. Consult seller's disclosures and qualified professionals/contractors if concerns exist in this area. Septic tanks, wells, pumps and associated equipment, water supply quantity and quality are not included in this inspection.

***Contractor References:** This report may contain a contractor reference and contractor contact information. Choosing a contractor is done solely at the risk of the client. The Elite Group cannot control the events that take place between contractors and customers and therefore cannot be held liable for any problems that may occur. References to contractors, their products and services, are provided "as is" without warranty of any kind, either expressed or implied. In no event shall The Elite Group be held liable for any incidental, indirect or consequential damages of any kind resulting from the information provided by each company and any business conducted as a result of such information. It is highly recommended that you check with your local licensing or business board for up to date and accurate information. When you contact a contractor you should:

1. Ask for and contact at least two customer references.
2. Find out how long they have worked in your area (familiarity with local building codes is important).
3. Ask if they are bonded (insured for damages and injuries on the job) Get a signed estimate for all parts and labor/installation.
4. You may wish to contact more than one contractor to ensure you are getting the best service and materials for your money.

This disclaimer applies to all references found on any and all of our report pages

SEE CONTRACT FOR ADDITIONAL INFORMATION AND DESCRIPTION OF ITEMS