

# INVOICE



**RUSH TERMITE AND PEST CONTROL INC.**  
**P.O. Box 801025**  
**Santa Clarita, CA 91380-1025**  
**Ph: (661) 296-3393**  
**Email: rushtermite@yahoo.com**

DATE	REPORT #	ESCROW #	PROPERTY LOCATION
04/02/2026	17781		22932 Beech Creek Circle, Santa Clarita CA 91390

TO: **Grace Morsch**  
**22932 Beech Creek Circle**  
**Santa Clarita, CA 91390**

03/30/2026	Inspection	\$150.00
------------	------------	----------

---

	Balance Due:	\$150.00
--	--------------	----------

RETURN THIS COPY WITH REMITTANCE

DUE AND PAYABLE WITHIN 10 DAYS

1.5% per month charged on all past due accounts. This is an annual percentage rate of 18%  
(Interest charged pursuant to the Robinson-Patman Act)

NOTICE: "Under the Mechanics' Lien law, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property but is not paid for his work or supplies, has the right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your own contractor in full, if the subcontractor, laborer, or supplier remains unpaid."

**THANK YOU FOR YOUR BUSINESS**

# WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. 22932	STREET, CITY, STATE, ZIP Beech Creek Circle, Santa Clarita CA 91390	Date of Inspection 3/30/2026	No. of Pages 8
-----------------------	--	---------------------------------	-------------------



**RUSH TERMITE AND PEST CONTROL INC.**  
**P.O. Box 801025**  
**Santa Clarita, CA 91380-1025**  
**Ph: (661) 296-3393**  
**Email: rushtermite@yahoo.com**


Firm Registration No. PR 9632	Report No. 17781	Escrow No.
Ordered By: Grace Morsch 22932 Beech Creek Circle Santa Clarita, CA 91390	Property Owner/Party of Interest Barry Burnett Realty 25603 Avenue Stanford Valencia, CA 91355 Attn: Keith Anderson	Report Sent To:

COMPLETE REPORT       LIMITED REPORT       SUPPLEMENTAL REPORT       REINSPECTION REPORT

General Description: One Story Stucco Residence, Vacant and Unoccupied, Attached Garage, Composition Roofing, Concrete Slab Foundation, With Floor Coverings.	Inspection Tag Posted: Attic.
	Other Tags Posted: None Noted.

An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites       Drywood Termites       Fungus/Dryrot       Other Findings       Further Inspection   
 If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

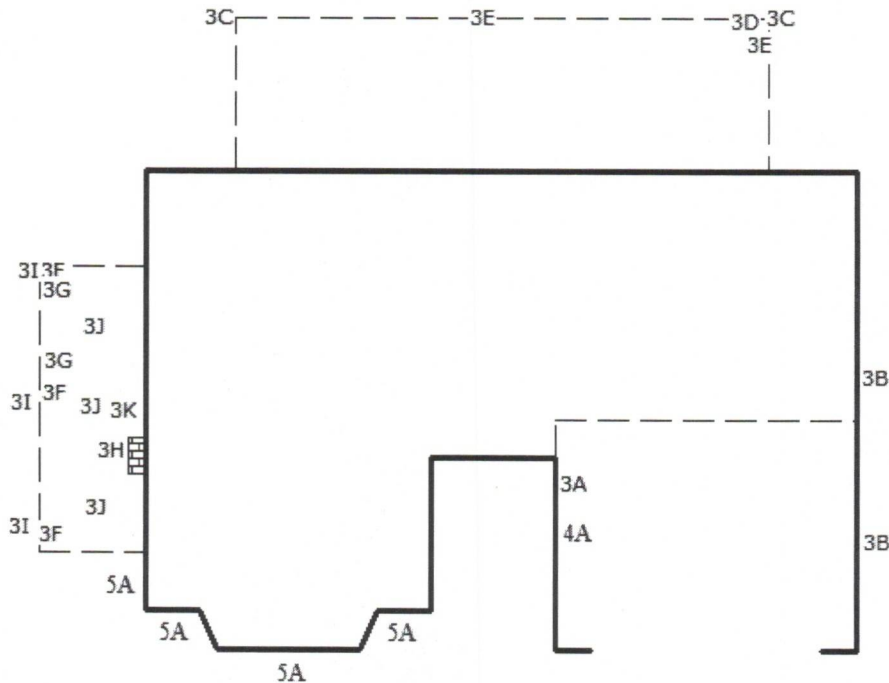

Front of House/Not to Scale

Inspected by Mary L Mockenhaupt State License No. OPR10073 Signature Mary L Mockenhaupt

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**WHAT IS A WOOD DESTROYING PEST AND ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST AND ORGANISM INSPECTION REPORT**

A wood destroying pest and organism inspection report contains findings as to the presence or absence of wood destroying pests and organisms in visible and accessible areas and contains recommendation for correcting any infestation or infestation found. The contents of Wood Destroying Pest & Organisms Inspection Report are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism inspection Report does not contain information on such defects, if any, as they are not within the scope of the license of either this company, or its employee's.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, space between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

**THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTOR'S STATE LICENSE BOARD.**

This company does not certify or guarantee against any leakage, such as (but not limited to plumbing, appliances, walls, windows, any type of seepage, roof or deck coverings). This company renders no guarantee, whatsoever, against any infestation, or any other adverse condition which may exist in such areas or may become visibly evident in such areas after this date. Upon request, further inspection in these areas would be performed at an additional charge.

The bathroom(S) and kitchen plumbing under the sinks were water tested and unless otherwise stated in this report, no leakage was found at the time of this inspection. We make no representations of future leakage that may occur after the date of this inspection. However, should any plumbing leak occur after the date of this inspection, interested parties are advised to contact a licensed plumbing contractor to inspect and or repair as necessary.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THE CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/ HERSELF.

if requested by the person ordering this report, a re-inspection of the structure will be performed. Such request must be within (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e termite infestations, termite damage, fungus damage, etc...) However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

Wallpaper, stain or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional charge.

NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such service that are in addition to the direct costs associated with paying the sub-contractor. You may accept Rush Termite's bid or you may contract directly with another registered company. If you choose to contract directly with another registered company Rush Termite will not in any way be responsible for any act or omission in the performance of work you directly with another company to perform.

This is a separated report has been requested which is defined as Section I/Section II conditions evident on the date of inspection.

**Section 1-** Contains items where there is evidence of active infestation, infection or conditions that have resulted in or from infestation or infection.

**Section 2-** Items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found.

**Further inspection-** Items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete his inspection and cannot be defined as section I or II.

This property was not inspected for the presence of health-related molds or fungi as well as asbestos/lead paint. By California law we are neither qualified, authorized, nor licensed to inspect for health-related molds and/or fungi, as well as asbestos/ lead paint. If you desire information about the presence or absence of health-related molds, you should contact a certified industrial

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

hygienist. Interested parties that have concerns regarding mold, mildew, asbestos or lead paints should contact a company who specializes in these types of inspections. Further should we discover the presence of mold/ asbestos/lead paint during our inspection of the premises or should out inspection or repairs of the premise cause a release of mold spores or particles, or asbestos/lead paint particles, the owner/agent/tenant shall be solely responsible for the clean up, removal and disposal of any mold or asbestos/lead paint and the cost thereof. Owner/agent/tenant hereby agrees to waive any and all claims against this Company which are in any way related to the presence of mold on the premises and further agrees to indemnify and hold this company harmless from any and all claims of any nature asserted by any third party, including this company's employees, which is in any way related to the presence of mold, or asbestos/lead paint on the premises.

NOTE: YOU MUST READ AND UNDERSTAND THE SCOPE OF THIS INSPECTION AND REPORT. IF YOU DO NOT AGREE WITH AND UNDERSTAND THE SCOPE OF THIS INSPECTION, DO NOT USE THIS REPORT FOR ANY PURPOSE. CONTACT OUR OFFICE FOR FURTHER INFORMATION.

NOTE: SHOULD THE FURTHER INSPECTION ITEMS NOTED IN THIS REPORT NOT BE PERFORMED, RUSH TERMITE WILL ASSUME NO LIABILITY FOR ANY INFESTATIONS OR INFECTION WHICH MAY BE CONCEALED IN THESE AREAS.

In the event it is required to drill through concrete to facilitate chemical treatment, we assume no responsibility for damage to electrical, computer cable and phone lines or piping such as plumbing, gas, etc.. during our repair work or chemical treatment. If damage does occur, it is the responsibility of the owner to contact the appropriate licensed contractor to repair at owner's expense. Should the owner, agents or any party know of other termite reports, home improvements, or any adverse conditions to structures pest control that were not covered in our report, it is the person's responsibility to disclose those items to all parties involved including Rush Termite & Pest Control. Any differences in conflicting report should be addressed prior to the close of escrow. All pesticides and fungicides must be applied by a state certified applicator. (see 8555 Business and Profession Code Division 3) and in accordance with the manufacturer's label requirements. Health related molds, mildew and/or fungi within structures have become an issue in California. This firm cannot or will not make any opinion regarding these issues. By California law, we are neither qualified, authorized or licensed for Health related molds, mildew and/or fungi. This is out of the scope of a wood destroying pest and organism report. If you desire information about the presence or absence of Health related molds, mildew and/or fungi, you should contact an industrial hygienist. In a letter sent by the State of California, Molds, sometimes called mildew are not wood-destroying organisms. Branch 3 licensees do not have a duty under Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. RUSH TERMITE AND PEST CONTROL DOES NOT INCLUDE PAINT, PRIMER AND/OR STAINS, UNLESS PRIOR ARRANGEMENTS ARE MADE. AN ADDITIONAL FEE WILL BE CHARGE. IF CONTRACTED TO PAINT, RUSH TERMITE AND PEST CONTROL DOES NOT GUARANTEE COLOR MATCH.

PERTAINS ONLY TO HOMES WITH UPSTAIRS STALL SHOWERS Upstairs stall shower not water tested due to finish ceiling below. No water stains were noted to finished ceiling below stall shower at the time of inspection. If the water test of the upstairs stall shower is desired it will be done at owners responsibility and expense.

NOTE: Inspectors do not carry 40' ladders therefore inspection of the second story will be performed from ground level. No probing will occur. A request for an inspector to come equipped with ladder must be done in advance and an additional charge will be incurred. The exterior base of the home must be clear of obstacles for inspection to be performed.

NOTE: During inspections of home that are furnished, personal effects may limit visual inspection. No personal effects, ie; storage in cupboards, closets, garages ect will be moved to perform inspection. Adverse conditions may exist in inaccessible areas.

NOTE: Regarding any wood replacement called out as corrective measures, Rush Termite **WILL NOT** clear off any repair that have been filled by owner. Infected wood must be removed.

NOTE: Attic and sub areas with insulation and ducting have limited access and visibility, adverse conditions may exist in these areas.

NOTE: Fencing, gates and any detached structures are not included in this inspection report unless specifically requested.

NOTE: Gutters are attached in areas of repairs, home owner will need to make sure they are removed prior to Rush Termites arriving. If Rush Termite must remove gutters there is no guarantee they will not be damaged during this process. **GUTTERS WILL NOT BE RE-INSTALLED.** Rush Termite recommends owner contacting professional to do this.

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**GUTTERS LIMIT VISUAL INSPECTION. ADVERSE CONDITIONS MAY EXIST IN INACCESSIBLE AREAS.**

NOTE: Any fill noted around home limits visibility in these areas. Rush Termite is unable to determine the presence or absence of adverse conditions in these areas. Rush Termite recommends contracting owner regarding these repairs.

NOTE: In other perform corrective repairs Rush Termite needs a clean work station. If during the course of repairs, Rush Termite must remove storage, debris or pet fence from areas of repairs and work stations, an additional fee of \$300 minimum will be charge in order to continue repairs.

NOTE: Peeling paint noted to areas around home. Rush Termite recommends painting and/or upkeep of these areas to help prevent future adverse conditions.

STATEMENT: The purpose of this inspection report is to report conditions that exist at the date and time of this inspection in the visible and accessible areas. No guarantees or warranties are being implied nor given for any condition which may become evident or may not occur after this date.

**THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION 1/SECTION 2** CONDITIONS EVIDENT ON THE DATE OF INSPECTION.

**SECTION 1** CONTAINS ITEMS WHERE THERE IS VISIBLE EVIDENCE OF ACTIVE WOOD DESTROYING PESTS OR ORGANITIONS THAT HAVE RESULTED IN OR FROM WOOD DESTROYING PEST OR ORGANISMS. **SECTION 2** ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO WOOD DESTORYING PESTS OR ORGANISMS, BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINDED AS

RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE COMPLETE INSPECTION, DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION 1 OR SECTION 2.

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**3. Fungus/Dryrot:**

ITEM 3A FINDING Minor fungus damage noted to plywood sheathing, damage may extend into inaccessible areas.

RECOMMENDATION Scrape and treat infected wood members using a registered chemical, TIMBOR, for the control of fungus. Fill minor damage with a wood filler. (Chemical treatments must be performed by this registered company. If others are making repairs then wood will need to be replaced to get clearance).

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 3B FINDING Fungus damage noted to eaves board, damage may extend into inaccessible areas.

RECOMMENDATION Open up roofing in areas of repair. Remove and replace damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s). Relay with like roofing.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

In order for Rush Termite to perform any corrective repairs in areas in which roofing and/or flashing may need to be removed, Rush Termite will take all responsible precautions against damaging existing roofing and/or flashing, but makes no guarantees that existing roofing and/or flashing can be reused. Rush Termite can replace the roofing and/or flashing using like materials at an additional charge. No gaurantees given towards an exact match.

ITEM 3C FINDING Fungus damage noted to header end, Damage may extend into inaccessible areas.

RECOMMENDATION Cut back both ends to eliminate damaged wood members as necessary and to make patio look symmetrical. Treat exposed wood, if fungus goes further, with registered chemical Timbor, for the control of fungus. Fill if necessary and paint. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 3D FINDING Fungus damage noted to patio eaves board, damage may extend into inaccessible areas.

RECOMMENDATION Open up roofing in areas of repair. Remove and replace damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s). Relay with like roofing.

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

ITEM 3E FINDING Minor fungus damage noted to post, damage may extend into inaccessible areas.

RECOMMENDATION Scrape and treat infected wood members using a registered chemical, TIMBOR, for the control of fungus. Fill minor damage with a wood filler. (Chemical treatments must be performed by this registered company. If others are making repairs then wood will need to be replaced to get clearance).

\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**3. Fungus/Dryrot:**

- ITEM 3F FINDING Fungus damage noted to patio post and casings, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).
- \* Rush Termite will use existing brackets if they are viable. If they are not , replacement of post brackets will be an additional \$150.00 per bracket replacement.  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*
- ITEM 3G FINDING Fungus damage noted to corbal, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*
- ITEM 3H FINDING Fungus damage noted to ledger, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*
- ITEM 3I FINDING Fungus damage noted to header, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*
- ITEM 3J FINDING Fungus damage noted to shade bars, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*
- ITEM 3K FINDING Fungus damage noted to rafter, Damage may extend into inaccessible areas.
- RECOMMENDATION Remove, replace and/or repair damaged wood members as necessary. If damage extends into inaccessible areas a supplemental report will be issued outlining any further finding(s), recommendation(s) and price(s).  
\*\*\*\*\* This is a Section 1 Item \*\*\*\*\*

22932

Beech Creek Circle, Santa Clarita CA 91390

3/30/2026

17781

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

**4. Other Findings:**

ITEM 4A FINDING Water damage noted to garage pedestrian door, damage may extend into inaccessible areas.

RECOMMENDATION Remove and replace door using existing hardware. If existing hardware is unuseable new hardware can be supplied upon request at an additional charge. No weather stripping will be installed.

\*Owner must inform Rush Termite of any alarm sensors that may be attached to door. We will not be liable for saving sensor if we are not informed. If informed Rush Termite will remove sensors (if possible) and give to owner. It is up to the owner to contact the alarm company to re-install and adjust sensors.

\*\*\*\*\* This is a Section 2 Item \*\*\*\*\*

**5. Further Inspection:**

ITEM 5A FINDING: Front of home was inaccessible for inspection due to dense hedges. Adverse conditions may exist in inaccessible areas.

RECOMMENDATION: A further inspection once area(s) is made accessible. A Supplemental report will be issued with any further finding(s), recommendation(s) and price(s).

\*\*\*\*\* Unknown Further Inspection Recommended \*\*\*\*\*

22932 Beech Creek Circle, Santa Clarita CA 91390 3/30/2026 17781  
BUILDING NO. STREET, CITY, STATE, ZIP INSPECTION DATE REPORT NO.

OCCUPANTS CHEMICAL NOTICE

RUSH TERMITE PEST CONTROL will use pesticide chemical(s) specified below for the control of wood destroying pests or organisms in locations identified in the Structural Pest Control report as indicated above.

(1) The pest(s) to be controlled:

SUBTERRANEAN TERMITES  FUNGUS or DRY ROT  
 DRY-WOOD TERMITES  OTHER

(2) The pesticide(s) proposed to be used and the active ingredient(s).

- A. TALSTAR: Active ingredients : Bifenthrin 7.9%
- B. TIMBOR : Active ingredients: Disodium Octoborte Terahydrate 10%
- C. TERMIDOR SC: Active ingredients: Fibronil 91%
- D. VIKANE/ZYTHOR: Active ingredients: Sulfur Flouride 100%
- E. PREMISE: Active ingredients: imidacloprid 0.05%; Isobutane 7.50%

(3) "State Law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the U.S. Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." "If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu., contact your physician or poison control center and your pest operator immediatel.(This statement shall bemedifies to include any other syptoms of over exposure which are not typical or influenz.)"

Rush Termite Company.....(661)296-3393  
Los Angeles Country Health Department.....(661)254-9560  
Los Angeles Country Agriculture Commissioner.....(626)575-5466  
Poison Control Center .....(800) 876-4766  
Structural Pest Control Board.....(800) 737-8188  
2005 Evergreen Street, Suite #1500 Sacramento, CA 95815

Persons with respiratory or allergic conditions,or others who may be concerned about their health relative to this chemical treatment, should contact their physician concerning occupancy during and after chemical treatment prior to signing this NOTICE.

NO CHEMICAL APPLICATION WILL BE PERFORMED UNTIL SUCH TIME THAT THIS NOTICE IS RETURNED HAVING READ THE INSTRUCTIONS, I, THE UNDERSIGNED, WILL ACCEPT RESPONSIBILITY FOR ALL THE AFFOREMENTIONED.

OWNER/OCCUPANT \_\_\_\_\_ DATE \_\_\_\_\_





**RUSH TERMITE AND PEST CONTROL INC.**  
**P.O. Box 801025**  
**Santa Clarita, CA 91380-1025**  
**Ph: (661) 296-3393**  
**Email: rushtermite@yahoo.com**

## WORK AUTHORIZATION CONTRACT

Address of Property: 22932 Beech Creek Circle, Santa Clarita CA 91390  
 Inspection Date: 3/30/2026  
 Report #: 17781  
 Title Co. & Escrow #:

### CUSTOMER INFORMATION

The total amount of this contract is due and payable upon completion of the work listed above unless otherwise specified. Only the work specified in the contract is being done at this time due to owners wishes. ANY WORK PERFORMED AGAINST AN EXISTING TITLE ESCROW WILL BE THE FINANCIAL RESPONSIBILITY OF THE PARTY ORDERING THE INSPECTION REPORT, IN THE EVENT OF A CANCELLED TITLE ESCROW.

Work completed (LABOR) by operator shall be guaranteed for a period of one year from completion. Toilet plumbing(parts supplied by this firm), showers, floors or any measures for the control of moisture are guaranteed for (30) days only. Chemical treats are guaranteed for one year. Only the areas treated are guaranteed.

Customer agrees to hold company harmless for any damage which may occur to plant life, wiring, trees, vines, pets, tile roofs, plumbing leaks, or changes beyond control of the company which may occur during the performance of this work. In case of non-payment by owner, reasonable attorney's fees and costs of collection shall be paid by the owner, whether suit be filled or not. A SERVICE CHARGE OF 1-1/2 PERCENT, PER MONTH WILL BE CHARGED ON ALL BALANCES OVER (30) DAYS. THE 1-1/2 PERCENT, PER MONTH, EQUALS 18 PERCENT PER ANNUM ON THE UNPAID BALANCES.

Any additional damage found while work is being performed will be supplemented by a report as to additional findings and costs.

All repairs performed by others must be re-inspected by OUR COMPANY before a CERTIFICATION will be issued. We do not guarantee work completed by others. Any repairs completed by others must be guaranteed in writing and submitted to OUR COMPANY before a CERTIFICATION will be issued. This firm does not make statements concerning workmanship. Workmanship is only determinable by those paying for or receiving those services.

If at the time of repairs to decks, the damage is found to be more extensive, a Supplemental report will be given along with a bid for any other corrections that maybe necessary.

A re-inspection of specific items on the report or of any other conditions pertaining to this structure can be done at an ADDITIONAL COST PER TRIP. The re-inspection must be done within (4) months of the original inspection.

Our inspectors are not equipped with 40 ft. ladders therefore all two story building will not be inspected at the eaves unless requested.

NOTE: Inspection fee is billed separately above any work costs.

**MOLD DISCLAIMER:** There may be health related issues associated with the structural repairs reflected in the inspection report referenced by this Work Authorization Contract. These health issues include but are not limited to the possible release of mold spores during the course of repairs. We are not qualified to and do not render any opinion concerning such health issues or any special precautions. Any questions concerning health issues or any special precautions to be taken prior to or during the course of such repairs should be directed to a Certified Industrial Hygienist before any such repairs are undertaken.

BY EXECUTING THIS WORK AUTHORIZATION CONTRACT, CUSTOMER ACKNOWLEDGES THAT HE OR SHE HAS BEEN ADVISED OF THE FOREGOING AND HAS HAD THE OPPORTUNITY TO CONSULT WITH A QUALIFIED PROFESSIONAL.

INITIALS \_\_\_\_\_

DATE \_\_\_\_\_