

Building No. 2521	Street Edgerton Place	City Port Hueneme	ZIP 93041	Date of Inspection 06/08/2026	Number of Pages 7
		Inside Out Pest Control, Inc. PO Box 968 Ventura CA 93002 (805) 658-2994 InsideOutJoseph@Gmail.com		Report # : 15504 Registration # : PR9970 Escrow # : ☐ CORRECTED REPORT	
Ordered by: Brian and Kepola Keller Williams		Property Owner and Party of Interest:		Report sent to:	
COMPLETE REPORT ☒		LIMITED REPORT ☐		SUPPLEMENTAL REPORT ☐	
REINSPECTION REPORT ☐		GENERAL DESCRIPTION: Two story unit, one in a multi unit complex			
Inspection Tag Posted: closet				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites ☐ Drywood Termites ☒ Fungus / Dryrot ☒ Other Findings ☒ Further Inspection ☐					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

INSIDE OUT PEST CONTROL, INC.

Page 2 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection		Corresponding Report No.		Escrow No.

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

INSIDE OUT PEST CONTROL, INC.

Page 3 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection	Corresponding Report No.	Escrow No.		

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

2. DRYWOOD TERMITES:

2A - Section I

FINDING - Evidence of Drywood Termites Noted at Attic, Interior, Exterior, and Garage.

Extermination of drywood termites by Thermigation heat process at Whole Unit.

One year warranty.

Any Sprinkler Heads Must Be Capped/Removed and System Must Be Drained Prior to Thermigation. Any Damage Done By Sprinklers Is Not Warranted By Inside Out Pest Control, Inc. and/or its Subcontractors.

2A - Secondary Recommendation

SECONDARY RECOMMENDATION - Locally treat for the control of drywood termites using either Altriset®(chlorantraniliprole), Termidor®(Fipronil), Premise Foam(Imidacloprid) and/or Tim-Bor®(Disodium Octaborate Tetrahydrate). Remove or cover the drywood termite fecal pellets in accessible areas at an additional cost. As Requested By Customer. 1 Year Warranty at Areas Treated Only.

Localized treatment is not intended to be an entire structure treatment method. If infestations of wood destroying pests extend or exist beyond these areas of local treatment, they may not be exterminated.

2B - Section I

FINDING - Evidence of Drywood Termites Noted at Attic Framing.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

Brace Only.

2C - Notes

Evidence of termite damage noted at Attic Framing.

RECOMMENDATION - Drywood termite damage appears to be minor, and wood members does not appear to be structurally weakened. No recommendation for repair at this time. Periodic inspection advised.

2D - Section I

Evidence of termite damage noted at Casing.

INSIDE OUT PEST CONTROL, INC.

Page 4 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection		Corresponding Report No.		Escrow No.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to perform any corrective work needed.

2E - Section I

Evidence of termite damage noted at Barge.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

2F - Section I

Evidence of termite damage noted at Header.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

2G - Section I

Evidence of termite damage noted at Trim.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

2H - Section I

Evidence of termite damage noted at Fascia.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

2I - Section I

Evidence of termite damage noted at Siding.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an

INSIDE OUT PEST CONTROL, INC.

Page 5 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection	Corresponding Report No.		Escrow No.	

Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

3. FUNGUS / DRYROT:

3A - Section I

Fungus and/or dry rot noted at Window Sill.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to perform any corrective work needed.

3B - Section I

Fungus and/or dry rot noted at Rafter.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

3C - Section I

Fungus and/or dry rot noted at Fascia.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

3D - Section I

Fungus and/or dry rot noted at Trim.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

3E - Section I

Fungus and/or dry rot noted at Siding.

INSIDE OUT PEST CONTROL, INC.

Page 6 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection		Corresponding Report No.		Escrow No.

RECOMMENDATION - Repair the damaged wood member(s) noted in the above. Should Infestation or Infection Extend Into an Inaccessible Area, Work Will Cease, and a Supplemental Report will be Issued with Our Findings, Recommendations and Costs. Replace with New Materials As Necessary. **During the Course of Repairs, Roofing Tiles, Stucco, Drywall, Decking, Flooring, Flashing and/or Gutters May Have Possible Damages Once Repairs Are Completed Due To The Process of Repairs. Inside Out Pest Control, Inc. is Not Responsible for Correcting Any Roofing, Gutters, Drywall or Stucco if Damages Occur and Does Not Guarantee Paint Color/Texture To Any Repairs That Are Made.**

4. OTHER FINDINGS:

4A - Section II

Water stains at Attic Roof Structure and/or Framing.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4B - Section II

Water stains and/or water damage at Ceiling at 2nd Story Bedroom.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4C - Section II

Water stains and/or water damage at Kitchen Cabinetry.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4D - Section II

Water stains at Livingroom Ceiling.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4E - Section II

Water stains at Closet Ceiling.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4F - Section II

Water damage at Window Sill.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4G - Section II

Water stains and/or water damage at Bathroom Baseboard and/or Wall.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any corrective work needed.

4H - Section II

Water stains and/or water damage at Bathroom Sink Cabinet.

RECOMMENDATION - Owner/agent should engage the services of a licensed Tradesman to check for leaks and to perform any

INSIDE OUT PEST CONTROL, INC.

Page 7 of 7 inspection report

2521	Edgerton Place	Port Hueneme	CA	93041
Address of Property Inspected		City	State	ZIP
06/08/2026	15504			
Date of Inspection	Corresponding Report No.		Escrow No.	

corrective work needed.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(805) 388-4343
Health Department	(805) 981-5101
Structural Pest Control Board	(916) 561-8700
2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815	



Inside Out Pest Control, Inc.

PO Box 968
Ventura CA 93002
(805) 658-2994

InsideOutJoseph@Gmail.com

Page 1 of 2

WORK AUTHORIZATION

Report #: 15504

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 2521 Edgerton Place

City: Port Hueneme

State/ZIP: CA 93041

The inspection report of the company dated, **06/08/2026** is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____. This total amount is due and payable within **30 days** from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of **ninety (90) days**. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof.

THE OWNER OR OWNER'S AGENT AGREES

To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. To account for inflation, the contract price shall be adjusted/renewed if the cost of raw materials or inputs increase. The parties agree to adjust the contract price proportionately to reflect such increases. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

PAYMENTS

We Accept Payments Sent By Check To PO Box 968 Ventura, CA 93002. Alternatively We Accept Payments Via Zelle with no Fee. Payments Via Credit/Debit Card Are Also Accepted With a 3.5% Fee.

ITEMS

Prefix	Section I	Section II	Further Inspection	Other
2A Primary (Thermigation)	3,850.00	0.00	0.00	0.00
2A Secondary (Localized Treatment)	850.00	0.00	0.00	0.00
2B (Repairs)	5,130.00	0.00	0.00	0.00
2D	Others	0.00	0.00	0.00
2E	Included in 2B	0.00	0.00	0.00
2F	Included in 2B	0.00	0.00	0.00
2G	Included in 2B	0.00	0.00	0.00
2H	Included in 2B	0.00	0.00	0.00
2I	Included in 2B	0.00	0.00	0.00
3A	Others	0.00	0.00	0.00
3B	Included in 2B	0.00	0.00	0.00
3C	Included in 2B	0.00	0.00	0.00
3D	Included in 2B	0.00	0.00	0.00
3E	Included in 2B	0.00	0.00	0.00
4A	0.00	Others	0.00	0.00
4B	0.00	Others	0.00	0.00

Property Owner:

Date:

Inspected By:

Date:

Owner's Agent:

Date:

**Inside Out Pest Control, Inc.**

PO Box 968
Ventura CA 93002
(805) 658-2994
InsideOutJoseph@Gmail.com

Page 2 of 2

WORK AUTHORIZATION**Report #: 15504**

Prefix	Section I	Section II	Further Inspection	Other
4C	0.00	Others	0.00	0.00
4D	0.00	Others	0.00	0.00
4E	0.00	Others	0.00	0.00
4F	0.00	Others	0.00	0.00
4G	0.00	Others	0.00	0.00
4H	0.00	Others	0.00	0.00
Section Subtotals				
Using Primary Rec	8,980.00	0.00	0.00	0.00
Using Secondary Rec	5,980.00	0.00	0.00	0.00

PLEASE INITIAL YOUR SELECTION BELOW**Primary Total:** \$8,980.00 _____**OR****Secondary Total:** \$5,980.00 _____

Property Owner:	Date:	Inspected By:	Date:
-----------------	-------	---------------	-------

Owner's Agent:	Date:
----------------	-------