

RCB Inspections and Termite Control
P.O. Box 20562
Bakersfield, CA 93390
Ph: (661) 398-2151
termitehawk1@gmail.com

STATEMENT	
PRINTED	03/09/2026
PAGE	1 of 1
REPORT #	W42845


Bill To: Al LaPlant
30435 Horsethief Dr.
Tehachapi, CA 93561

Remit To: RCB Inspections and Termite Control
PO BOX 20562
Bakersfield, CA 93390

REFERENCE NO.		SERVICE ADDRESS				
		30435 Horsethief Dr. Tehachapi, CA 93561				
INVOICE	DATE	ITEM	BILL DESCRIPTION	AMOUNT	PAYMENTS	BALANCE
41703	03/06/2026	1	Termite Inspection and Report.	\$95.00		\$95.00
PLEASE INCLUDE THE INVOICE NUMBER IN ALL CORRESPONDENCE						GRAND TOTAL
Balances that remain unpaid for 30 days may be subject to 1 1/2 % per month interest and/or lien fees.						\$95.00

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building Address: 30435 Horsethief Dr., Tehachapi, CA 93561		Date of Inspection 03/06/2025	Number of Pages 6
RCB Inspections and Termite Control P.O. Box 20562 Bakersfield, CA 93390 Ph: (661) 398-2151 termitehawk1@gmail.com			Report # W42845 Lic. Registration # PR 4980 Expire #
Ordered by: Coldwell Banker Preferred Susan Chandler	Property Owner and/or Party of Interest: Al LaPlant 30435 Horsethief Dr. Tehachapi, CA 93561	Report Sent to: Coldwell Banker Preferred Susan Chandler	
COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐			
General Description: Two story single family house with comp roof, furnished and occupied.		Inspection Tag Posted: Close Other Tags Posted: None	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.			
Subterranean Termites ☐ Drywood Termites ☐ Fungus / Dryrot ☒ Other Findings ☒ Further Inspection ☒			
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for the details on checked items.			

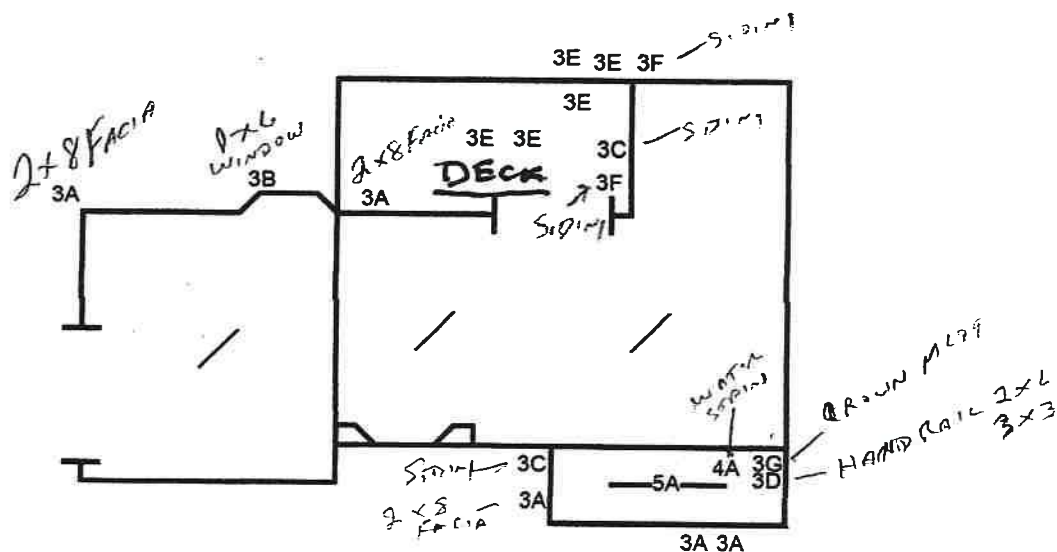

Front of House

This Diagram is not to scale

inspected by: Robert S Barton

State License No. OPR11212

Signature

Robert B. Barton

☐ I am unable to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceeding two years.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with the services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov

THIRD PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 30435 Horsethief Dr., Tehachapi, CA 93561

03/06/2026

W42845

Date

Report #

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

FINDINGS AND RECOMMENDATIONS

Fungus / Dryrot:

- 3A (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at fascia (2x8) as indicated on the diagram.
RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in the estimate.
- 3B (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at window trim (1x6) and siding trim (1x8) as indicated on the diagram.
RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in this estimate.
- 3C (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at siding (3-tier fiberboard) as indicated on the diagram.
RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in this estimate.
- 3D (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at handrail (2x6)(3x3) as indicated on the diagram.
RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in this estimate.
- * 3E (Section I) *Deck - Repaired 4/17/26 - FLEX*
FINDINGS: Evidence of dry-rot wood members noted at time of inspection at balcony framing, floor boards and main support beam as indicated on the diagram.
RECOMMENDATION: Contact proper tradesman to replace dry-rot damaged wood members and correct cause of any adverse conditions. If additional adverse conditions are found during repairs, further inspection is recommended and a supplemental report indicating any infection, adverse conditions or repairs will be made.
- 3F (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at exterior siding (textwood paneling) as indicated on the diagram.
RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in this estimate.

*RIGOR PENANieto - Deck Repair + Replacement
661-808-5404 \$4,500.00*

FOURTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address **30435 Horsethief Dr., Tehachapi, CA 93561**

03/06/2026

W42845

Date

Report #

- Findings and Recommendations continued from previous page -

3G (Section I)

FINDINGS: Dry-rot wood members found at time of inspection at porch crown molding as indicated on the diagram.

RECOMMENDATION: Replace dry-rot damaged wood members as necessary. No painting is included in this estimate.

Other Findings:

4A (Section II)

FINDINGS: Water stains noted at time of inspection at porch ceiling.

RECOMMENDATION: Contact proper tradesman to inspect for cause of water stains and correct if needed.

Further Inspection:

5A (Further Inspection)

FINDINGS: Inaccessible areas at under wood porch (no access/clearance) due to construction and or, storage, or other condition preventing inspection.

RECOMMENDATION: Owner to make area accessible for further inspection.

In accordance with the laws and regulations of the State of California, we are required to provide you with the following information prior to application of pesticides to your property.

"State law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized."

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately."

For further information, contact any of the following:

RCB Inspections and Termite Control (661) 398-2151

Poison Control Center (800) 222-1222

(Health Questions) County Health Dept.
Kern County (661) 862-8700

(Application Info.) County Agriculture Commission
Kern County (661) 868-6300

Structural Pest Control Board (Regulatory Info.) (916) 561-8704
2005 Evergreen Street, Ste. 1500 Sacramento, CA 95815

NOTICE TO OWNER

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

SIXTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address **30435 Horsethief Dr., Tehachapi, CA 93561**

03/06/2026

W42845

Date

Report #

Findings and Recommendations estimated by this Company:

Item	Approval	Primary Estimate	Section
3A	☐	\$425.00	I
3B	☐	\$215.00	I
3C	☐	\$325.00	I
3D	☐	\$295.00	I
3F	☐	\$495.00	I
3G	☐	\$445.00	I

☐ Complete all of the items quoted above with Primary Estimate.

Total Estimate \$2,200.00

☐ Complete only the above items checked.

Total \$ _____

Findings and Recommendations NOT estimated by this Company:

Owner or Authorized Representative shall contract others for completion of these items.

Items: 3E, 4A, 5A

*I have read and understand the terms of the Report referenced above and agree to the terms and conditions set forth.
RCB Inspections and Termite Control is hereby authorized to complete the items selected above and it is agreed that payment shall be made as follows:*

Payment shall be made as follows: ☐ With close of Escrow ☐ \$ _____ Deposit ☐ \$ _____ on Completion

Escrow Number: _____ Escrow Company: _____ Escrow Officer: _____

Phone () _____ - _____ Email: _____ Address: _____

Owner or Authorized Representative: ☐ Owner ☐ Representative's Title: _____

Print Name: _____ X _____ Date _____

Owner or Authorized Representative: ☐ Owner ☐ Representative's Title: _____

Print Name: _____ X _____ Date _____

SECOND PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 30435 Horsethief Dr., Tehachapi, CA 93561

03/06/2026

W42845

Date

Report #

What Is a Wood Destroying Pest and Organism Inspection Report?

The following explains the scope and limitations of a structural pest control inspection and a Wood Destroying Pest & Organism Inspection Report.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of wood destroying insects or organisms in visible and accessible areas on the date of inspection and contains our recommendations for correcting any infestations, infections, or conditions found. The contents of the wood destroying pest & organism inspection report are governed by the structural pest control act and its rules and regulations.

Some structures may not comply with building code requirements or may have structural, plumbing, electrical, heating and air conditioning, or other defects that do not pertain to this report. This report does not address any such defects as they are not within the scope of the license of the inspector or the company issuing this report.

The following areas are considered inaccessible for purposes of inspection or are not included in a normal inspection report and therefore are excluded in this report: the interior of hollow walls; spaces between an upstairs floor and the ceiling below or a porch deck and soffit below; stall showers over finished ceilings; such structural segments as areas enclosed by bay windows, buttresses, built in cabinet work, areas under floor covering; any areas requiring the removal of storage, furnishings or appliances; any areas to which there is no access without defacing or removing lumber, masonry or finished workmanship.

Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These areas include, but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than 18" clear crawl space, the interior of hollow walls, spaces between a floor or porch deck and the ceiling below, areas where there is no access without defacing or tearing out lumber, masonry or finished work that make inspection impractical, and areas or timbers around eaves that would require use of an extension ladder.

Certain areas may be inaccessible for inspection due to construction or storage. We recommend further inspection of areas where inspection was impractical. Re: Structural Pest Control Act, Article 6, section 8516 (b), paragraph 1990 (l). Amended effective March 1, 1974. Stall shower, if any, is water tested in compliance with Section 1991 (12) of the Structural Pest Control Act. The absence or presence of leaks through sub-floor, adjacent floors or walls will be reported. This is a report of the condition of the stall shower at the time of inspection only, and should not be confused as a guarantee. Although we make a visual examination, we do not deface or probe into window or door frames, decorative trim, roof members, etc., in search of wood destroying pests or organisms.

"This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs."

NOTE: We do not inspect or certify plumbing, plumbing fixtures, etc.

NOTE: "The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors' State License Board."

8514.5. "NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept RCB Inspections and Termite Control's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, RCB Inspections and Termite Control will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform."

"NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company."

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold-like conditions, please contact the appropriate mold professional.

"Local treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated."

FIFTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address **30435 Horsethief Dr., Tehachapi, CA 93561**

03/06/2026

W42845

Date

Report #

NOTE: If the Home Owner fails to pay billing in full, RCB Inspections and Termite Control will have the right to be paid back for all of its costs and expenses to the extent not prohibited by applicable law. Those expenses include, for example (but not limited to), reasonable attorney's fees. If for any reason this account is to be turned over to our collection agency, you will be responsible for all costs of collecting.