


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 2011	Street Rachelle Pl	City Escondido	ZIP 92025	Date of Inspection 07/21/2026	Number of Pages 5
 Pest Patrol, Inc. 9920 Scripps Lake Drive Suite 107 San Diego CA 92131 (760) 789-5889 office@pestpatrol.com WE WILL PRICE MATCH OR BEAT ANY COMPETITOR!				Report # : 22519 Registration # : PR1612 Escrow # : ☐ CORRECTED REPORT	
Ordered by: DD Castillo	Property Owner and Party of Interest: 2011 Rachelle Pl Escondido CA 92025 United States			Report sent to: DD Castillo	
COMPLETE REPORT ☒		LIMITED REPORT ☐		SUPPLEMENTAL REPORT ☐	
GENERAL DESCRIPTION: 1 story, slab foundation, single family residence, stucco siding, light weight concrete tile roof, and attached garage.				Inspection Tag Posted: Garage	
				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites ☐ Drywood Termites ☒ Fungus / Dryrot ☒ Other Findings ☒ Further Inspection ☐					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Diagram Not To Scale

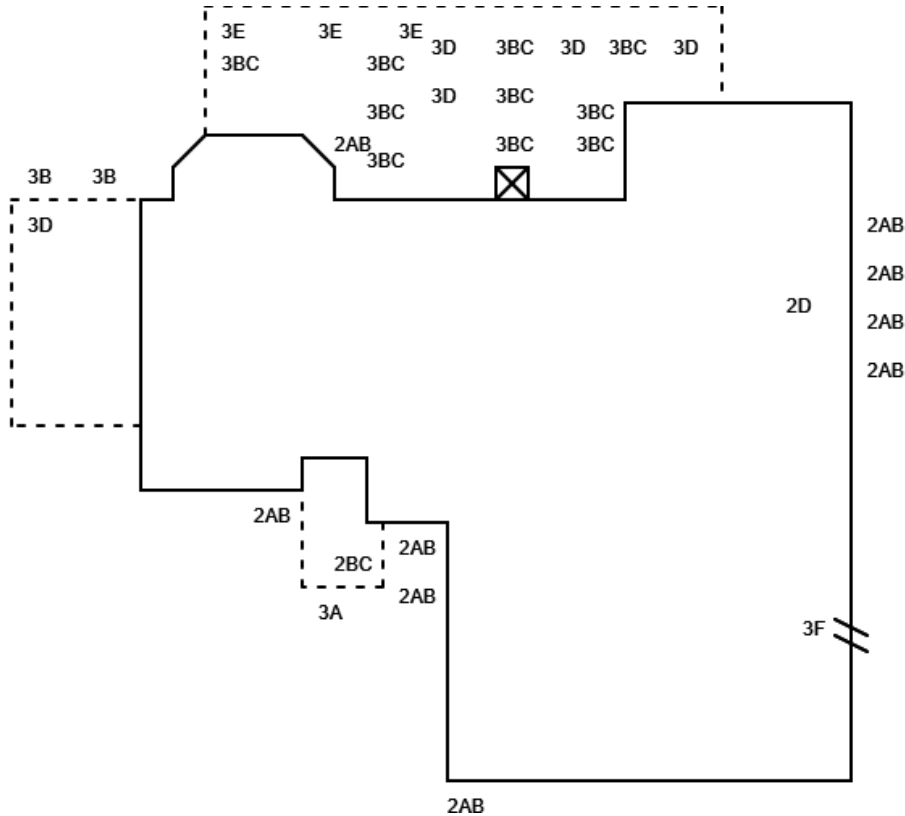

Inspected By: John Aguilera State License No. FR57429 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 04/2015)

PEST PATROL, INC.

Page 2 of 5 inspection report

2011	Rachelle Pl	Escondido	CA	92025
Address of Property Inspected		City	State	ZIP
07/21/2026	22519			
Date of Inspection		Corresponding Report No.		Escrow No.

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

This inspection report does not include findings for rats, mice, bats, other rodents or non-wood destroying pest.

PEST PATROL, INC.

Page 3 of 5 inspection report

2011	Rachelle Pl	Escondido	CA	92025
Address of Property Inspected		City	State	ZIP
07/21/2026		22519		
Date of Inspection		Corresponding Report No.		Escrow No.

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

2. DRYWOOD TERMITES:

2A - Section I

FINDING - Evidence of drywood termite infestations at fascia and rafter tail as indicated on the diagram.

RECOMMENDATION - Chemically treat visible and accessible infestations. Remove or cover accessible pellets.

Local chemical treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated.

2B - Section I

FINDING - Evidence of termite damaged wood members noted at time of inspection at fascia, rafter tail, and joist as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

2C - Section I

FINDING - Evidence of drywood termite infestations at joist as indicated on the diagram.

RECOMMENDATION - Chemically treat visible and accessible infestations. Remove or cover accessible pellets.

Local chemical treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated.

2D - Section I

FINDING - Evidence of drywood termite infestations at attic as indicated on the diagram.

RECOMMENDATION - EcoForce Thermal Treatment.

3. FUNGUS / DRYROT:

3A - Section I

FINDING - Dry-rot wood members found at time of inspection at beam as indicated on the diagram.

RECOMMENDATION - Repair the damaged wood member(s) as necessary. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

PEST PATROL, INC.

Page 4 of 5 inspection report

2011	Rachelle Pl	Escondido	CA	92025
Address of Property Inspected		City	State	ZIP
07/21/2026		22519		
Date of Inspection		Corresponding Report No.		Escrow No.

3B - Section I

FINDING - Dry-rot wood members found at time of inspection at pergola slats as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

3C - Section I

FINDING - Dry-rot wood members found at time of inspection at pergola joist as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

3D - Section I

FINDING - Dry-rot wood members found at time of inspection at pergola post as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

3E - Section I

FINDING - Dry-rot wood members found at time of inspection at pergola beam as indicated on the diagram.

RECOMMENDATION - Remove and replace and/or repair the damaged wood member(s) as necessary in currently available widths and grades. Minor damage may be filled, or where impractical, reinforcement will be done. If, upon performance of the work, the damage extends into inaccessible areas, a new supplemental report with cost estimate may be issued.

If the paint is provided for us, then painting is included in the price of the bid. If paint is not provided, we will prime the repaired/replaced area only.

3F - Section I

FINDING - Dry-rot wood members found at time of inspection at pedestrian door as indicated on the diagram.

RECOMMENDATION - Replace pedestrian door. Prior to work, door will need to be measured and ordered.

4. OTHER FINDINGS:

4A - Section II

FINDING - Water heater leaking in garage.

RECOMMENDATION - Owner/agent should engage the services of a water heater/restoration company to repair and inspect for mold.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

PEST PATROL, INC.

Page 5 of 5 inspection report

2011	Rachelle Pl	Escondido	CA	92025
Address of Property Inspected		City	State	ZIP
07/21/2026		22519		
Date of Inspection		Corresponding Report No.		Escrow No.

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(858) 694-2739
Health Department	(866) 358-2966
Structural Pest Control Board	(916) 561-8700
	2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815



Pest Patrol, Inc.
9920 Scripps Lake Drive Suite 107
San Diego CA 92131
(760) 789-5889
office@pestpatrol.com

WE WILL PRICE MATCH OR BEAT ANY COMPETITOR!

WORK AUTHORIZATION

Report #: 22519

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 2011 Rachele Pl

City: Escondido

State/ZIP: CA 92025

The inspection report of the company dated, **07/21/2026** is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____. This total amount is due and payable within **30 days** from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of ninety (90) days. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof. The quoted price is for all work being performed together. Should only a portion of the work be authorized, rather than the full recommended work, the price may change in cost.

THE OWNER OR OWNER'S AGENT AGREES

All services rendered and any additional services requested upon the completion of the work will be paid within thirty (30) days of their completion. For all properties that will be paid outside of escrow: 1) 30% of the invoice must be paid as a deposit before the work is performed. Any credit card transaction will be subject to a 2% service charge. 2) a card will be put on file, 3) should the invoice not be paid within thirty (30) days after the completion of the work, the card on file will be charged, 4) if the charge does not go through, an interest of one and one-half percent (1.5%) will be added to the invoice for each month it is not paid. In the case of non-payment by the owner, reasonable attorney fees and costs of collection shall be paid by the owner, whether the suit is filed or not.

In order for a property to be paid through escrow: 1) the property must be in escrow when the work is performed, 2) the buyer(s) must release contingencies before the work is performed, 3) escrow information must be provided including the escrow officer's name and email address. If all three of these conditions are not met, work must be paid for outside of escrow from the person who authorizes the work.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

ITEMS

Prefix	Section I	Section II	Further Inspection	Other
2A	450.00	0.00	0.00	0.00
2B	3,175.00	0.00	0.00	0.00
2C	See 2A	0.00	0.00	0.00
2D	1,400.00	0.00	0.00	0.00
3A	350.00	0.00	0.00	0.00
3B	5,350.00	0.00	0.00	0.00
3C	See 3B	0.00	0.00	0.00
3D	See 3B	0.00	0.00	0.00
3E	See 3B	0.00	0.00	0.00
3F	985.00	0.00	0.00	0.00
4A	0.00	N/A	0.00	0.00
Total:	11,710.00	0.00	0.00	0.00

Property Owner:

Date:

Inspected By:

Date:

Owner's Agent:

Date:



Pest Patrol, Inc.

9920 Scripps Lake Drive Suite 107
San Diego CA 92131
(760) 789-5889
office@pestpatrol.com

Page 2 of 2

WE WILL PRICE MATCH OR BEAT ANY COMPETITOR!

WORK AUTHORIZATION

Report #: 22519

Prefix	Section I	Section II	Further Inspection	Other
GRAND TOTAL:	11,710.00			

Property Owner:	Date:	Inspected By:	Date:
-----------------	-------	---------------	-------

Owner's Agent:	Date:
----------------	-------