

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

BUILDING NO. 3050	STREET, CITY, STATE, ZIP Motor Avenue, Los Angeles CA 90064	Date of Inspection 7/23/2026	No. of Pages 9
 ELITEGROUP INSPECTION PROFESSIONALS California's Most Trusted Inspection Company Since 1984 15963 PIUMA AVENUE CERRITOS, CA 90703 562-291-1881 562-928-8504 FAX elitegroup@brotherstermite.com			
Firm Registration No. PR 5758		Report No. 18112	Escrow No.
Ordered By: Michael Otto & David Martinez Attn: 510-432-0517- cell office@leeziff.com		Property Owner/Party of Interest Todd & Mark Slavkin	Report Sent To:
COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐			
General Description: Three story stucco home with a composition and tile roof, an attached deck, balcony and an attached two car garage (occupied and furnished).		Inspection Tag Posted: Attic.	
		Other Tags Posted: None.	
An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.			
Subterranean Termites ☐ Drywood Termites ☒ Fungus/Dryrot ☒ Other Findings ☒ Further Inspection ☒			
If any of above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.			

NOTE: DIAGRAM IS DISPLAYED ON PAGE 2

Inspected by Richard Leitner Jr. State License No. FR 49131

Signature




You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceeding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control board at (916) 561-8708, or (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (Rev. 04/2015)

18112

REPORT NO.

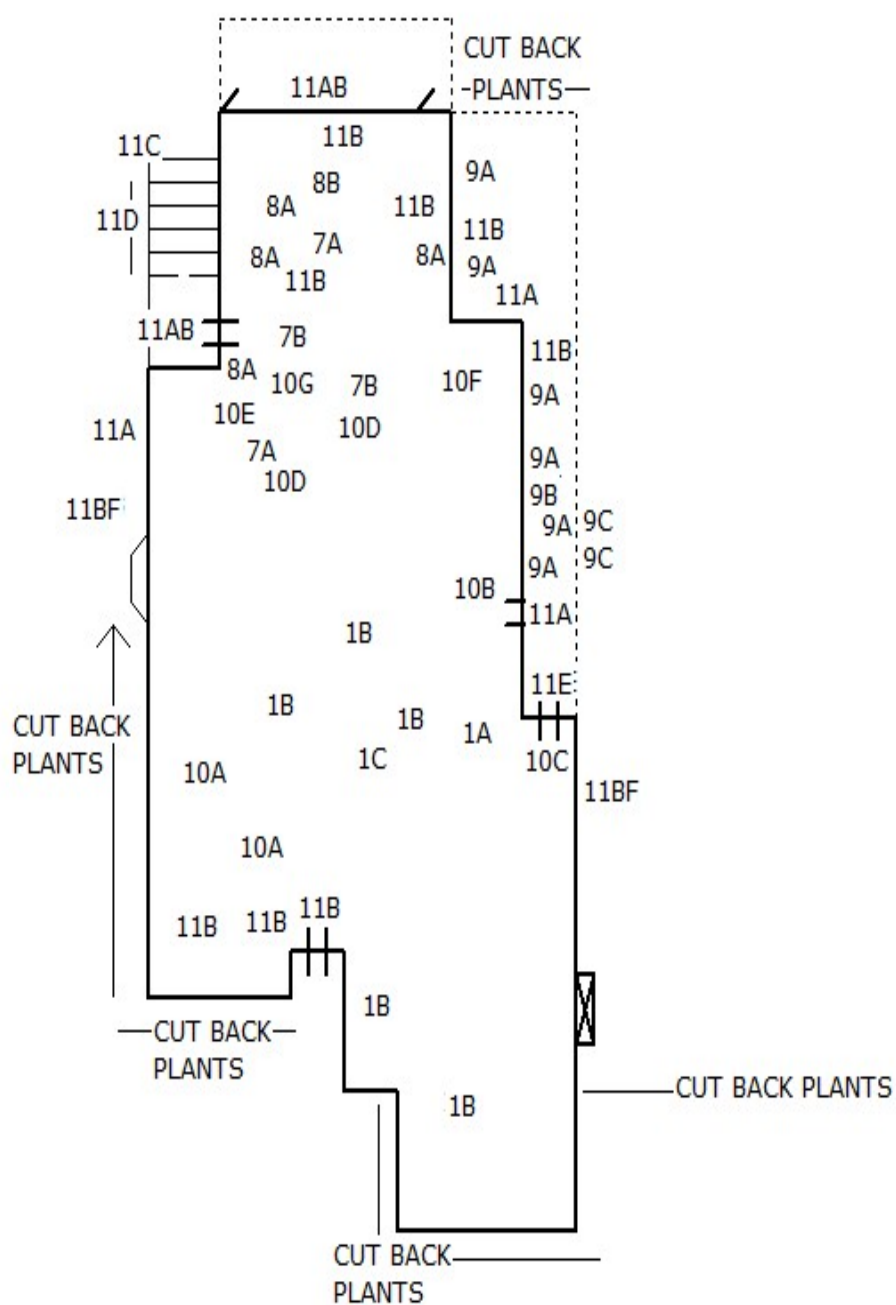

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

A. Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These include but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than 18" clear crawl space, the interior of hollow walls; spaces between a floor or porch deck and the ceiling below; area where there is no access without defacing or tearing out lumber, masonry or finished work; areas behind stoves, refrigerators or beneath floor coverings, furnishings; areas where encumbrances and storage conditions or locks make inspection impractical, portions of the subarea concealed or made inaccessible by ducting or insulation, areas beneath wood floors over concrete, and areas concealed by heavy vegetation. Areas or timbers around eaves were visually inspected from the ground level only. We do not inspect fences, sheds, dog houses, detached patios, detached wood decks, wood retaining walls or wood walkways. We assume no responsibility for work performed by anyone else, for damage to structure or contents during our inspection, or for infestation, infection, adverse conditions or damage undetected due to inaccessibility or non-disclosure by owner/agent/tenant.

B. Slab floor construction has become more prevalent in recent years. Floor coverings may conceal cracks in the slab that will allow infestation to enter. During an inspection, areas under slab floors are inaccessible. This company assumes no responsibility for any infestation which may exist under the slab flooring. Infestation in the walls may be concealed by plaster so that a diligent inspection may not disclose the true condition. These areas are not practical to inspect because of health hazards, damage to the structure; or inconvenience. They were not inspected unless described in this report. We recommend further inspection if there are any questions about the above noted areas. Ref: Structural Pest Control Act, Article 6, Section 8516(b), paragraph 1990(i). Amended effective March 1, 1974. Inspection is limited to disclosure of wood destroying pest or organisms as set forth in the Structural Pest Control Act, Article 6, Section 8516(b), Paragraph 1990-1991.

C. This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each re-inspection. The re-inspection must be done within ten (10) working days of request. The re-inspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from the parties performing the repairs.

D. This company is not responsible for work completed by others, recommended or not, including by the owner. Contractor bills should be submitted to escrow as certification of work completed by others.

E. This report includes findings related to the presence/non-presence of wood destroying organisms and/or visible signs of leaks in the accessible portions of the roof. **The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors State License Board.**

F. Second story stall showers are inspected but not water tested unless there is evidence of leaks in the ceiling below. Sunken or below grade showers or tubs are not water tested due to their construction.

G. During the course of/after opening walls or any previously concealed areas, should any further damage or infestation be found, a supplementary report will be issued. Any work completed in these areas would be at the owner's direction and additional expense.

H. During the process of treatment or replacement it may be necessary to drill noted through ceramic tiles or other floor coverings; these holes will then be sealed with concrete. We will exercise due care but assume no responsibility for cracks, chipping or other damage to floor coverings. We do not re-lay carpeting.

I. We assume no responsibility for damage to any plumbing, gas or electrical lines, etc., in the process of pressure treatment of concrete slabs or replacement of concrete or structural timbers.

J. When a fumigation is recommended, we will exercise all due care but assume no responsibility for damage to shrubbery, trees, plants, or tv antennas on roofs. A fumigation notice will be left with, or mailed to the owner of this property, or his designated agent. Occupants must comply with instructions contained in the fumigation notice. During fumigation and aeration, the possibility of burglary exists, as it does any time you leave your home. Therefore, we recommend that you take any steps that you feel necessary to prevent any damage to your property against any loss, damage or vandalism to your property. This company does not provide any onsite security except as required by state or local ordinances and does not assume any responsibility for care and custody of the property in case of vandalism, breaking or entering.

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

K. Second floor timbers (rafters, sheathing, fascia) are inspected from the ground level.

L. This company does no painting unless specified in this report. This company assumes no responsibility for future plumbing leaks (toilets & showers). If repairs are made to wood members, our company will not be responsible for damage to the roof.

M. Nothing expressed or mentioned in this Agreement is intended or shall be construed to give any person, other than the parties hereto and their respective successors and assigns, any legal or equitable right, remedy or claim under or in respect of this Agreement or any provisions herein contained, this Agreement and any conditions and provisions hereof being intended to be and being for the sole and exclusive benefits of the parties hereto and their respective successors and assigns, and for the benefit of no other person.

N. The total amount of this contract is due and payable upon completion of work unless otherwise specified. A finance charge computed at a monthly rate of 1.5% of the unpaid balance (annual percentage rate of 18%) will be added to all accounts past due.

O. Owner/agent/tenant acknowledges and agrees that inspection of the premises will not include any type of inspection for the presence or non-presence of asbestos and that this report will not include any findings or opinions regarding the presence or non-presence of asbestos in, upon or about the premises, we recommend that you contact a contractor specifically licensed to engage in asbestos related work. Further, should we discover the presence of asbestos during our inspection of the premises or should our inspection of the premises cause a release of asbestos dust or particles, owner/agent/tenant shall be solely responsible for the cleanup, removal and disposal of the asbestos and the cost thereof. Owner/agent/tenant hereby agrees to waive any and all claims against this company which are in any way related to the presence of asbestos on the premises and further agrees to indemnify and hold this company harmless from any and all claims of any nature asserted by any third party, including this Company's employees, which is in any way related to the presence of asbestos on the premises.

P. This property was not inspected for the presence or absence of health related molds or fungi. By California law we are neither qualified, authorized, nor licensed to inspect for fungi. If you desire information about the presence or absence of health related molds, you should contact an industrial hygienist.

Q. A shower pan repair is an isolated repair to a portion of an entire shower. Any glass removed to facilitate a pan replacement is done as a courtesy. If damage occurs to the glass or metal, it will be replaced at the owner's expense. Glass re-installed at the request of the homeowner will be installed without warranty. New glass doors or panels furnished by an appropriate contractor may be recommended.

R. Any building permit required for the completion of the repair work must be obtained by the property owner. Some repairs may require a building permit.

S. Pesticides are the products this company uses to control the target pest listed in your inspection report. Pesticides make a better life for all of us. They help control disease carriers, thus protecting your health and property. When properly used, pesticides pose no problem to man or to the environment. Your technician is a state certified applicator and is constantly being upgraded by our training sessions. If you have any questions, please contact your inspector or a representative from our company. State law requires that you be given the following informational form "Caution--Pesticides are Toxic Chemicals". Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800-876-4766) and this company immediately. For further information, contact any of the following: for health questions--the county health department (213-250-8055); for application information--the county agricultural commissioner (626-575-5466) and for regulatory information--the Structural Pest Control Board (800-737-8188, 2005 Evergreen Street Suite 1500 Sacramento CA 95815).

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

T. The Structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

U. The charge for service that this company subcontracts to another person or entity may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor.

V. Fumigations are guaranteed for a period of two years; all other work is guaranteed for a period of one year.

Subcontractors:

FUMIGATIONS PERFORMED BY: **A-1 Fumigation Inc. (562) 866-7535**

STALL SHOWER PANS INSTALLED BY: **Artisan Builders (909) 595-7266**

REPAIR WORK PERFORMED BY: **Brothers Termite Inc. (562) 927-5541**

Chemical Disclaimer - Insecticides utilized for local chemical treatment:

- Termidor SC EPA #7969-210 (Fipronil 0.06%)
- PT Cy-Kick EPA #499-470 (Cyfluthrin 0.1%)
- Bora-Care **EPA #64405-1** (Disodium Octaborate Tetrahydrate 40%)
- Termidor Foam EPA #499-563 (Fipronil - 0.005%)

Chemical Disclaimer - Gas utilized for fumigation:

- Vikane (Active Ingredient: Sulfuryl Fluoride)

Areas Inspected/Not Inspected

1. SUBSTRUCTURE: 50 % ACCESSIBLE, DRY
2. STALL SHOWER: 1 TESTED: NOT LEAKING / 2 NOT TESTED: UPSTAIRS
3. FOUNDATIONS: RAISED
4. PORCHES-STEPS: CONCRETE
5. VENTILATION: ADEQUATE
7. ATTIC SPACES: 50 % ACCESSIBLE, INSULATION, DUCTS
8. GARAGES: ATTACHED 2 CAR, ENCLOSED WALLS, STORAGE
9. DECKS-PATIOS: WOOD DECK, STUCCO BALCONY

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Separated Reports

Each item in a separated report will be defined as Section I or Section II conditions that are evident on the date of the inspection:

-**Section I** items have visible evidence of active infestation, infection or conditions that have resulted in or from infestation/infection.

-**Section II** items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found.

-**Further Inspection** items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

Substructure Areas:

ITEM 1A Scrap wood and cellulose debris noted in the subarea.

Rec: Clean out the debris and remove from the premises.

***** This is a Section 2 Item *****

ITEM 1B Water stains noted at the subfloor and floor joist.

Rec: Scrape and treat with a wood preservative.

***** This is a Section 2 Item *****

ITEM 1C Surface fungus noted at the subfloor.

Rec: Scrape the fungus and treat with a wood preservative.

***** This is a Section 1 Item *****

Attic Spaces:

ITEM 7A Tradesman to correct - not included in this estimate
Water stains noted at the attic sheathing.

Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 7B Evidence of drywood termites noted in the attic.

Rec: Fumigate the entire structure with Vikane gas; seal or enclose the building with tarps.

***** This is a Section 1 Item *****

Garages:

ITEM 8A Tradesman to correct - not included in this estimate
Stucco cracks noted at the garage ceiling and walls.

Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 8B Excessive storage noted in the garage.

Rec: If the storage has been removed, then further inspection can be performed.

***** Unknown Further Inspection Recommended *****

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Decks - Patios:

ITEM 9A Surface fungus noted under the deck boards.

Rec: Scrape the fungus and treat with a wood preservative.

***** This is a Section 1 Item *****

ITEM 9B Prior to scheduling the fumigation, the home must be assessed by a fumigation coordinator to determine the optimal method of putting the tarp around the tree growing through the deck.

***** Information Item *****

ITEM 9C Dry rot noted at the deck posts.

Rec: Remove the damaged wood. If no further damage is exposed, install new lumber. NOTE: If further inspection reveals an infestation/infection in the wood, a supplemental report will be issued and an additional cost may apply.

***** This is a Section 1 Item *****

Other - Interiors:ITEM 10A Tradesman to correct - not included in this estimate
Plaster damage noted at the primary bedroom ceiling.Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 10B Tradesman to correct - not included in this estimate
Plaster damage noted at the downstairs stairway wall.Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 10C Tradesman to correct - not included in this estimate
Water stains noted at the ceiling.Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 10D Tradesman to correct - not included in this estimate
Plaster damage noted at the upstairs hallway ceiling.Rec: Owner to contact a proper tradesman to inspect and advise.

***** This is a Section 2 Item *****

ITEM 10E Tradesman to correct - not included in this estimate
Loose toilet noted in the upstairs hallway bathroom.Rec: Reset the toilet.

***** This is a Section 2 Item *****

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Other - Interiors:

ITEM 10F Tradesman to correct - not included in this estimate
Plaster damage noted at the upstairs bedroom ceiling.

Rec: Owner to contact a proper tradesman to inspect and advise.
***** This is a Section 2 Item *****

ITEM 10G Tradesman to correct - not included in this estimate
Damaged wood floor noted at the upstairs hallway bathroom.

Rec: Owner to contact a proper tradesman to inspect and advise.
***** Information Item *****

Other - Exteriors:

ITEM 11A Dry rot noted at the threshold, window sill and doors leading to the deck.

Rec: Remove the damaged wood. If no further damage is exposed, install new lumber. NOTE: If further inspection reveals an infestation/infection in the wood, a supplemental report will be issued and an additional cost may apply.
***** This is a Section 1 Item *****

ITEM 11B Tradesman to correct - not included in this estimate
Peeling paint noted on the shutters, windows, door leading the the balcony and window sill.

Rec: Scrape the wood and then apply a coat of paint.
***** This is a Section 2 Item *****

ITEM 11C Tradesman to correct - not included in this estimate
Barewood noted at the steps.

Rec: Apply a coat of paint.
***** This is a Section 2 Item *****

ITEM 11D Tradesman to correct - not included in this estimate
Cracked stucco noted at the exterior.

Rec: Apply a stucco patch.
***** This is a Section 2 Item *****

ITEM 11E Water damage noted at the door under the deck.

Rec: Replace the damaged door.
***** This is a Section 2 Item *****

ITEM 11F Tradesman to correct - not included in this estimate
Dry rot noted at the windows.

Rec: Replace the damaged wood.
***** This is a Section 1 Item *****

3050

Motor Avenue, Los Angeles CA 90064

7/23/2026

18112

BUILDING NO.

STREET, CITY, STATE, ZIP

INSPECTION DATE

REPORT NO.

Roof Disclaimer

While placing and removing tarpaulins, in the course of the fumigation of this structure, damage may occur to the roof. The amount of damage cannot be predetermined. Precautions will be taken to minimize damage. This company is not making any guarantees that damage will or will not occur during the fumigation process.

Plant Disclaimer

While placing and removing tarpaulins, in the course of the fumigation of this structure, damage/death of the foliage may occur. The amount of damage cannot be predetermined. Precautions will be taken to minimize plant damage/death. This company is not making any guarantees that damage/death will or will not occur during the fumigation process.

Escrow Information

I authorize funds to be held by my contracted escrow company. I will instruct them to disburse funds, to this company, upon the closing or cancellation of the transaction.

ESCROW COMPANY'S NAME _____ TELEPHONE # _____

ESCROW OFFICER'S NAME _____ ESCROW # _____

Work Authorization

I. I have read and understand this WDO inspection report.

II. I authorize the following items to be performed: _____.

III. I agree to pay the proposed cost of: _____.

signature_____
printed name_____
date

SECTION 1 COST: \$9622.00 **EXCLUDING ITEM 11F**

FUME COST: \$4270 + REPAIR COST: \$5352

SECTION 2 COST: \$1996.00 (ITEMS 1A, 1B & 11E)

OPTIONAL PAINTING COST: \$804.00

Select payment method: o Credit/Debit Card o Zelle o Check o Escrow

A deposit of 50% is required prior to starting the job. The balance is due upon completion.

Please contact us at least 20 days in advance, to schedule an appointment.