

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1764	Street DEAVERS DR	City SAN MARCOS	Zip 92069	Date of Inspection 09/12/26	Number of Pages 1 of 4
-----------------------------	-----------------------------	---------------------------	---------------------	---------------------------------------	----------------------------------

**TURBO
TERMITE**

TURBO TERMITE & REPAIR
1561 SAN PEDRO POINT CT
CHULA VISTA, CA 91911
Phone: (619)422-0123 Fax: (619)422-1877

Report # 266310

Ordered by:
TRIOLO REALTY GROUP
DARIN TRIOLO
12750 HIGH BLUFF DR
SAN DIEGO, CA 92130
W: 619-804-5686

Property Owner and/or Party of Interest:

Report sent to:
TRIOLO REALTY GROUP
DARIN TRIOLO
12750 HIGH BLUFF DR
SAN DIEGO, CA 92130
W: 619-804-5686

COMPLETE REPORT ☒
LIMITED REPORT ☐
SUPPLEMENTAL REPORT ☐
REINSPECTION REPORT ☐

General Description:
2 Story, single family residence, concrete slab, attached garage, wood frame & stucco, occupied w/ tile roof.


Inspection Tag Posted:

Other Tags Posted:

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☐
Drywood Termites ☒
Fungus / Dryrot ☒
Other Findings ☐
Further Inspection ☐

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

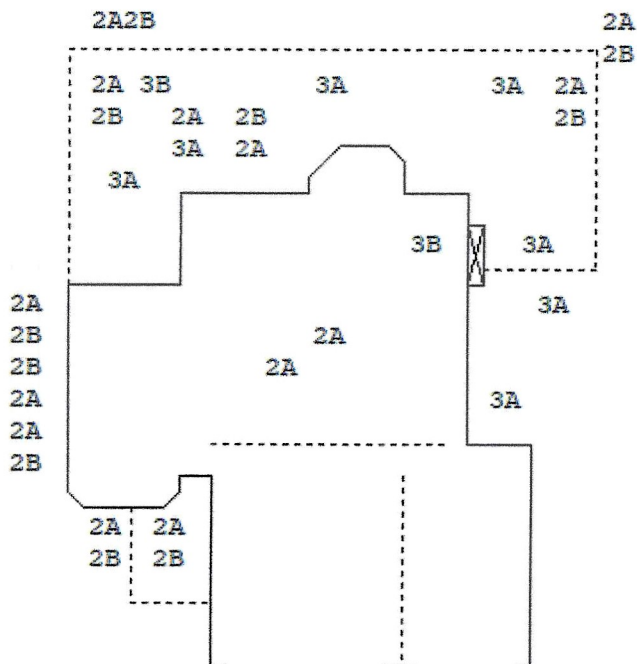

Inspected by: **JOSE J FLETES**

State License No. **OPR4023**

Signature

Jose J. Fletes

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (REV. 10/01)

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1764	Street DEAVERS DR	City SAN MARCOS	Zip 92069	Date of Inspection 09/12/26	Report # 266310	Page 2 of 4
-----------------------------	-----------------------------	---------------------------	---------------------	---------------------------------------	---------------------------	-----------------------

Thank you for selecting Turbo Termite & Repair to perform a structural pest control inspection on your property. Please read and become familiar with the contents of this report. Items in this report are designated to eliminate damage as a result of wood destroying pests and organisms and adverse conditions which lead to same. This inspection is not designed to bring the dwelling into existing code compliance. Any additional information regarding same will have to be obtained from the local building department. Any additional required work is subject to a supplemental report and additional costs if applicable. Painting and primer not included unless otherwise stated in our report.

A registered structural pest control company shall provide the owner, or owner's agent, and tenant of the premises for which the work is to be done with clear written notice which contains the following statements and information using words with common and everyday meaning:

- (1) The pest to be controlled.
- (2) The pesticide or pesticides proposed to be used, and the active ingredient or ingredients.

"State law requires that you be given the following information: CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control operators are licensed and regulated by the structural pest control board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are not appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." "If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately." For further information contact any of the follow: Turbo Termite & Repair 619-422-0123, for health questions - the San Diego County Health Department 619-338-2222, for application - the County Agriculture Commissioner 619-694-2739, and for regulatory information - the Structural Pest Control Board at 1418 Howe Avenue, Sacramento, CA 95825, 800-737-8188, Poison Control 800-876-4766.

At times Turbo Termite & Repair may find it necessary to use a subcontractor for the purposes of fumigation. In this instance you will be provided with the appropriate emergency numbers for the subcontracted fumigation company (see the occupants notice of fumigation).

AREAS NOT INSPECTED. PLEASE READ.

We did not inspect the interior of finished walls or behind installed finished cabinet work. The interior was furnished at the time of our inspection with carpets installed. We did not inspect the areas immediately under furniture, appliances or carpets. In slab floor type of construction, it is possible for subterranean termite infestations to be concealed and not evident at the time of our inspection. We assume no liability for any infestations that are not evident at the time of our inspection. We did not inspect the roof covering for leakage. Inspection of these areas is not practical. Our inspection does not include inspection of the electrical, plumbing, heating or mechanical systems in the structure. Our inspection will not detect building code violations. If any information is desired about any of these areas, a company who makes home inspections should be engaged. It is possible for wood destroying organisms, infestations and infections to be concealed and not evident at the time of our inspection. THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS STATE LICENSE BOARD.

NOTE: We make no guarantee as to workmanship, effectiveness, or in any other way, of work performed by others. Any guarantee desired should be secured from persons performing this work.

We guarantee treatments done by this company for six months from the completion. Fumigations are guaranteed for two

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
1764	DEAVERS DR	SAN MARCOS	92069	09/12/26	266310	3 of 4

years from the date of the fumigation. We cannot guarantee work done by the owners or the owners' agent. We make no guarantee against future infections/infestations, adverse conditions/damage or conditions/damage present but not evident at the time of our inspection.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

If, during the performance of any repairs or reinspections by this company, any infestations or infections are revealed that were not evident at the time of our original inspection, we would issue a supplemental report with findings, recommendations and additional costs for corrections.

This is a separated report which is defined as Section I/Section II conditions evident on the date of inspection. Section I contains items where there is evidence of active infestation, infection or conditions that have resulted in or from infestation or infection. Section II items are conditions deemed likely to lead to infestation or infection, but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

NOTE: Turbo Termite inspects second story eaves visually from the ground only.

ROOF DISCLOSURE: (A) The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

SECOND OPINION DISCLOSURE: NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.) However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

SUBCONTRACTOR COST DISCLOSURE: NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Turbo Termite and Repair's bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company Turbo Termite and Repair will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform.

SECTION I:

(2) DRYWOOD TERMITES

2A. FINDING: Infestation by drywood termites noted in attic, window trim, roof eaves, fascia boards and patio cover. Infestation appears to extend into inaccessible areas.

RECOMMENDATION: Due to the nature of these infestations, it will be necessary to seal the entire structure and fumigate it with Vikane (Sulfuryl Flouride). We will use tear gas (Chloropicrin) as a warning agent. The entire structure must be vacant for at least 48 hours for this process. We will use all due caution in our operation, however, we assume no liability for any damage to the roof coverings, solar panels, TV antennas or plantings adjacent to the structure. The occupants must sign the Occupants Fumigation Notice and comply with all of the instructions. SECTION I ITEM.

NOTE: Instruction for prep work will be forthcoming from the fumigation company and must be complied

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Report #	Page
1764	DEAVERS DR	SAN MARCOS	92069	09/12/26	266310	4 of 4

with in order for fumigation to commence.

2B. FINDING: Dry wood termite damage noted in window trim, roof eaves, fascia boards, rafter tails, patio cover joices, blocks, lattice,braces and post.

RECOMMENDATION: Remove & replace damaged wood members as needed. SECTION I ITEM.

(3) FUNGUS/DRYROT

3A. FINDING: Fungus damage noted in garage door pywood,fascia board, rafter tails, fascia trim, patio cover joices, brace, fascia boards, blocks, lattice and post trim, due to prolonged exposure.

RECOMMENDATION: Remove & replace damaged wood members as needed. SECTION I ITEM.

SEE 2B FOR COST

NOTE: We will need a scaffold(INCLUDED IN PRICE).

WORK AUTHORIZATION CONTRACT

Building No. 1764	Street DEAVERS DR	City SAN MARCOS	Zip 92069	Date of Inspection 09/12/26	Page No. 1
TURBO TERMITE		TURBO TERMITE & REPAIR			
		1561 SAN PEDRO POINT CT			
		CHULA VISTA, CA 91911			
		Phone: (619)422-0123			
		Fax: (619)422-1877			
Registration # PR4023			For Report # 266310		

ITEMIZED COST BREAKDOWN (Refer to items on the report)

	Primary Work Bid	Secondary Work Bid
SECTION 1:	2A: \$2900.00	
	2B: \$6680.00	*** TOTAL: \$0.00
	3A: SEE 2B FOR COST	
	*** TOTAL: \$9580.00	
SECTION 2:	NONE	NONE
FURTHER INSPECTION:	NONE	NONE
TOTAL:	\$9580.00	\$0.00

THIS IS A BINDING CONTRACT between our company and , and incorporates our termite report # 266310 dated 09/12/26 for real property located at 1764 DEAVERS DR SAN MARCOS CA 92069. Items on the report may contain provisions for additional costs over and above the original estimate. Please read the report carefully and completely.

CONDITIONS:

1. This offer is limited to 4 months from the date of the report.
2. If further inspection is recommended, or if additional work is required, we will provide prices or recommendations for correction. Interested parties will be notified prior to any work being done.
3. Notice to owner of Mechanic's Lien as required by the Structural Pest Control Board: Under the California Mechanics Lien Law, any structural pest control operator who contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.
4. We will use due caution and diligence in their operations and care will always be taken to minimize any damage, but assumes no responsibility for matching existing colors and styles, or for incidental damage to roof coverings, TV antennas, solar panels, rain gutters, plant life, paint or wall coverings. There may be health related issues associated with the structural repairs reflected in the inspection report referenced by this work authorization contract. These health issues include but are not limited to the possible release of mold spores during the course of repairs. We are not qualified to and do not render any opinion concerning such health issues or any special precautions. Any questions concerning health issues or

WORK AUTHORIZATION CONTRACT

Building No.	Street	City	Zip	Date of Inspection	Page No.
1764	DEAVERS DR	SAN MARCOS	92069	09/12/26	2

**TURBO
TERMITE**

TURBO TERMITE & REPAIR
1561 SAN PEDRO POINT CT
CHULA VISTA, CA 91911
Phone: (619)422-0123
Fax: (619)422-1877

Registration # PR4023

For Report # 266310

any special precautions to be taken prior to or during the course of such repairs should be directed to a Certified Industrial Hygienist before any such repairs are undertaken. By executing this work authorization contract, customer acknowledges that he or she has been advised of the foregoing and has had the opportunity to consult with a qualified professional.

5. This report is limited to the accessible areas of the structure shown on the diagram. Please refer to the report for areas not inspected and further information.

6. **TERMS OF PAYMENT.** We agree to pay the sum of _____ upon issuance of Notice of Work Completed. Accounts are past due thirty days (30DAYS) after date of completion a 1.5% per month interest will be charged on unpaid balances unless prior arrangements have been made.

7. We instruct , holder of escrow number _____ to pay the sum of _____ upon close of escrow. Close of escrow date: _____ Phone # . We understand that we are responsible for payment, and if escrow does not close within 30 days of completion of work we will pay the amount due in full, and upon notification late fees may apply if payment is not made.

8. We authorize this company to perform items

_____ for a contract price of _____.

NAME OF PERSON TO CONTACT FOR ACCESS: _____ **PHONE #** _____

SIGNED _____ **DATE** _____

OWNER OR OWNER'S AGENT

It is assumed that if an agent orders work on the owners behalf, and that they were notified prior by said agent, that if payment is not made by the agent or escrow company it will be the responsibility of the owner to produce payment.

TURBO TERMITE & REPAIR
1561 SAN PEDRO POINT CT
CHULA VISTA, CA 91911
Phone: (619)422-0123
Fax: (619)422-1877

INVOICE # 12424

**TO: TRIOLO REALTY GROUP
DARIN TRIOLO
12750 HIGH BLUFF DR
SAN DIEGO, CA 92130**

THANK YOU