



Your Inspection Report

1330 Stonewood Court
San Pedro, CA 90732

PREPARED FOR:
ANTONIETTA LAURO

INSPECTION DATE:
Wednesday, March 11, 2026

PREPARED BY:
John Cipres



ANDREAS FAULT

Andreas Fault Property Inspections
14252 Culver Dr, Suite A-933
Irvine, CA 92604

323-855-7791

www.andreasfaultpro.com
John@andreasfaultpro.com



Scan to download
report

March 11, 2026

Dear Antonietta Lauro,

RE: Report No. 1569
1330 Stonewood Court
San Pedro, CA
90732

Thanks very much for choosing us to perform your home inspection. The inspection itself and the attached report comply with the requirements of the Standards of Practice of our national Association. This document defines the scope of a home inspection.

Clients sometimes assume that a home inspection will include many things that are beyond the scope. We encourage you to read the Standards of Practice so that you clearly understand what things are included in the home inspection and report.

The report has been prepared for the exclusive use of our client. No use by third parties is intended. We will not be responsible to any parties for the contents of the report, other than the party named herein .

The report is effectively a snapshot of the house, recording the conditions on a given date and time. Home inspectors cannot predict future behavior, and as such, we cannot be responsible for things that occur after the inspection. If conditions change, we are available to revisit the property and update our report.

The report itself is copyrighted, and may not be used in whole or in part without our express written permission.

Again, thanks very much for choosing us to perform your home inspection.

Sincerely,

John Cipres
on behalf of
Andreas Fault Property Inspections



INVOICE

March 11, 2026

Client: Antonietta Lauro

Report No. 1569

For inspection at:

1330 Stonewood Court

San Pedro, CA

90732

on: Wednesday, March 11, 2026

Property Inspection

\$450.00

Total

\$450.00

PAID IN FULL - THANK YOU!

Andreas Fault Property Inspections
14252 Culver Dr, Suite A-933
Irvine, CA 92604
323-855-7791
www.andreasfaultpro.com
John@andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document.

[Priority Maintenance Items](#)

Exterior

WALLS \ Soffits (underside of eaves) and fascia (front edge of eaves)

Condition: • [Rot or insect damage](#)

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Various Front Rear Exterior

Task: Repair or replace Further evaluation

Time: Discretionary

WALLS \ EIFS (Exterior Insulation and Finishing System) and Stucco

Condition: • [Crumbling](#)

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Rear Exterior

Task: Repair

Time: Immediate

Cost: Minor

Condition: • [Minor cracks](#)

Implication(s): Shortened life expectancy of material

Location: Various Rear Exterior

Task: Repair Monitor

Electrical

SERVICE BOX, GROUNDING AND PANEL \ Distribution panel

Condition: • [Openings in panel](#)

Implication(s): Electric shock | Fire hazard

Location: Rear Exterior

Task: Repair Improve

Time: Immediate

Cost: Minor

Condition: • [Arc Fault Circuit Interrupter \(AFCI\) test faulty](#)

Implication(s): Fire hazard

Location: Kitchen

Task: Repair Further evaluation

Time: Immediate

Cost: Minor

DISTRIBUTION SYSTEM \ Outlets (receptacles)

Condition: • [GFCI/GFI needed \(Ground Fault Circuit Interrupter\)](#)

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Implication(s): Electric shock

Location: Garage

Task: Provide

Time: Immediate

Cost: Minor

Heating

FURNACE \ Life expectancy

Condition: • [Inoperative](#)

Found off by The Gas Company

Implication(s): No heat for building

Location: First Floor

Task: Repair Further evaluation Service

Time: Immediate

FURNACE \ Ducts, registers and grilles

Condition: • [Disconnected ducts](#)

Implication(s): Increased heating costs | Reduced comfort

Location: Second Floor Attic

Task: Repair Further evaluation

Time: Immediate

Cost: Minor

Cooling & Heat Pump

AIR CONDITIONING \ Compressor

Condition: • [Inoperative](#)

Implication(s): Equipment overheating | Damage to equipment | System inoperative or difficult to operate | Reduced comfort

Location: Rear Exterior

Task: Repair Further evaluation

Time: Immediate

Plumbing

SUPPLY PLUMBING \ Water pressure regulator (Pressure reducing valve)

Condition: • [Missing](#)

Implication(s): Chance of water damage to structure, finishes and contents | Leakage | Damage to equipment

Location: Rear Exterior

Task: Provide

Time: Immediate

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Condition: • Required due to high supply water pressure

Implication(s): Chance of damage to contents, finishes and/or structure | Damage to equipment

Location: Rear Exterior

Task: Provide

Time: Immediate

WATER HEATER \ Life expectancy

Condition: • Past life expectancy

Implication(s): Chance of water damage to structure, finishes and contents | No hot water

Location: First Floor Garage

Task: Replace

Time: Immediate

WATER HEATER \ Temperature/pressure relief (TPR) valve

Condition: • [Discharge tube missing](#)

Implication(s): Scalding

Location: Rear Garage

Task: Provide

Time: Immediate

Cost: Minor

WASTE PLUMBING \ Traps - performance

Condition: • [Leak](#)

Implication(s): Sewage entering the building

Location: First Floor Kitchen

Task: Repair or replace Further evaluation

Time: Immediate

Cost: Minor

FIXTURES AND FAUCETS \ Hose bib or bibb (outdoor faucet)

Condition: • [Leak or drip](#)

Implication(s): Chance of water damage to structure, finishes and contents

Location: Rear Exterior

Task: Replace

Time: Immediate

Cost: Minor

FIXTURES AND FAUCETS \ Bathtub

Condition: • The shower arm is loose in the wall

Location: Second Floor Bathroom

Task: Repair Further evaluation

Time: Immediate

Cost: Minor

FIXTURES AND FAUCETS \ Bathtub enclosure

Condition: • [Leak](#)

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

The shower head is loose and leaks when on

Implication(s): Chance of water damage to structure, finishes and contents

Location: Second Floor Bathroom

Task: Repair or replace Further evaluation

Time: Immediate

Cost: Minor

Condition: • [Caulking loose, missing or deteriorated](#)

Implication(s): Chance of water damage to structure, finishes and contents

Location: Second Floor Bathroom

Task: Improve

Time: Immediate

Cost: Minor

Interior

WALLS \ Plaster or drywall

Condition: • [Loose or missing](#)

Location: Rear Garage

Task: Repair

Time: Immediate

Cost: Minor

WINDOWS \ Storms and screens

Condition: • [Missing](#)

Implication(s): Chance of pests entering building | Increased heating costs | Reduced comfort

Location: Various Kitchen Bedroom

Task: Provide

Time: Immediate

DOORS \ General notes

Condition: • Door rubs

All upstairs bedroom doors need adjustment to prevent carpet contact.

Location: Second Floor Bedroom

Task: Improve

Time: Immediate

Cost: Minor

CARPENTRY \ Cabinets

Condition: • Missing Vanity knobs

Location: Second Floor Bathroom

Task: Improve

Time: Discretionary

Cost: Minor

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

APPLIANCES \ Dishwasher

Condition: • Loose

The dishwasher is not secure

Implication(s): Reduced operability

Location: First Floor Kitchen

Task: Repair

Time: Immediate

Cost: Minor

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

[Home Improvement - ballpark costs](#)

ROOFING

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Limitations

Inspection limited/prevented by: • Lack of access (too high/steep)

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

RECOMMENDATIONS \ General

1. Condition: • Recommend to have a licensed roofing contractor inspect Roof had no access

Location: Throughout

EXTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Description

Gutter & downspout material: • [Galvanized steel](#)

Gutter & downspout type: • [Eave mounted](#)

Gutter & downspout discharge: • [Above grade](#)

Downspout discharge: • [Above grade](#)

Lot slope: • [Away from building](#)

Soffit (underside of eaves) and fascia (front edge of eaves): • [Wood](#)

Wall surfaces and trim: • [Wood](#)

Driveway: • Concrete

Walkway: • Concrete

Garage:

• Attached



1. Attached

Limitations

Exterior inspected from: • Ground level

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

WALLS \ Soffits (underside of eaves) and fascia (front edge of eaves)

2. Condition: • [Rot or insect damage](#)

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Various Front Rear Exterior

Task: Repair or replace Further evaluation

Time: Discretionary


EXTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

- THE BOTTOM
 - ROOFING
 - EXTERIOR**
 - STRUCTURE
 - ELECTRICAL
 - HEATING
 - COOLING
 - INSULATION
 - PLUMBING
 - INTERIOR
- SITE INFO REFERENCE

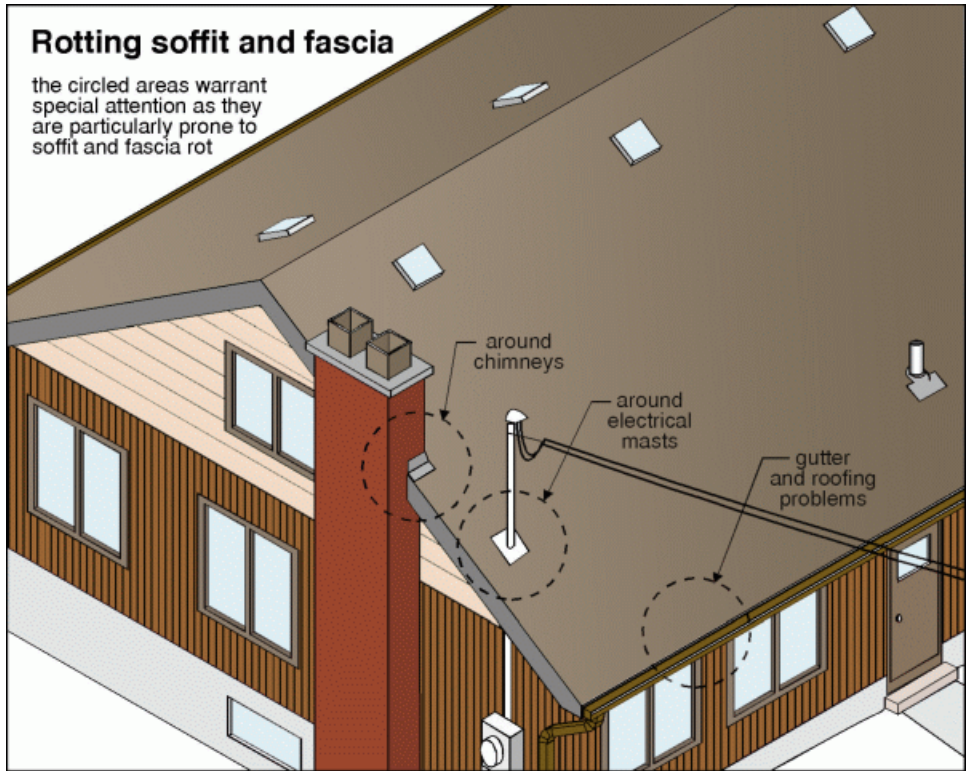

2. Rot or insect damage



3. Rot or insect damage



4. Rot or insect damage

WALLS \ EIFS (Exterior Insulation and Finishing System) and Stucco

3. Condition: • [Crumbling](#)

EXTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE


Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Rear Exterior

Task: Repair

Time: Immediate

Cost: Minor

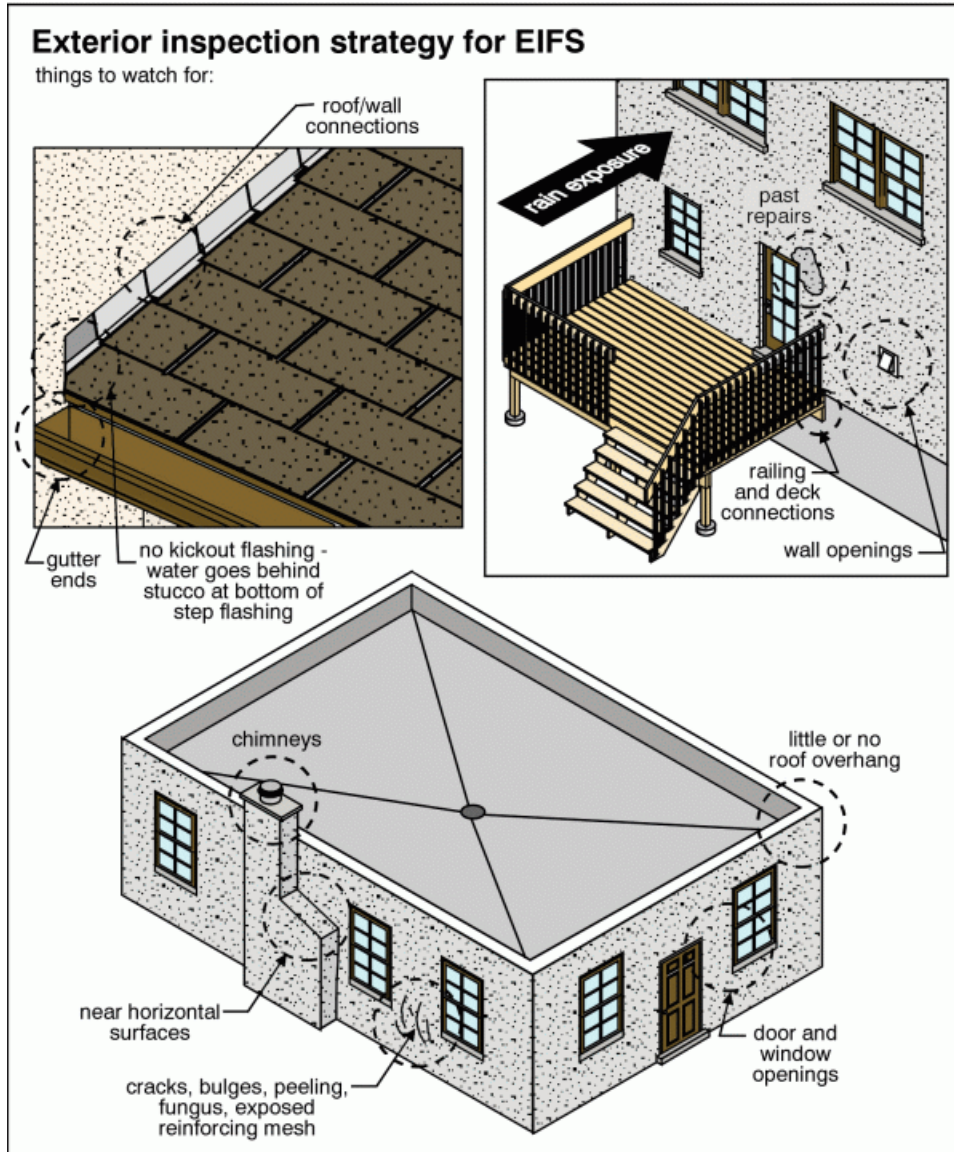

EXTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



5. Crumbling



6. Crumbling

4. Condition: • [Minor cracks](#)

Implication(s): Shortened life expectancy of material

Location: Various Rear Exterior

Task: Repair Monitor




7. Minor cracks



8. Minor cracks



9. Minor cracks

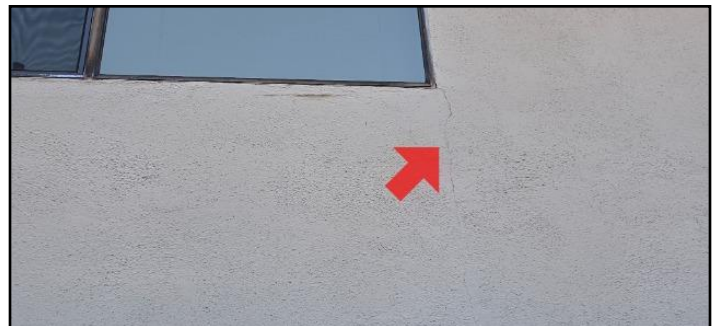

10. Minor cracks

EXTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



11. *Minor cracks*

5. Condition: • Paint or stain - needed

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Rear Exterior

Task: Improve

Time: Discretionary



12. *Paint or stain - needed*

STRUCTURE

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Description

- Configuration:** • [Slab-on-grade](#)
- Foundation material:** • Not visible
- Floor construction:** • Not visible
- Exterior wall construction:** • [Wood frame](#)
- Roof and ceiling framing:** • [Rafters/roof joists](#)

Limitations

- Attic/roof space:** • Inspected from access hatch
- Environmental issues are outside the scope of a home inspection:** • This includes issues such as asbestos.

Recommendations

RECOMMENDATIONS \ Overview

- 6. Condition:** • No structure recommendations are offered as a result of this inspection.
- Location:** Throughout

- THE BOTTOM
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL**
 - HEATING
 - COOLING
 - INSULATION
 - PLUMBING
 - INTERIOR
- SITE INFO
 - REFERENCE

Description

Service entrance cable and location: • [Underground - cable material not visible](#)

Service size:

- [100 Amps \(240 Volts\)](#)



13. 100 Amps (240 Volts)

Main disconnect/service box rating:

- [100 Amps](#)

- THE BOTTOM
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL**
 - HEATING
 - COOLING
 - INSULATION
 - PLUMBING
 - INTERIOR
- SITE INFO
 - REFERENCE



14. 100 Amps

- Main disconnect/service box type and location:** • [Breakers](#)
- System grounding material and type:** • [Not visible](#)
- Auxiliary panel (subpanel) type and location:** • [Not found](#)
- Distribution wire (conductor) material and type:** • [Copper - non-metallic sheathed](#)
- Type and number of outlets (receptacles):** • [Grounded - typical](#)
- Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI):** • [GFCIs present](#)
- Smoke alarms (detectors):** • None noted
- Carbon monoxide (CO) alarms (detectors):** • None noted
- Fire Extinguishers:** • None

Limitations

- Panel covers:** • Not safe to remove • Disconnect covers are not removed by the building inspector
- System ground:** • Continuity not verified • Quality of ground not determined
- Circuit labels:** • The accuracy of the circuit index (labels) was not verified.

Recommendations

SERVICE BOX, GROUNDING AND PANEL \ Distribution panel

7. Condition: • [Openings in panel](#)


Implication(s): Electric shock | Fire hazard

Location: Rear Exterior

Task: Repair Improve

Time: Immediate

Cost: Minor

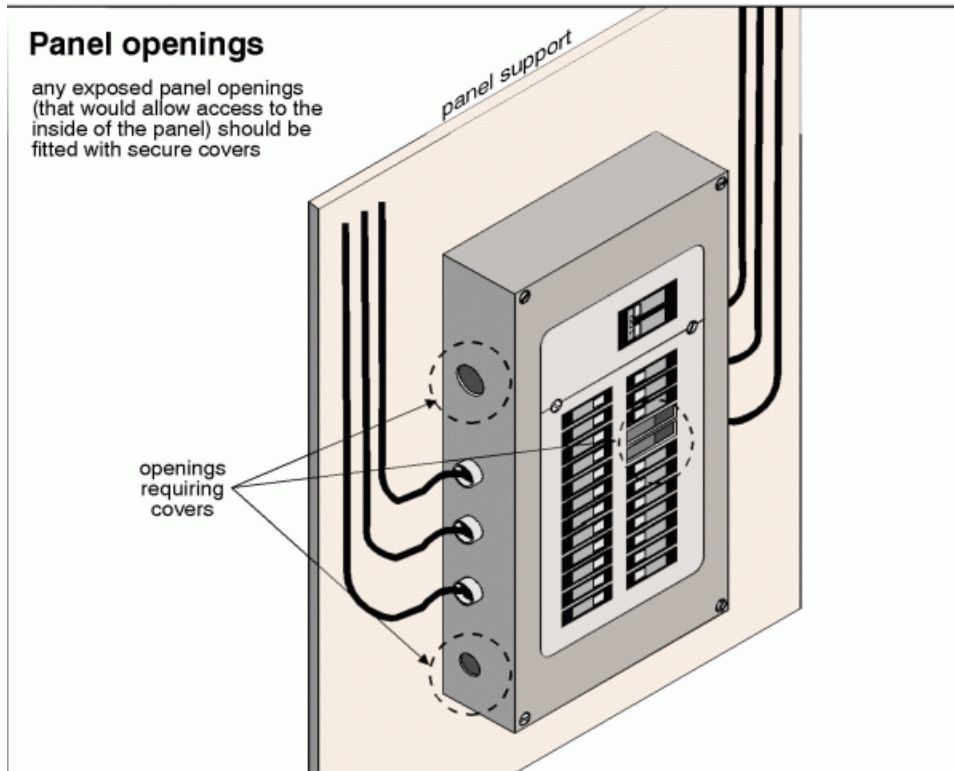



15. Openings in panel

8. Condition: • [Arc Fault Circuit Interrupter \(AFCI\) test faulty](#)


Implication(s): Fire hazard

Location: Kitchen

Task: Repair Further evaluation

Time: Immediate

Cost: Minor

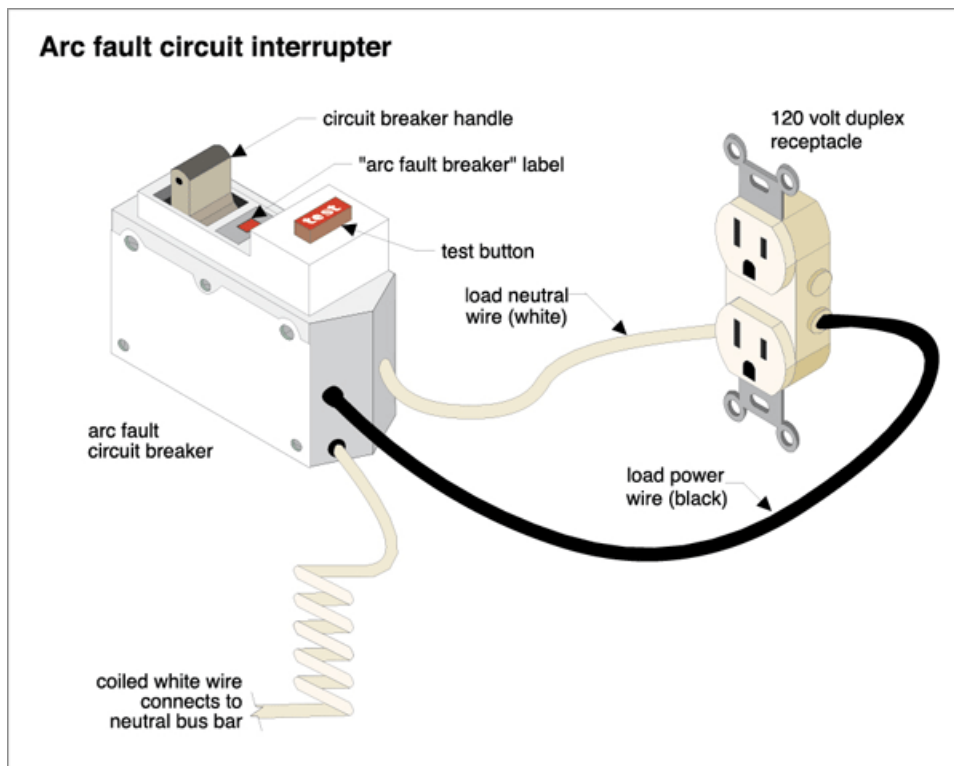

16. Arc Fault Circuit Interrupter (AFCI) test...



17. Arc Fault Circuit Interrupter (AFCI) test...

DISTRIBUTION SYSTEM \ Outlets (receptacles)

9. Condition: • [GFCI/GFI needed \(Ground Fault Circuit Interrupter\)](#)

THE BOTTOM	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	REFERENCE								


Implication(s): Electric shock

Location: Garage

Task: Provide

Time: Immediate

Cost: Minor

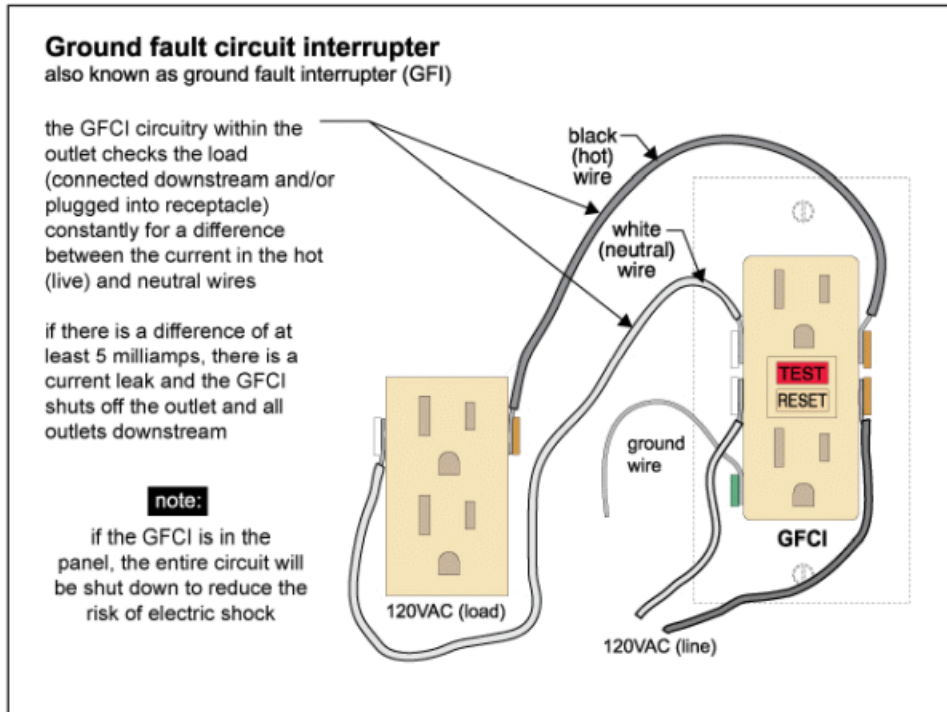

18. GFCI/GFI needed (Ground Fault Circuit...)

HEATING

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Description

Heating system type: • Forced Air Furnace

Fuel/energy source: • [Gas](#)

Furnace manufacturer: • Goodman

Heat distribution: • [Ducts and registers](#)

Approximate capacity: • [85,000 BTU/hr](#)

Efficiency: • [Conventional](#)

Approximate age: • [10 years](#)

Typical life expectancy: • Furnace (conventional or mid-efficiency) 18 to 25 years

Main fuel shut off at: • Meter

Failure probability: • [Medium](#)

Air filter: • Disposable

Fireplace/stove: • None

Limitations

Inspection prevented/limited by: • System was shut off

Safety devices:

- Not tested as part of a building inspection
- Found off and tagged by The Gas Company



19. Not tested as part of a building inspection

HEATING

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Heat exchanger: • Not visible

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

FURNACE \ Life expectancy

10. Condition: • [Inoperative](#)

Found off by The Gas Company

Implication(s): No heat for building

Location: First Floor

Task: Repair Further evaluation Service

Time: Immediate



20. Inoperative

FURNACE \ Ducts, registers and grilles

11. Condition: • [Disconnected ducts](#)

Implication(s): Increased heating costs | Reduced comfort

Location: Second Floor Attic

Task: Repair Further evaluation

Time: Immediate

Cost: Minor


HEATING

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

- THE BOTTOM
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL
 - HEATING**
 - COOLING
 - INSULATION
 - PLUMBING
 - INTERIOR
- SITE INFO REFERENCE

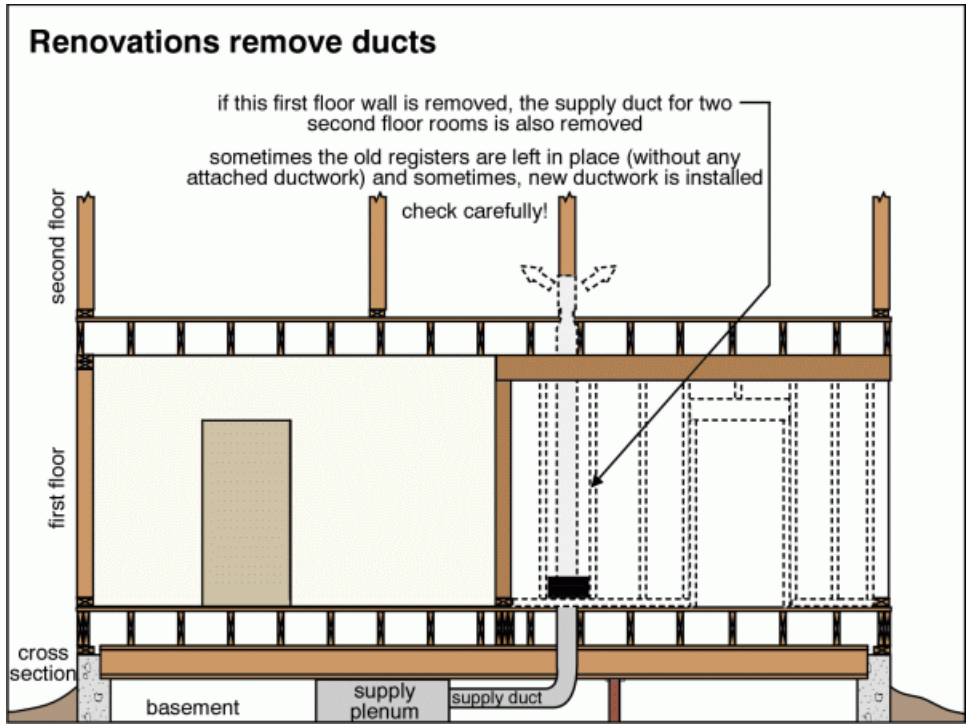

21. Disconnected ducts



22. Disconnected ducts

COOLING & HEAT PUMP

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

- THE BOTTOM
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL
 - HEATING
 - COOLING**
 - INSULATION
 - PLUMBING
 - INTERIOR
- SITE INFO
 - REFERENCE

Description

Air conditioning type: • Central

Cooling capacity: • Not determined

Compressor type:

- Electric



23. Electric

Compressor approximate age: • 10 years

Typical life expectancy: • 12 to 15 years

Failure probability: • [Medium](#)

Temperature difference across cooling coil: • Not determined

Air filter: • Disposable

Location of the thermostat for the cooling system: • Hallway • First Floor

Limitations

Inspection limited/prevented by: • System inoperative

Not part of a home inspection: • Home inspectors cannot typically access or inspect the indoor coil • Home inspectors do not verify that the size of the indoor coil matches the outdoor coil

COOLING & HEAT PUMP

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Recommendations

AIR CONDITIONING \ Compressor

12. Condition: • [Inoperative](#)

Implication(s): Equipment overheating | Damage to equipment | System inoperative or difficult to operate | Reduced comfort

Location: Rear Exterior

Task: Repair Further evaluation

Time: Immediate

INSULATION AND VENTILATION

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

- THE BOTTOM
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL
 - HEATING
 - COOLING
 - INSULATION**
 - PLUMBING
 - INTERIOR
- SITE INFO
 - REFERENCE

Description

Attic/roof insulation material:

- [Glass fiber](#)



24. Glass fiber

Attic/roof insulation amount/value: • Not determined

Attic/roof air/vapor barrier: • Not determined • [Not visible](#)

Attic/roof ventilation: • [Roof and soffit vents](#)

Limitations

Inspection limited/prevented by lack of access to: • Wall space

Attic inspection performed: • From access hatch

Roof space inspection performed: • From access hatch

Air/vapor barrier system: • Continuity not verified

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

ATTIC/ROOF \ Insulation

13. Condition: • [Amount less than current standards](#)

Implication(s): Increased heating and cooling costs

Location: Throughout Attic

Task: Improve

Time: Discretionary

INSULATION AND VENTILATION

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



25. *Amount less than current standards*


Description

Service piping into building: • [Copper](#)

Supply piping in building: • [Copper](#)

Main water shut off valve at the:

- Exterior wall

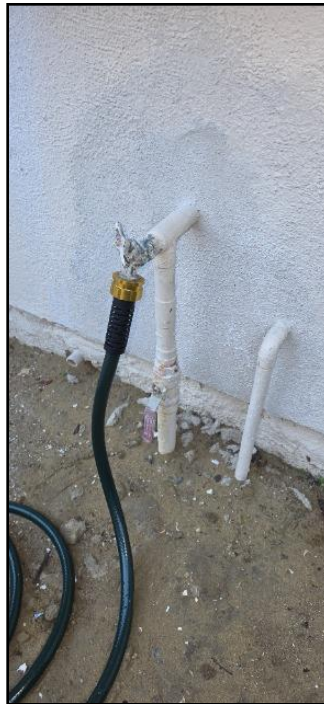

26. Exterior wall

Water flow and pressure: • [Above average](#)

Water heater type:

- Tank



27. Tank

Water heater location: • Garage

Water heater fuel/energy source: • [Gas](#)

Water heater exhaust venting method: • Natural draft

Water heater manufacturer: • State

Water heater tank capacity: • [40 gallons](#)

Water heater approximate age: • 11 years

Water heater typical life expectancy: • 8 to 12 years

Water heater failure probability: • [High](#)

Hot water temperature (Generally accepted safe temp. is 120° F): • 120° F

Hot water circulating system: • None

Waste disposal system: • [Public](#)

Waste and vent piping in building: • [Not visible](#)

Gas meter location:

• Exterior rear

It is recommended to have a Seismic gas shut-off valve installed for future earthquakes

PLUMBING

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



28. Exterior rear

Gas piping material: • Steel

Main gas shut off valve location: • Gas meter

Exterior hose bibb (outdoor faucet): • Present

Limitations

Items excluded from a building inspection: • Water quality • Isolating/relief valves & main shut-off valve • Concealed plumbing • Tub/sink overflows • Water heater relief valves are not tested • The performance of floor drains or clothes washing machine drains • Landscape irrigation system

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

SUPPLY PLUMBING \ Water pressure regulator (Pressure reducing valve)


14. Condition: • [Missing](#)

Implication(s): Chance of water damage to structure, finishes and contents | Leakage | Damage to equipment

Location: Rear Exterior

Task: Provide

Time: Immediate

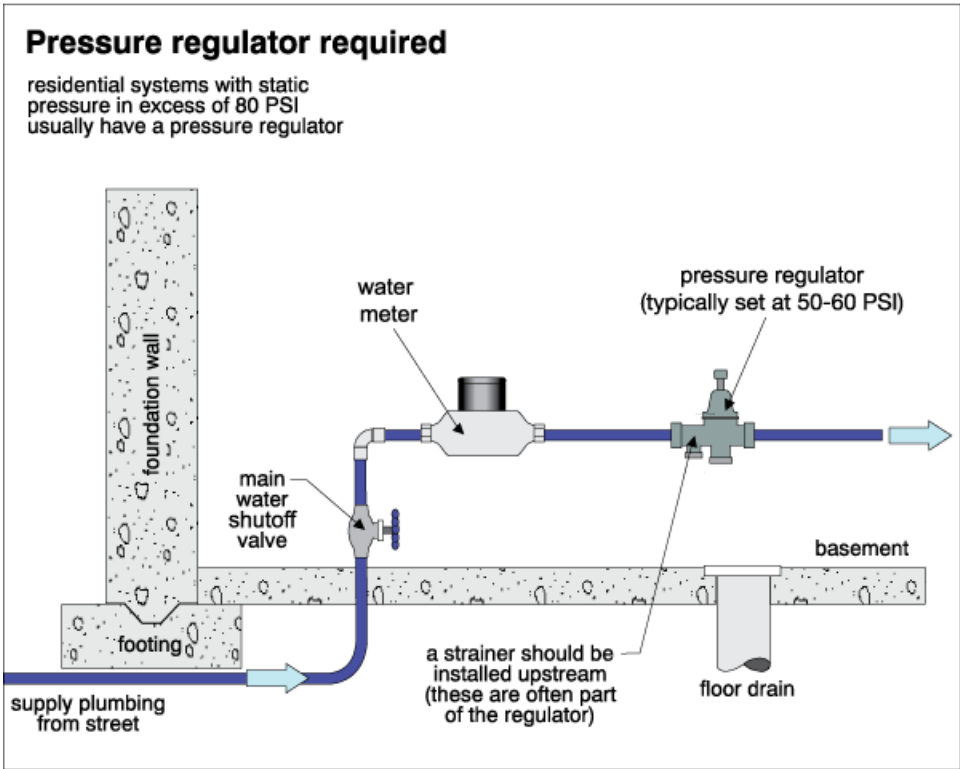

29. Missing

15. **Condition:** • Required due to high supply water pressure

Implication(s): Chance of damage to contents, finishes and/or structure | Damage to equipment

Location: Rear Exterior

Task: Provide

Time: Immediate

WATER HEATER \ Life expectancy

16. Condition: • Past life expectancy

Implication(s): Chance of water damage to structure, finishes and contents | No hot water

Location: First Floor Garage

Task: Replace

Time: Immediate



30. Past life expectancy



31. Past life expectancy

- THE BOTTOM
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING**
- INTERIOR
- SITE INFO
- REFERENCE



32. Past life expectancy

WATER HEATER \ Temperature/pressure relief (TPR) valve

17. Condition: • [Discharge tube missing](#)


Implication(s): Scalding

Location: Rear Garage

Task: Provide

Time: Immediate

Cost: Minor

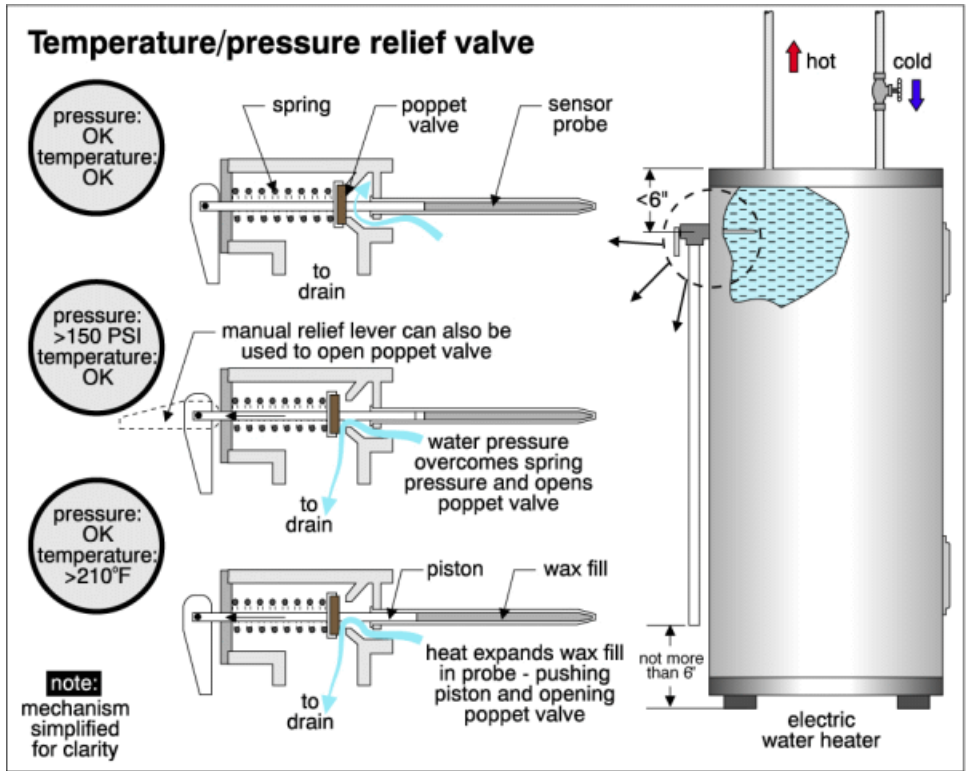

33. Discharge tube missing

WATER HEATER - GAS BURNER AND VENTING \ Gas piping

18. Condition: • [No drip leg \(sediment trap/dirt pocket\)](#)


Implication(s): Equipment failure

Location: Rear Garage

Task: Provide

Time: Discretionary

Cost: Minor

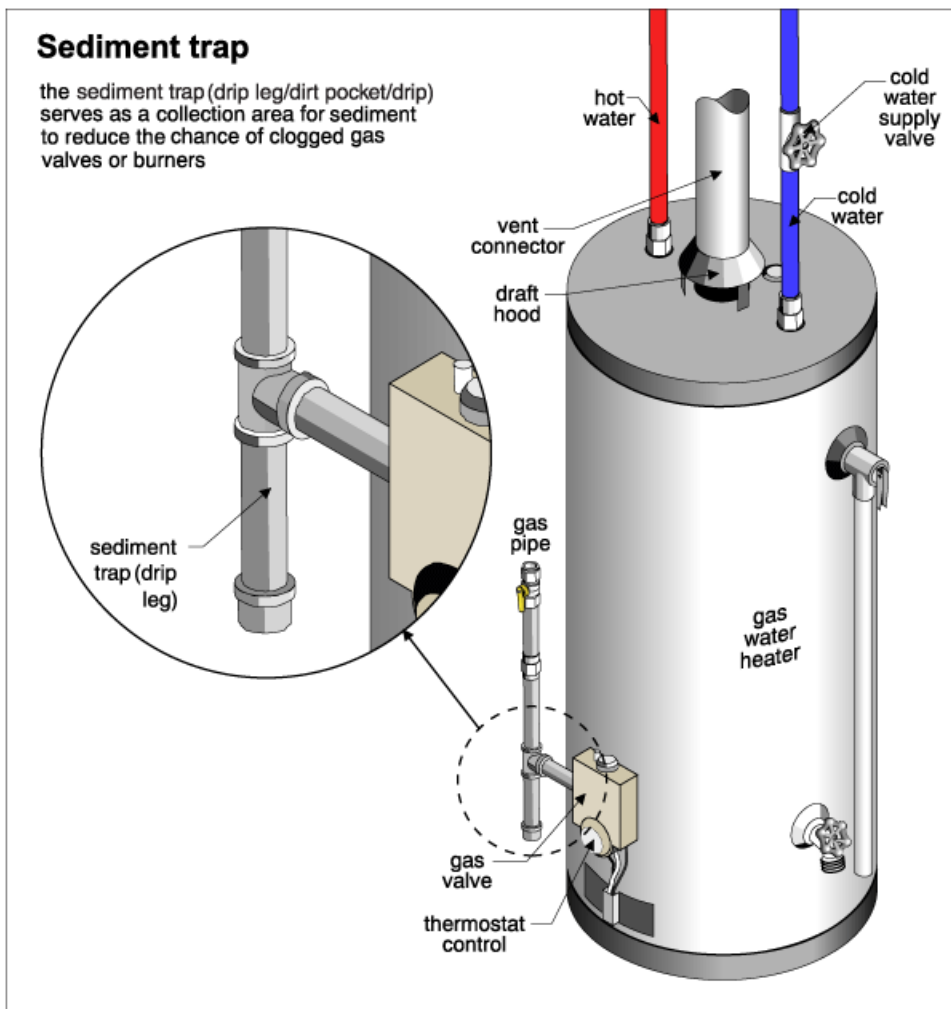

34. No drip leg (sediment trap/dirt pocket)

WASTE PLUMBING \ Traps - performance

19. Condition: • [Leak](#)

Implication(s): Sewage entering the building

Location: First Floor Kitchen

Task: Repair or replace Further evaluation

Time: Immediate

Cost: Minor



35. Leak



36. Leak



37. Leak

FIXTURES AND FAUCETS \ Hose bib or bibb (outdoor faucet)

20. Condition: • [Leak or drip](#)

Implication(s): Chance of water damage to structure, finishes and contents

Location: Rear Exterior

Task: Replace

Time: Immediate

Cost: Minor



38. Leak or drip

FIXTURES AND FAUCETS \ Bathtub


21. Condition: • The shower arm is loose in the wall

Location: Second Floor Bathroom

Task: Repair Further evaluation

Time: Immediate

Cost: Minor

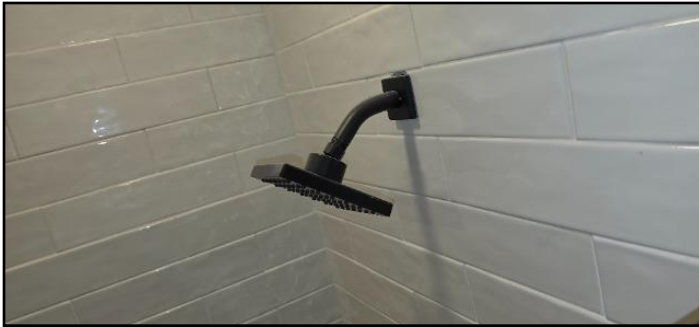

39.



40.

FIXTURES AND FAUCETS \ Bathtub enclosure

22. Condition: • [Leak](#)

The shower head is loose and leaks when on


Implication(s): Chance of water damage to structure, finishes and contents

Location: Second Floor Bathroom

Task: Repair or replace Further evaluation

Time: Immediate

Cost: Minor

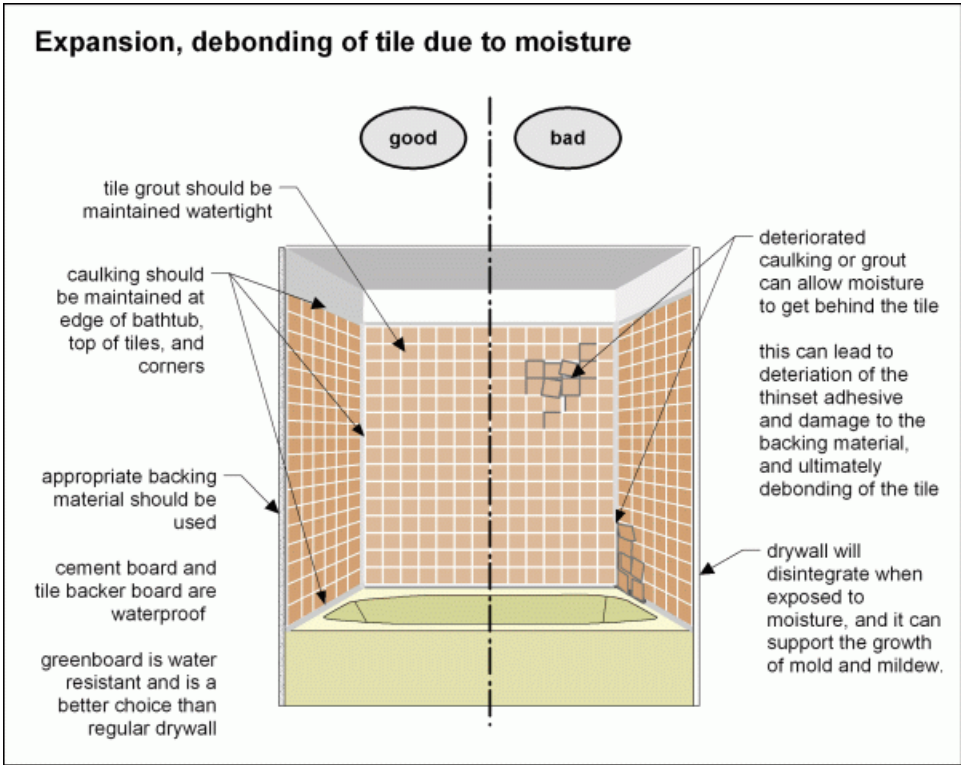

41. Leak



42. Leak

23. Condition: • [Caulking loose, missing or deteriorated](#)



Implication(s): Chance of water damage to structure, finishes and contents

Location: Second Floor Bathroom

Task: Improve

Time: Immediate

Cost: Minor

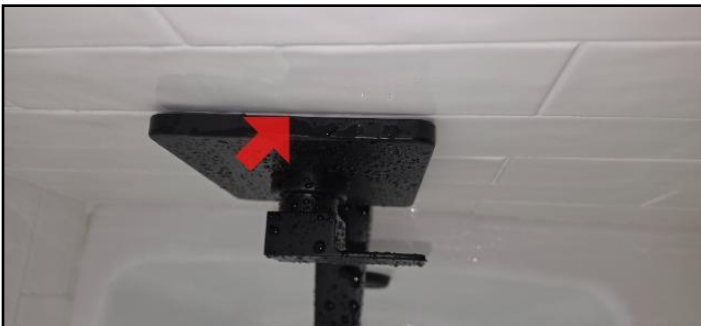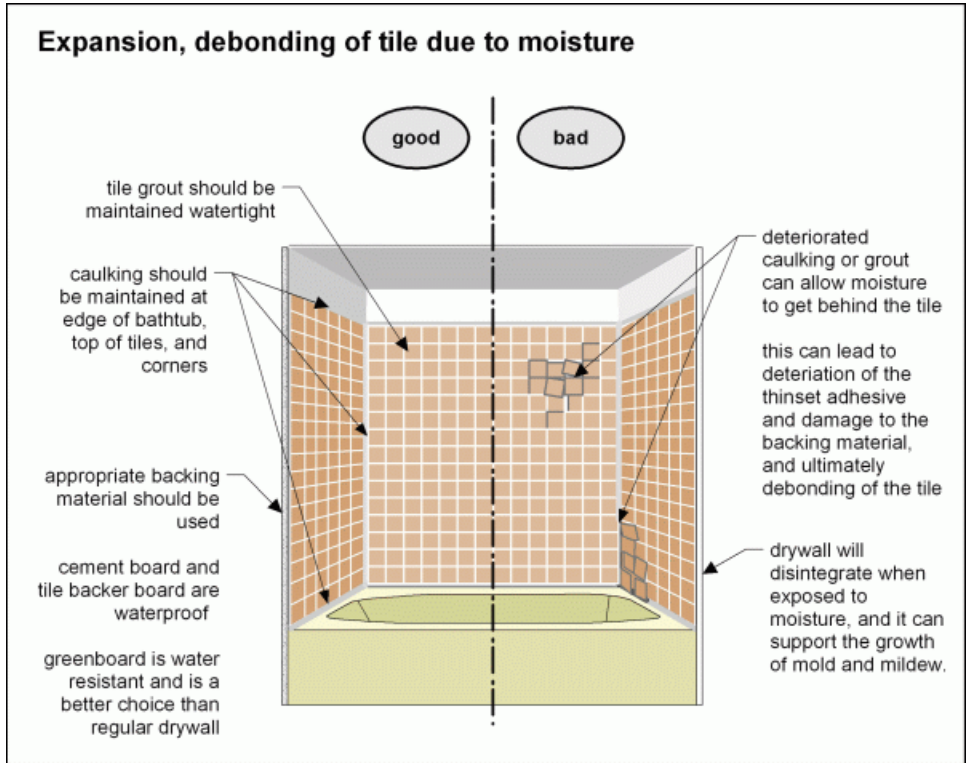

43. Caulking loose, missing or deteriorated



44. Caulking loose, missing or deteriorated

- THE BOTTOM
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- SITE INFO
- REFERENCE

Description

Major wall and ceiling finishes: • [Plaster/drywall](#)

Windows: • Aluminum

Oven fuel: • Electricity

Range fuel: • Electricity

Appliances:

- Range hood



45. Range hood

- Dishwasher



46. Dishwasher

- Waste disposal



47. Waste disposal

- Range



48. Range

Laundry facilities:

- Hot/cold water supply

- THE BOTTOM
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- SITE INFO
- REFERENCE



49. Hot/cold water supply

- 120-Volt outlet
- Gas piping

Kitchen ventilation: • Range hood • Discharges to exterior

Bathroom ventilation: • Exhaust fan

Inventory Furnace: • Goodman

Inventory Water Heater: • State

Limitations

Not included as part of a building inspection: • Security systems and intercoms • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any • Decorative items • Aesthetics or quality of finishes • Vermin, including wood destroying organisms. • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Environmental issues including asbestos • Paint, wallpaper, and other finishes • Floor coverings • Window treatments • Window coatings and seals between panes of glass

Appliances: • Self-cleaning features on ovens not tested • Effectiveness of dishwasher drying cycle not tested • Appliances are not moved during an inspection

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

WALLS \ Plaster or drywall

24. **Condition:** • [Loose or missing](#)

Location: Rear Garage

Task: Repair

Time: Immediate

Cost: Minor



50. Loose or missing

WINDOWS \ Storms and screens

25. Condition: • [Missing](#)

Implication(s): Chance of pests entering building | Increased heating costs | Reduced comfort

Location: Various Kitchen Bedroom

Task: Provide

Time: Immediate

INTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



51. Missing Screens



52. Missing Screens

DOORS \ General notes

26. Condition: • Door rubs

All upstairs bedroom doors need adjustment to prevent carpet contact.

Location: Second Floor Bedroom

Task: Improve

Time: Immediate

Cost: Minor

INTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE



53. Door rubs



54. Door rubs

CARPENTRY \ Cabinets

27. Condition: • Missing Vanity knobs

Location: Second Floor Bathroom

Task: Improve

Time: Discretionary

Cost: Minor



55.



56.

APPLIANCES \ Dishwasher

28. Condition: • Loose

The dishwasher is not secure

Implication(s): Reduced operability

Location: First Floor Kitchen

Task: Repair

INTERIOR

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Time: Immediate

Cost: Minor



57. Loose

SITE INFO

1330 Stonewood Court, San Pedro, CA March 11, 2026

Report No. 1569

www.andreasfaultpro.com

THE BOTTOM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

SITE INFO

REFERENCE

Description

Weather: • Sunny • Clear

Approximate temperature: • 72°

Attendees: • Seller's Agent

Access to home provided by: • Seller's agent

Occupancy: • There was no one home during the inspection. • The home was vacant during the inspection. • The home was unfurnished during the inspection.

Utilities: • All utilities were on during the inspection. • The water service is public. • The plumbing waste disposal system is public.

Approximate inspection Start time: • The inspection started at 8:00 a.m.

Approximate inspection End time: • The inspection ended at 9:30 a.m.

Approximate age of home: • 51 years

Approximate date of construction: • 1975

Approximate size of home: • 1500 ft.²

Building type: • Town home

Number of dwelling units: • Single-family

Number of stories: • Two

Number of bedrooms: • Four

Number of bathrooms: • Three

Garage, carport and outbuildings: • Attached two-car garage

END OF REPORT

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS

