WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building Address:	Date of Inspection	Number of Pages
264 Vanderbilt Dr., Oxnard, CA 93036	11/10/2026	6

TERMITE & PEST CONTROL

1252 Evergreen Ln.
Port Hueneme CA 93041
Phone: 805-336-1624
Email:
david@dmtermiteandpestcontrol.com

Report # W10194

Lic. Registration # PR 7272

Escrow #

Ordered by:	Property Owner and/or Party of Interest:	Report Sent to:
John Hart Real Estate Isaiah Zendejas 264 Vanderbilt Dr. Oxnard, CA 93036	John Hart Real Estate Isaiah Zendejas 264 Vanderbilt Dr. Oxnard, CA 93036	John Hart Real Estate Isaiah Zendejas 264 Vanderbilt Dr. Oxnard, CA 93036

COMPLETE REPORT ☑ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐

General Description:
Single story occupied wood framed raised stucco single family residence with a composition roof and an attached garage


Inspection Tag Posted: Wall

Other Tags Posted:
None

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites ☑ Drywood Termites ☑ Fungus / Dryrot ☑ Other Findings ☑ Further Inspection ☐

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for the details on checked items.

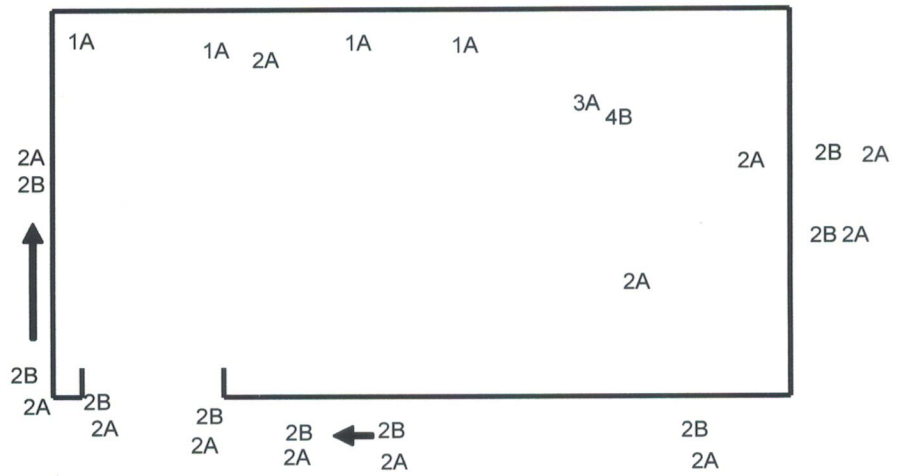

This Diagram is not to scale

Inspected by: David J Marquez **State License No.** FR65620 **Signature** _____

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceeding two years.
To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Ste. 1500, Sacramento, California 95815.
NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with the services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www. pestboard.ca.gov

SECOND PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 264 Vanderbilt Dr., Oxnard, CA 93036 | 11/10/2026 (Date) | W10194 (Report #)

What Is a Wood Destroying Pest and Organism Inspection Report?

The following explains the scope and limitations of a structural pest control inspection and a Wood Destroying Pest & Organism Inspection Report.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of wood destroying insects or organisms in visible and accessible areas on the date of inspection and contains our recommendations for correcting any infestations, infections, or conditions found. The contents of the wood destroying pest & organism inspection report are governed by the structural pest control act and its rules and regulations.

Some structures may not comply with building code requirements or may have structural, plumbing, electrical, heating and air conditioning, or other defects that do not pertain to this report. This report does not address any such defects as they are not within the scope of the license of the inspector or the company issuing this report.

The following areas are considered inaccessible for purposes of inspection or are not included in a normal inspection report and therefore are excluded in this report: the interior of hollow walls; spaces between an upstairs floor and the ceiling below or a porch deck and soffit below; stall showers over finished ceilings; such structural segments as areas enclosed by bay windows, buttresses, built-in cabinet work, areas under floor covering; any areas requiring the removal of storage, furnishings or appliances; and any areas to which there is no access without defacing or removing lumber, masonry or finished workmanship.

Certain areas are recognized by the industry as inaccessible and/or for other reasons not inspected. These areas include, but are not limited to: inaccessible and/or insulated attics or portions thereof, attics with less than an 18" clear crawl space, the interior of hollow walls, spaces between a floor or porch deck and the ceiling below, areas where there is no access without defacing or tearing out lumber, masonry or finished work that make inspection impractical, and areas or timbers around eaves that would require use of an extension ladder. Eaves, timber or any lumber 10' above ground level will not be proved but are only visually inspected by inspector. Infestations or damage may exist in these areas without our knowledge and DM Termite and Pest Control will not be liable for any area(s) found above 10'.

Certain areas may be inaccessible for inspection due to construction or storage. We recommend further inspection of areas where inspection was impractical. Re: Structural Pest Control Act, Business and Professions Code Article 1, 8516(b)(9). Stall shower, if any, is water tested in compliance with Title 16 Professional and Vocational Regulations Article 5, §1991.1(12) of the Structural Pest Control Act. The absence or presence of leaks through sub-floor, adjacent floors or walls will be reported. This is a report of the condition of the stall shower at the time of inspection only, and should not be confused as a guarantee. Although we make a visual examination, we do not deface or probe into window or door frames, decorative trim, roof members, etc., in search of wood destroying pests or organisms.

"This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs." DM Termite and Pest Control will not be liable for repairs done by another license contractor.

NOTE: We do not inspect or certify plumbing, plumbing fixtures, etc.

NOTE: "The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors' State License Board."

"NOTICE: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept DM Termite and Pest Contro's bid or you may contract directly with another registered company licensed to perform the work. Fumigations are warrantied for a period of three years unless specified in the recommendation.
If you choose to contract directly with another registered company, DM Termite and Pest Contro will not in any way be responsible for any act or omission in the performance of work that you directly contract with another to perform."

"NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company."

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold-like conditions, please contact the appropriate mold professional.

"Local treatment is not intended to be an entire structure treatment method. If infestations of wood-destroying pests extend or exist beyond the area(s) of local treatment, they may not be exterminated."

Any time during repairs if any damage is found beyond immediate area(s), a supplemental report will be issued outlining finding, recommendations and costs. DM Termite and Pest Control does not guarantee and exact match of color, style and thickness of materials installed due to market availability. DM Termite and Pest Control will do the best to match such materials as close as possible.

THIRD PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 264 Vanderbilt Dr., Oxnard, CA 93036 — Date: 11/10/2026 — Report #: W10194

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

FINDINGS AND RECOMMENDATIONS

Subterranean:

1A PRICE: $984.00 (Section I)
FINDINGS: Cellulose debris with evidence of subterranean termites was noted at subarea as indicated on diagram.
RECOMMENDATION: Remove Cellulose debris of a size which can be raked from sub area. Drill, pressure rod and/or treat the subarea adjacent to the cellulose debris with a register termiticide for the control of Subterranean Termites. Low pressure spot spray as necessary. Scrape and break down all accessible Subterranean tubing. Two year warranty.

Drywood:

2A PRICE: $2,082.00 (Section I)
FINDINGS: Evidence of Drywood Termite infestation at subarea, garage door jamb, bedroom, wall trim, window trim, fascia as indicated on the diagram.
RECOMMENDATION: Vacate the premises and seal the structure for fumigation with Vikane Gas (Chloropicrin used as a warning agent with Vikane gas fumigant) for the control of Drywood Termites. Remove or cover accessible evidence of infestation. Fumigation warranteed for 3 years. DM Termite and Pest Control will NOT be liable for damage to: plants, paint, roofs, antennae etc. Fumigation awareness notice must be signed prior to fumigation. See fumigation notice for terms and liabilities.

2B PRICE: $4,110.00 (Section I)
FINDINGS: Evidence of termite damaged wood members noted at time of inspection at window trim, fascia, wall trim, garage door jamb as indicated on the diagram.
RECOMMENDATION: Remove and replace or sister wood members as necessary. Repair remaining damage with epoxy filler and primer as necessary. Ready for paint. No painting is included in this estimate.

Fungus / Dryrot:

3A PRICE: See 2B (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at garage door jambs, window trims and fascia as indicated on the diagram.
RECOMMENDATION: Remove and replace and/or repair dry-rot damaged wood members as necessary. Scrape and treat fungus as needed. Primer wood as needed. No painting is included in this estimate.

3B PRICE: See 2B (Section I)
FINDINGS: Dry-rot wood members found at time of inspection at subarea subfloor and floor joists as indicated on the diagram.
RECOMMENDATION: Remove and replace and/or repair dry-rot damaged or sister wood members as necessary. Scrape and treat fungus as needed. Primer wood as needed. No painting is included in this estimate.

- Findings and Recommendations continued on next page -

FOURTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 264 Vanderbilt Dr., Oxnard, CA 93036 | 11/10/2026 (Date) | W10194 (Report #)

- Findings and Recommendations continued from previous page -

Other Findings:

4B PRICE: Unknown (Section II)
FINDINGS: Water stains noted subfloor and floor joists in the subarea at time of inspection as indicated on diagram. No active dripping or visible wetness was observed at the time of inspection. Recommend evaluation by an appropriate licensed contractor and corrcetion as necessary.
RECOMMENDATION: Owner/Agent to contact proper tradesman/contractor to inspect for cause of water stains and correct as needed as indicated on the diagram..

In accordance with the laws and regulations of the State of California, we are required to provide you with the following information prior to application of pesticides to your property.

"State law requires that you be given the following information: CAUTION--PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized."

"If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately."

For further information, contact any of the following:

DM Termite and Pest Control	(805) 336-1624
Poison Control Center	(800) 222-1222
(Health Questions) County Health Dept.	
Ventura County	(805) 654-2813
Los Angeles County	(213) 240-8117
Santa Barbara County	(805) 691-4900
(Application Info.) County Agriculture Commission	
Ventura County	(805) 388-4222
Los Angeles County	(626) 575-5471
Santa Barbara County	(805) 681-5600

Structural Pest Control Board (Regulatory Info.) (916) 561-8704
2005 Evergreen Street, Ste. 1500 Sacramento, CA 95815

FIFTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 264 Vanderbilt Dr., Oxnard, CA 93036 | 11/10/2026 (Date) | W10194 (Report #)

TERMITE AND FUNGUS CONTROL CHEMICALS

Taurus SC (EPA Reg. No. 53883-279)
Active Ingredients: Fipronil: 5-amino-l -(2,6-dichloro-4-(trifluoromethyl) phenyl)-4-((1, R,S)-(trifluoromethyl)sulfinyl) -1-H-pyrazole-3-carbonitrile)

Termidor Foam (EPA Reg. No. 499-563)
Active Ingredients: Fipronil: 5-amino-l -(2,6-dichloro-4-(trifluoromethyl) phenyl)-4-((1, R,S)-(trifluoromethyl)sulfinyl) -1-H-pyrazole-3-carbonitrile .005%

Termidor SC (EPA Reg. No. 7969-210-AA)
Active Ingredients: Fipronil: 5-amino-l -(2,6-dichloro-4-(trifluoromethyl) phenyl)-4-((1, R,S)-(trifluoromethyl)sulfinyl) -1-H-pyrazole-3-carbonitrile 9.1%

Chloropicrin (EPA Reg. No. 00000)
Active Ingredients: Chloropicrin 96%

Vikane (EPA Reg. No. 62719-4)
Active Ingredients: Sulfuryl flouride 99.8%

Tim-bor (EPA Reg. No. 64405-8-ZC)
Active Ingredients: Disodium Octaborate Tetrahydrate 98%

NOTICE TO OWNER
Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.
To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

NOTE: If the Home Owner fails to pay billing in full, DM Termite and Pest Contro will have the right to be paid back for all of its costs and expenses to the extent not prohibited by applicable law. Those expenses include, for example (but not limited to), reasonable attorney's fees. If for any reason this account is to be turned over to our collection agency, you will be responsible for all costs of collecting.

SIXTH PAGE OF STANDARD INSPECTION REPORT OF THE PROPERTY LOCATED AT:

Address 264 Vanderbilt Dr., Oxnard, CA 93036 11/10/2026 W10194
Date Report #

Findings and Recommendations estimated by this Company:

Item	Approval	Primary Estimate	Section
1A	☐	$984.00	I
2A	☐	$2,082.00	I
2B	☐	$4,110.00	I
3A	☐	Included in 2B	I
3B	☐	Included in 2B	I

☐ **Complete all of the items quoted above with Primary Estimate.** **Total Estimate** **$7,176.00**

☐ Complete only the above Items checked.
Total $_____

Findings and Recommendations NOT estimated by this Company:

Owner or Authorized Representative shall contract others for completion of these items.

Items: 4B

I have read and understand the terms of the Report referenced above and agree to the terms and conditions set forth. DM Termite and Pest Control is hereby authorized to complete the Items selected above and it is agreed that payment shall be made as follows:

Payment shall be made as follows: ☐ *With close of Escrow* ☐ *$_____Deposit* ☐ *$_____on Completion*

Escrow Number:_____ Escrow Company:_____ Escrow Officer: _____

Phone ( ) _____ - _____ Email: _____ Address: _____

Owner or Authorized Representative: ☐ Owner ☐ Representative's Title:_____

Print Name:_____ X_____ Date_____

Owner or Authorized Representative: ☐ Owner ☐ Representative's Title:_____

Print Name:_____ X_____ Date_____

DM TERMITE & PEST CONTROL

1252 Evergreen Ln.
Port Hueneme CA 93041
Phone: 805-336-1624
Email:
david@dmtermiteandpestcontrol.com

INVOICE

22281

PAGE
1 of 1

JOB NUMBER
W10194

Bill To: Attn: Isaiah Zendejas
John Hart Real Estate
264 Vanderbilt Dr.
Oxnard, CA 93036

Remit To: DM Termite and Pest Control
1252 Evergreen Ln.
Port Hueneme, CA 93041

REFERENCE NO.	SERVICE ADDRESS
	264 Vanderbilt Dr. Oxnard, CA 93036

ITEM	DATE	QTY	DESCRIPTION	AMOUNT	TAX AMT	TOTAL
1	11/10/2026		Termite Inspection Fee.	$95.00		$95.00

PLEASE INCLUDE THE INVOICE NUMBER IN ALL CORRESPONDENCE

Balances that remain unpaid for 30 days may be subject to 1 1/2 % per month interest and/or lien fees.

GRAND TOTAL
$95.00