

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	1 of 6

	Western Termite Solutions, INC. 2860-A Olive Hwy Oroville, CA 95966 Tel 530-712-9161 Fax Registration #: PR8939	A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER. Report #: 50831
-----------------------------------------------------------------------------------	--------------------------------------------------------------------------------------------------------------------------------------------------	----------------------------------------------------------------------------------------------------------------------------------------------------------------

Ordered by: Scott Peebles 1967 and 1969 D St Oroville, CA 95966-6603	Property Owner and Party of Interest:	Report sent to: Scott Peebles
-------------------------------------------------------------------------------	---------------------------------------	----------------------------------


COMPLETE REPORT
 LIMITED REPORT
 SUPPLEMENTAL REPORT
 REINSPECTION REPORT

General Description: Multi family dwellings, comp roof, wood siding, raised foundation, vacant.	Inspection Tag Posted: Kitchen sink
Other Tags Posted:	

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites
 Drywood Termites
 Fungus/Dryrot
 Other Findings
 Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

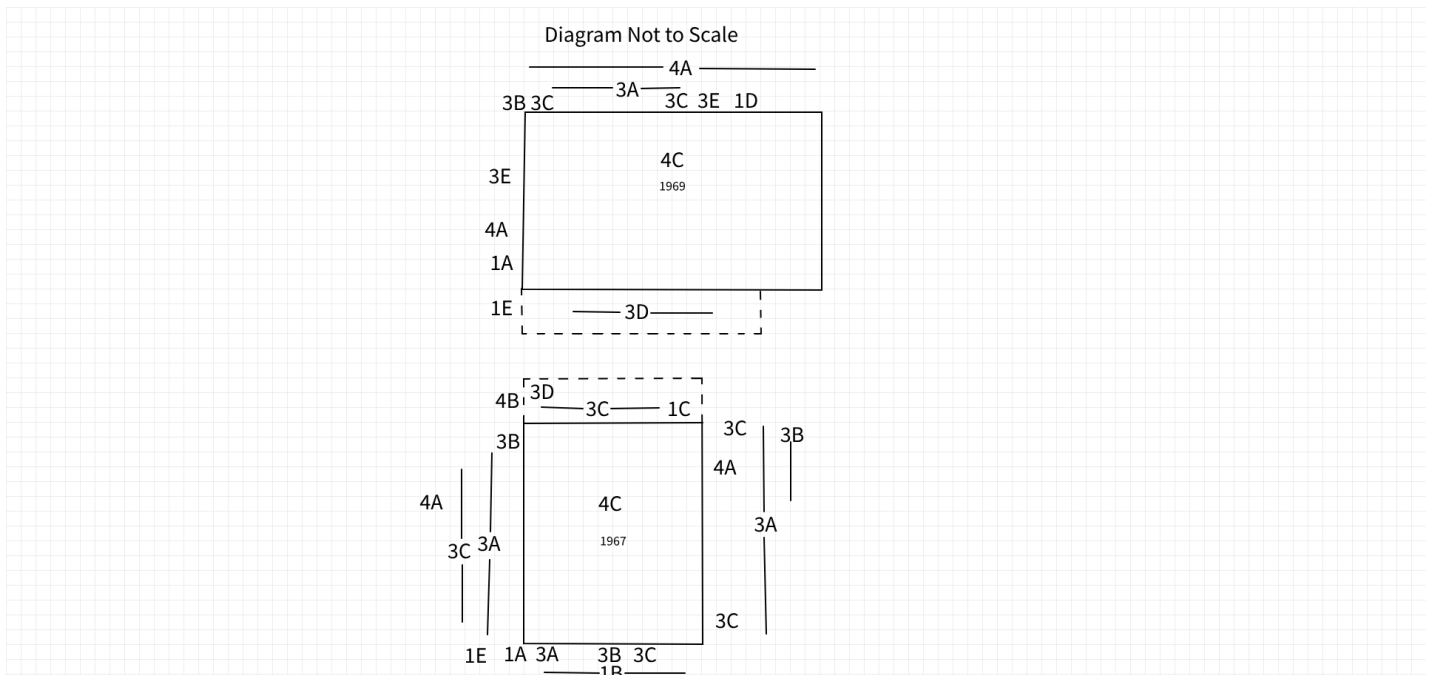

Inspected By: Emmitt Bruno
 State License No.: FR53395
 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	2 of 6

General Comments

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted only, upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	3 of 6

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

Description of Findings

SECTION: I

SUBTERRANEAN TERMITES

- Finding: 1A Subterranean termite damage noted at the water table.
Recommendation: Repair the subterranean termite damaged wood member(s) noted in the above finding.
Price: Bid upon request.
- Finding: 1B Subterranean termite damage noted at the skirting and rim joist.
Recommendation: Repair the subterranean termite damaged wood member(s) noted in the above finding.
Price: Bid upon request.
- Finding: 1C Subterranean termite damage noted at the rafter tail and stud.
Recommendation: Repair the subterranean termite damaged wood member(s) noted in the above finding.
Price: Bid upon request.
- Finding: 1D Subterranean termite damage noted at the window casing.
Recommendation: Repair the subterranean termite damaged wood member(s) noted in the above finding.
Price: Bid upon request.
- Finding: 1E Evidence of subterranean termites at multiple locations around both structures.
Recommendation: Chemically treat soil around the entire structures for control of subterranean termites. This may include rodding/trenching soil around exterior foundation; treating voids in foundation walls; drilling attached slabs, brick, stone veneer that extends below grade level; drilling expansion joints or cold joints in slabs; treating drain penetrations. Remove termite shelter tubes (if present) from accessible areas. 1 year warranty against re-infestation.
- Note: Western Termite Solutions, Inc. assumes no responsibility for damage to any hidden pipes, wiring or other facilities embedded/hidden in the concrete slabs.
Price: \$1,975.00

FUNGUS/DRYROT

- Finding: 3A Fungus damage at the siding and/or trim.
Recommendation: Remove fungus damaged wood member(s) and replace with new material. If after damaged materials are removed and new findings are discovered, a supplemental report will be reflecting new findings.
Price: Bid upon request.
- Finding: 3B Fungus damage at the barge rafter and drip edge.
Recommendation: Owner/agent should engage the services of a licensed roof contractor to make any necessary repairs to the roof or the roof coating system. Remove fungus damaged wood member(s) and replace with new material.
Price: Roofer
- Finding: 3C Fungus damage at the roof sheathing and/or fascia.
Recommendation: Owner/agent should engage the services of a licensed roof contractor to make any necessary repairs to the roof or the roof coating system. Remove fungus damaged wood member(s) and replace with new material.
Price: Roofer

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	4 of 6

Finding: 3D Fungus damage at the awning in multiple locations.
Recommendation: Owner/agent should engage the services of a licensed roof contractor to make any necessary repairs to the roof or the roof coating system. Remove fungus damaged wood member(s) and replace with new material.

Price: Roofer

Finding: 3E Fungus damage at the window casing.
Recommendation: Remove fungus damaged wood member(s) and replace with new material. If after damaged materials are removed and new findings are discovered, a supplemental report will be reflecting new findings.

Price: Bid upon request.

SECTION: II OTHER FINDINGS

- NOTE: 1. Stored items.
2. Interior of 1969 inaccessible due to unsanitary conditions.
3. Portions of the exterior inaccessible due to shed built too close to structure.

Finding: 4A Earth wood contact(s) noted at the skirting.
Recommendation: Re-grade the soil level to break the earth wood contact.
Price: Others

Finding: 4B Earth wood contact(s) noted at the covered awning.
Recommendation: Re-grade the soil level to break the earth wood contact.
Price: Others

Finding: 4C Sub areas on both structures inaccessible due to no access.
Recommendation: Install access to allow for further inspection. No opinion is given as to the presence or absence of wood destroying organisms in inaccessible areas.
Price: No price given.

Section I Total: \$1,975.00
Section II Total: \$0.00

Grand Total: \$1,975.00

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	5 of 6

Disclaimer

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report. Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

Local treatment is not intended to be an entire structure treatment method. If infestations or wood destroying pests exist or extend beyond the areas of local treatment, they may not be exterminated.

For further information, contact any of the following agencies in your area: see next page

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1967	D St	Oroville	95966-6603	02/05/2026	6 of 6

NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, etc.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE A RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY. NOTICE: THE CHARGE FOR SERVICE THAT THIS COMPANY SUBCONTRACTS TO ANOTHER REGISTERED COMPANY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH PAYING THE SUBCONTRACTOR. YOU MAY ACCEPT WESTERN TERMITE SOLUTIONS, INC.'S BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, WESTERN TERMITE SOLUTIONS, INC. WILL NOT BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM.

Pesticides are the products Western Termite Solutions, INC. uses to control the target pests listed in your agreement. Pesticides make a better life for all by helping control disease carriers and wood destroying insects, thus protecting our health and property. When properly used, pesticides pose no problems to humans or the environment. Your Technician is a State certified applicator whose knowledge is constantly being upgraded through regularly scheduled training sessions. If you have any questions, please call us at: 530-712-9161 or write to: Western Termite Solutions, INC., 2860-A Olive Hwy, Oroville, CA 95966.

STATE LAW REQUIRES THAT YOU BE GIVEN THE FOLLOWING INFORMATION: PESTICIDE NOTICE (SECTION 8538)

CAUTION: PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following an application you experience symptoms similar to common seasonal illness, comparable to the flu, eye, skin, or lung irritation, or difficulty with blood clotting, contact Western Termite Solutions, INC., your physician, and/or your Poison Control Center. For the Poison Control Center, contact the following: (1-800-876-4766).

FOR FURTHER INFORMATION: Contact any of the following: Your pest control company is Western Termite Solutions, INC.; for Regulatory Information call the Structural Pest Control Board (916-561-8700), or write 2005 Evergreen Street, Suite 1500, Sacramento, CA, 95815-3831. For answers to your health questions, call the County Health Department (see list below) and for application information, contact the County Agriculture Commissioner (see list below):

County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.	County	Health Dept.	Ag. Comm.
Butte:	(530) 538-7581	(930) 552-4100	Plumas:	(530) 283-6337	(530) 283-6365	Sutter:	(530) 822-7215	(530) 822-7500
Colusa:	(530) 458-0250	(530) 458-0580	Sacramento:	(916) 875-5881	(916) 875-6603	Tehama:	(530) 527-6824	(530) 527-4231
Glenn:	(530) 865-1165	(530) 934-6501	San Joaquin:	(209) 468-3411	(209) 953-6000	Yolo:	(530) 666-8646	(530) 666-8140
Nevada:	(530) 265-1450	(530) 470-2690	Sierra:	(530) 283-6337	(530) 283-6365	Yuba:	(530) 749-6311	(530) 749-5400

PESTICIDES: 24-3-8 w/Dimension(Dithiopyr),565 Plus XLO(Pyrethrins, PBO, MGK-264),ACE-Jet(Acephate), Advance 375A Select(Abamectin B1), Advance Granular Carpenter Ant Bait(Abamectin B1), Advion Ant Bait Arena(Indoxacarb),Advion Ant Gel(Indoxacarb),Advion Cockroach Bait Arena(Indoxacarb),Advion Cockroach Gel Bait(Indoxacarb), Advion Insect Granular Bait(Indoxacarb),Advion Micro Flow(Indoxacarb), Advion WDG(Indoxacarb),AGRI-FOS(Mono-and di-potassium salts of Phosphorous Acid), Allure MD(Z-9, E-12-Tetradecadien-1-yl acetate), Alpine Dust(Dinotefuran & Diatomaceous Earth), Alpine Flea with IGR(Dinotefuran, Pyriproxyfen, Prallethrin), Alpine P(Dinotefuran), Alpine Pressurized Fly Bait(Dinotefuran), Alpine WSG(Dinotefuran), Altosid Briquets(S-Methoprene), Altriset(Chlorantriliprole), Aprehend(Beauveria bassiana),Arbor-OTC(Oxytetracycline Hydrochloride), Archer(Pyriproxyfen), Arena 0.25G(Clothianidin), Avert DF(Abamectin), Avian Control Repellent(Methyl Anthranilate), Avitrol Whole Corn(4-Aminopyridine),AzaSol(Azadirachtin),Bactimos PT(Bacillus thuringiensis), balEnce(Beauveria bassiana Strain HF23),Bandit(Imidacloprid),Banner Maxx II(Propiconazole), BioampAA(),Bo ra-Care(Disodium Octaborate Tetrahydrate),Capstone(Aminopyralid, Triclopyr), Card-O-Vap 8(Dichlorvos, DDVP),CB-80(Pyrethrins, Piperonyl Butoxide),Chase Granular Mole Gopher Repellent(Castor Oil USP, Sodium Lauryl Sulfate), Chloropirrin(Chloropirrin),Cidetrak IMM(9Z,12E)-9,12-tetradecadien-1-yl acetate), Cidetrak IMM MEC((9Z,12E)-9,12-tetradecadien-1-yl acetate),CimeXa(Amorphous Silica Gel),Conserve SC(Spinosad), Conrac All Weather Blox(Bromadiolone), ContraPest(4-Vinylcyclohexene diepoxide, Triptolide), Crossfire(Clothianidin, Metolfluthrin, PBO), CrossFire Aerosol(Clothianidin, Metolfluthrin, Piperonyl Butoxide),Cy-Kick C & C Pressurized Residual(Cyfluthrin), CyKick CS(Cyfluthrin),DeltaGard(Deltamethrin),Deltagard G(Deltamethrin), Demand CS(Lambda-Cyhalothrin),Detex Blox(N/A),Diacon IGR(Methoprene),Dimension Ultra 40 WP(Dithiopyr), Dismiss CS(Sulfentazone),Ditrac All Weather Blox (Diphacinone),Ditrac Ground Squirrel Bait(Diphacinone), Dioxem Precise(Indoxacarb),Dragnet SFR(Permethrin),Drain Gel(Bacteria (Bacillus Spores)), Drione(Pyrethrins, Piperonyl Butoxide Technical, Amorphous Silica Gel),Drive XLR8(dimethylamine salt of quinclorac), Espanade 200 SC(Indaziflam), Espanade EZ(Indaziflam, Diquat Dibromide, Glyphosate, Isopropylamine Salt), Essentria G(Eugenol, Thyme Oil),Essentria IC Pro(Sodium Lauryl Sulfate, Geraniol, Clove Oil, Cornmint Oil), Essentria IC3(Rosemary Oil, Geraniol, Peppermint Oil),Essentria Wasp & Hornet(Peppermint oil, Sodium lauryl sulfate),Evergreen(Pyrethrins),ExciteR(Pyrethrins, Piperonyl Butoxide),Fastrac All Weather Blox(Bromethalin), Fastrac Soft Bait(Bromethalin),Fendona CS(alpha-Cypermethrin), Fendona CS II(alpha-Cypermethrin), FirstStrike(difethialone), Flatline(Chlorophacinone),Foam Fighter(Dimethyl silicone fluid emulsion),Fuse(Fipronil, Imidacloprid),Fusilade II(Fluazifop-P butyl),Gallery 75 DF(Isoxaben), Garlon 4 Ultra(Triclopyr),Gentrol Aerosol(Hydroprene),Gentrol IGR Concentrate(Hydroprene), Gentrol Point Source(Hydroprene),Headway G(Azoxystrobin),Heritage(Azoxystrobin),IGI Carbon Dioxide(Carbon Dioxide),JMA-Jet(Imidacloprid),Impel Rods (Anhydrous Disodium Octaborate),In2Mix(Pyriproxyfen, Beauveria bassiana strain GHA),In Vaide bio foam(foaming agents, citrus oil and waste-digesting bacillus bacteria), InVite liquid lure(Food grade materials),Kaput Ground Squirrel(Diphacinone, Imidacloprid),Kaput- D(Diphacinone),Kaput-D Ground Squirrel(Diphacinone, Imidacloprid),Lesco Hort Oil(Mineral Oil), Lesco Three-Way(MCPA, Triclopyr, Dicamba),Lifeline(Glufosinate-ammonium),Liqua-Tox II(Sodium Salt of Diphacinone),Magnify(Ammonium Salts, Alkyl polyglucoside + Dimethylpolysiloxane), Maintain CF 125(Methyl Ester Chlorefluoreneol, Flurecol-Methyl, Methyl-2,7-dichloro-9-hydroxyfluorene-9- carboxylate), Maxforce FC Roach Bait Stations(Fipronil),Maxforce FC Ant Stations(Fipronil),Maxforce FC Select(Fipronil),Maxforce Fleet Ant Gel(Fipronil),Maxforce Fly Spot Bait(Imidacloprid),Maxforce Granular Fly Bait (Imidacloprid),Maxforce Impact(Clothianidin),MaxForce Quantum(Imidacloprid),Merit 75 WSP(Imidacloprid),Microcare 3% CS(Pyrethrins, Piperonyl Butoxide, Technical),Milestone Speciality(aminopyralid),Mole Scram(Castor Oil, Citronella Oil, Garlic Oil),Mother Earth Scatter Bait(Boric Acid),Natural DT(Spinosad),Niban(Orthoboric Acid), No Foam A(Nonylphenoxy polyethoxy ethanolols, Isopropanol and Fatty acids), No Foam B(Octyl phenoxy polyethoxy ethanololsopropanol, Linear alkyl sulfonate, lBuffering acids, Coconut amine, condensate, Silicone defoamer),NU-FILM- P(Poly - 1 -p-Menthene), Nuvan ProStrips+(DDVP),NyGuard(Pyriproxyfen),Odoban RTU(Alkyl (C12-16) dimethyl benzyl ammonium chloride), OneGuard(Lambda-cyhalothrin, Prallethrin, Pyriproxyfen, Piperonyl butoxide),Onslaught(Esfenvalerate, Prallethrin, Piperonyl butoxide), Onslaught FastCap(Esfenvalerate, Prallethrin, PBO),Optigard Ant Gel Bait(Thiamethoxam(1)),Optigard Roach Bait(Emamectin benzoate),Optimate(Gamma Cyhalothrin),OvoControl P(Nicarbazin),P.C.Q. Pro(Diphacinone), Patrol(Lambda-Cyhalothrin),PBO-8(Technical Piperonyl Butoxide), PENTRA-BARK(Polyalkylene Modified Heptamethyltrisiloxane and nonionic surfactants), Permethrin SFR(Permethrin),Perm-X UL 30/30(Permethrin, Piperonyl Butoxide), Petcor 2(Etofenprox, (S)-Methoprene, Piperonyl Butoxide), Phantom II PI(Chlorfenapyr),Phantom SC(Chlorfenapyr), PHOSPHO-Jet(Mono-and di-potassium salts of Phosphorous Acid),Precor 2625(Etofenprox, Tetramethrin,Pyrethrins,PBO, S-Methoprene), Precor IGR Concentrate(Methoprene),Premise 75(Imidacloprid),Premise Foam(Imidacloprid),Premise Pro(Imidacloprid), Pro Foam Platinum(Sulfates Disodium Lauroampho Diacetate), Proflex(Lambda-cyhalothrin, Novaluron, Pyriproxyfen), Progress(Ethofumesate),Propoliz(Propiconazole),Purge III(Pyrethrins), QuikStrike(Dinotefuran),QuikStrike Fly Bait Spray(Dinotefuran),Rat-Out Gel(Garlic Oil, White pepper), RatX(Corn Gluten Meal, Sodium Chloride, Citric Acid, Pubescent Whole Egg Solids, Soybean Oil),Rodent Bait Diphacinone .01% (Diphacinone),RoundUp Custom(GLYPHOSATE, ISOPROPYLAMINE SALT), Rozol Ground Squirrel(Chlorophacinone),Rozol Pocket Gopher Bait(Chlorophacinone-Liphadione),Rozol Vole Bait(Chlorophacinone), Safari 20 SG(Dinotefuran), Sedgehammer(Halosulfuron-methyl),Selontra(Chole calciferol),SFM-75(Sulfometuron Methyl), Sluggo (Iron Phosphate), Sluggo Leaf Life(Iron Phosphate), SnapShot(Trifluraline, isoxaben & isomers), SpeedZone Southern(Carfenfentazone-ethyl, 2,4-D, 2-ethylhexyl ester, MCPP, Dicamba),SpeedZone Southern EW(2,4-D, Dichloropro-p, Dicamba, Carfenfentazone-ethyl), Sumari(Clothianidin, Pyriproxyfen), Sumari Ant Bait(Clothianidin), Sumilar(Pyriproxyfen), SureGuard SC(Flumioxazin), Suspend PolyZone(Deltamethrin), Suspend SC(Deltamethrin), Takedown II(Bromethalin), Talpid(Bromethalin),TAP Insulation(Boric Acid), Taurus SC(Fipronil),Tekko 10(Novaluron), Tekko Pro(Novaluron, Pyriproxyfen),Tempo SC Ultra(Beta-Cyfluthrin), Terad3 Ag Blox(Cholecalciferol), Terad3 Blox(Cholecalciferol), Termidor Foam(Fipronil), Termidor HE(Fipronil), Termidor SC(Fipronil), Terro Ant Liquid Bait Station(Sodium Tetraborate Decahydrate), Thermolock InCide(Orthoboric Acid), Timbor(Disodium Octaborate Tetrahydrate), TREE-age G4(Emamectin Benzoate), Treerea R-10(Emamectin Benzoate), Trelona(Novaluron),ULD BP 100 II(Pyrethrin, PBO),ULD BP 300 II(Pyrethrins, PBO), Vikane(Sulfuryl Fluoride), Vital Oxide(Chlorine Dioxide, Alkyl dimethyl benzyl ammonium chloride, Alkyl dimethyl ethylbenzyl ammonium chloride), Wasp Freeze II(Prallethrin), WHY Trap(Heptyl Butyrate, 2-Methyl-1-butanol, Acetic Acid), Wilco Ground Squirrel Ag(Diphacinone), Wilco Ground Squirrel Bait(Diphacinone), Zimprox EC(Etofenprox),Zythor(Sulfuryl Fluoride).Western Termite Solutions, INC. will not apply any compound not authorized for use in California. **Western Termite Solutions, INC. will not apply any compound not authorized for use in California.**

If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800) 222-1222 and your pest control company immediately.

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. It's purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.