


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 215	Street Boeker Avenue	City Pismo Beach	ZIP 93449	Date of Inspection 02/10/2026	Number of Pages 4
Prize Pest Control 163 Surf Bird Court Guadalupe CA 93434 (805) 300-9099 Prizepestcontrolservices@gmail.com				Report # : 10238 Registration # : PR9432 Escrow # : <input type="checkbox"/> CORRECTED REPORT	
Ordered by: Robert Dickerson 215 Boeker Avenue Pismo Beach CA 93449 United States		Property Owner and Party of Interest:		Report sent to:	
COMPLETE REPORT <input checked="" type="checkbox"/>		LIMITED REPORT <input type="checkbox"/>		SUPPLEMENTAL REPORT <input type="checkbox"/>	
REINSPECTION REPORT <input type="checkbox"/>		GENERAL DESCRIPTION: One-story single family residence, wood siding, composition roof, vacant, detached garage		Inspection Tag Posted: Garage	
				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites <input type="checkbox"/>		Drywood Termites <input checked="" type="checkbox"/>		Fungus / Dryrot <input checked="" type="checkbox"/>	
				Other Findings <input type="checkbox"/>	
				Further Inspection <input type="checkbox"/>	
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Diagram Not To Scale

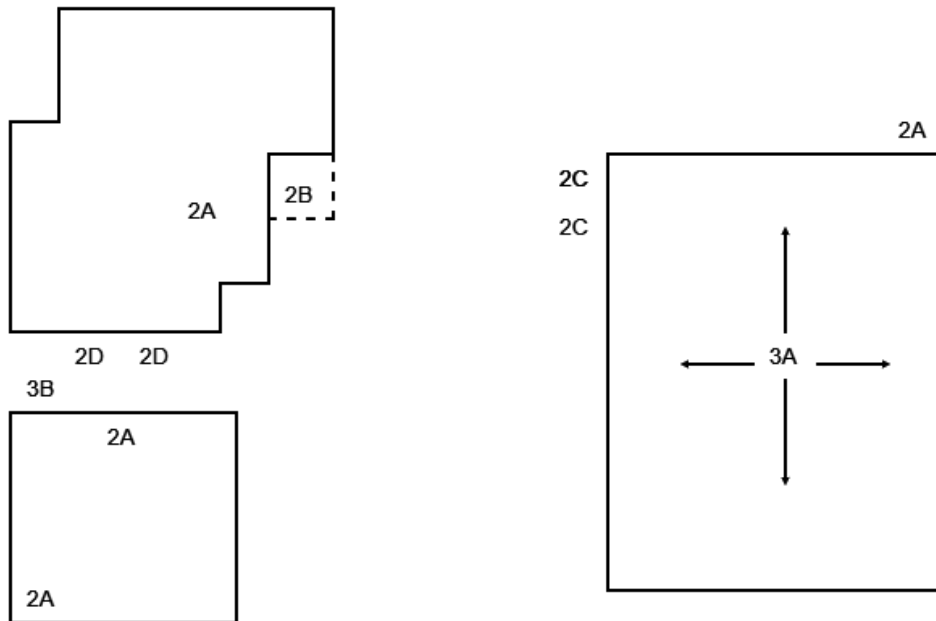

Inspected By: Eduardo Lopez State License No. PR14473 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 04/2015)

PRIZE PEST CONTROL

Page 2 of 4 inspection report

215	Boeker Avenue	Pismo Beach	CA	93449
Address of Property Inspected		City	State	ZIP
02/10/2026	10238			
Date of Inspection	Corresponding Report No.		Escrow No.	

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

PRIZE PEST CONTROL

Page 3 of 4 inspection report

215	Boeker Avenue	Pismo Beach	CA	93449
Address of Property Inspected		City	State	ZIP
02/10/2026	10238			
Date of Inspection	Corresponding Report No.		Escrow No.	

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF THE INSPECTION.

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

2. DRYWOOD TERMITES:

2A - Section I

FINDING: Evidence of drywood termites was noted at/in water heater closet, wood siding, baseboard and rafter.

RECOMMENDATION: Remove or cover accessible drywood termite fecal pellets.

RECOMMENDATION: Fumigate the structure with a gas lethal to drywood termites, with Vikane or Zythor (Sulfuryl Fluoride). Remove or cover drywood termite fecal pellets in accessible areas. Owner / agent to prepare for fumigation as per list of instructions to be furnished by this company. The structure must be vacated until release for re-entry by the licensed fumigator. 3 year warranty upon completion date.

2B - Section I

FINDING: Drywood termite damage was found at the wood siding. **RECOMMENDATION:** Remove and replace or reinforce damaged wood members. painting is included, color may not be an exact match.

2C - Section I

FINDING: Drywood termite damage was found at the shiplap. **RECOMMENDATION:** Remove and replace or reinforce damaged wood members. painting is included, color may not be an exact match.

2D - Section I

FINDING: Drywood termite damage was found at the rafter. **RECOMMENDATION:** Remove and replace or reinforce damaged wood members. painting is included, color may not be an exact match.

3. FUNGUS / DRYROT:

3A - Section I

FINDING: Fungus damage was found at wood framing under the subarea.

RECOMMENDATION: Remove and replace or reinforce damaged wood members. painting is included, color may not be an exact match.

3B - Section I

FINDING: Fungus damage was found at the shiplap.

RECOMMENDATION: Remove and replace or reinforce damaged wood members. painting is included, color may not be an exact match.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

PRIZE PEST CONTROL

Page 4 of 4 inspection report

215	Boeker Avenue	Pismo Beach	CA	93449
Address of Property Inspected		City	State	ZIP
02/10/2026	10238			
Date of Inspection	Corresponding Report No.		Escrow No.	

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following agencies in your area:

Poison Control Center	(800) 222-1222
Agricultural Department	(805) 781-5910
Health Department	(805) 781-5500
Structural Pest Control Board	(916) 561-8700

2005 Evergreen Street, Ste. 1500. Sacramento, CA 95815