


WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 11246	Street DENIVELLE PL	City TUJUNGA	ZIP 91042	Date of Inspection 07/06/2026	Number of Pages 5
 Hydrex Pest & Termite (HDX Pest Co. Inc.) 3252 Foothill Blvd. La Crescenta CA 91214 (818) 248-5186 hydrexgb@gmail.com www.hydrexglendale.com				Report # : 8027 Registration # : PR8071 Escrow # : ☐ CORRECTED REPORT	
Ordered by: PATRICIA RAMSEY 11246 DENIVELLE PL TUJUNGA CA 91042 MOBILE: (818) 523-3645 TRISH.REALTOR@GMAIL.COM		Property Owner and Party of Interest:		Report sent to: PATRICIA RAMSEY 11246 DENIVELLE PL TUJUNGA CA 91042 MOBILE: (818) 523-3645 TRISH.REALTOR@GMAIL.COM	
COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐					
GENERAL DESCRIPTION: One-story single family residence, stucco, composition roof, vacant, attached garage, slab foundation,				Inspection Tag Posted: Attic	
				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites ☐ Drywood Termites ☒ Fungus / Dryrot ☒ Other Findings ☐ Further Inspection ☐					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Diagram Not To Scale

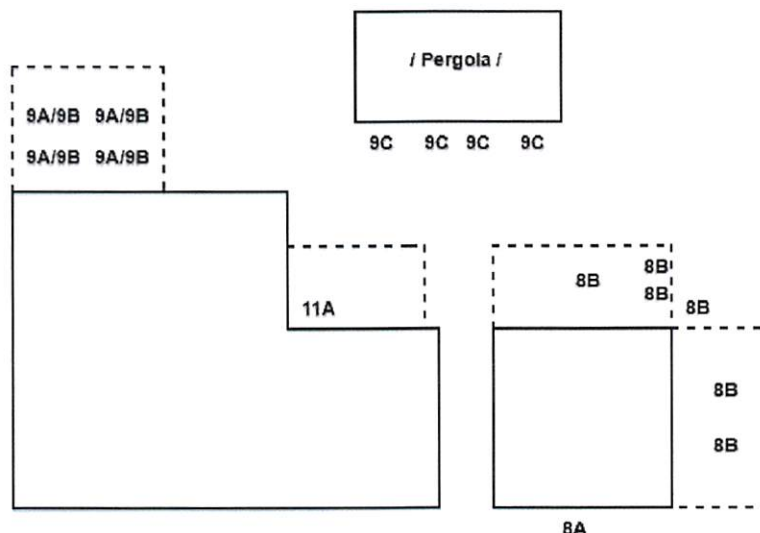

Inspected By: Ernest Kim State License No. FR61325 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California, 95815-3831.

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (Rev. 04/2015)

HYDREX PEST & TERMITE (HDX PEST CO. INC.)

Page 2 of 5 inspection report

11246	DENIVELLE PL	TUJUNGA	CA	91042
Address of Property Inspected		City	State	ZIP
07/06/2026	8027			
Date of Inspection	Corresponding Report No.	Escrow No.		

WHAT IS A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT? READ THIS DOCUMENT. IT EXPLAINS THE SCOPE AND LIMITATIONS OF A STRUCTURAL PEST CONTROL INSPECTION AND A WOOD DESTROYING PEST & ORGANISM INSPECTION REPORT.

A Wood Destroying Pest & Organism Inspection Report contains findings as to the presence or absence of evidence of wood destroying pests and organisms in visible and accessible areas and contains recommendations for correcting any infestations or infections found. The contents of Wood Destroying Pest & Organism Inspection Reports are governed by the Structural Pest Control Act and regulations.

Some structures do not comply with building code requirements or may have structural, plumbing, electrical, mechanical, heating, air conditioning or other defects that do not pertain to wood destroying organisms. A Wood Destroying Pest & Organism Inspection Report does not contain information on such defects, if any, as they are not within the scope of the licenses of either this company, or it's employees.

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations or infections may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture or appliances are not moved and windows are not opened during a routine inspection.

The exterior Surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractor's State License Board.

This company does not certify or guarantee against any leakage, such as (but not limited to) plumbing, appliances, walls, doors, windows, any type of seepage, roof or deck coverings. This company renders no guarantee, whatsoever, against any infection, infestation or any other adverse condition which may exist in such areas or may become visibly evident in such area after this date. Upon request, further inspection of these areas would be performed at an additional charge.

In the event damage or infestation described herein is later found to extend further than anticipated, our bid will not include such repairs. **OWNER SHOULD BE AWARE OF THIS CLOSED BID WHEN CONTRACTING WITH OTHERS OR UNDERTAKING THE WORK HIMSELF/HERSELF.**

If requested by the person ordering this report, a re-inspection of the structure will be performed. Such requests must be within four (4) months of the date of this inspection. Every re-inspection fee amount shall not exceed the original inspection fee.

Wall paper, stain, or interior painting are excluded from our contract. New wood exposed to the weather will be prime painted, only upon request at an additional expense.

This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTICE: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

This Wood Destroying Pest & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold-like conditions. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you wish your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

HYDREX PEST & TERMITE (HDX PEST CO. INC.)

Page 3 of 5 inspection report

11246	DENIVELLE PL	TUJUNGA	CA	91042
Address of Property Inspected		City	State	ZIP
07/06/2026	8027			
Date of Inspection	Corresponding Report No.	Escrow No.		

SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION.

SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND.

FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE HIS INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

Please Note: Areas with heavy storage, large furnishings, tacked down carpet and covered walls are considered "inaccessible" for inspection. Any infestation and/or damages in these inaccessible areas are not included in this report, unless made accessible for re-inspection (charge may apply if owner/agent did not make property accessible for a complete inspection).

Fumigation does not warranty subterranean termites. Subterranean termites are a different type of termites that live and build their colonies in and beneath the soil, they are treated differently. Warranty of fumigation will be treated locally and not re-tented.

SECTION I:

8A - Garages

FINDING - Evidence of drywood termites noted as indicated on diagram.

PRIMARY RECOMMENDATION - We recommend fumigation. The structure will have to be covered and/ or sealed to allow for a fumigant to be released into the enclosed space to gain control of infestation(s) noted in our finding(s).

We will exercise extreme caution during the fumigation process but can assume no liability for conditions such as but not limited to Tile/ wood shake / composition / metal / concrete roofing material and/ or roof conditions, plant life close to or adjacent to the structure. In the case of rain or winds (inclement weather) the fumigation process will be postponed to a time that is mutually agreeable. Evidence is to be covered, cleared or marked.

SECONDARY RECOMMENDATION - Locally treat for the control of drywood termites. Remove or cover the drywood termites fecal pellets in accessible areas. Local treatment is not intended to be an entire structure treatment method.

9A - Decks / Patios

FINDING - Evidence of drywood termites noted as indicated on diagram.

PRIMARY RECOMMENDATION - We recommend fumigation. The structure will have to be covered and/ or sealed to allow for a fumigant to be released into the enclosed space to gain control of infestation(s) noted in our finding(s).

We will exercise extreme caution during the fumigation process but can assume no liability for conditions such as but not limited to Tile/ wood shake / composition / metal / concrete roofing material and/ or roof conditions, plant life close to or adjacent to the structure. In the case of rain or winds (inclement weather) the fumigation process will be postponed to a time that is mutually agreeable. Evidence is to be covered, cleared or marked.

SECONDARY RECOMMENDATION - Locally treat for the control of drywood termites. Remove or cover the drywood termites fecal pellets in accessible areas. Local treatment is not intended to be an entire structure treatment method.

9B - Decks / Patios

FINDING - Drywood termite damage to the area indicated on diagram.

RECOMMENDATION - Repair/Patch the drywood termite damaged wood member(s) noted in the above.

9C - Decks / Patios

FINDING - Dry rot/Fungus damage to the area indicated on diagram.

RECOMMENDATION - Repair/Patch damaged wood member(s) noted in the above finding and apply one coat of primer. If the owner provides the paint, we will proceed with painting as well.

11A - Other / Exterior

FINDING - Dry rot/Fungus damage to the area indicated on diagram.

RECOMMENDATION - Repair/Patch damaged wood member(s) noted in the above finding. We will paint with primer and the paint

HYDREX PEST & TERMITE (HDX PEST CO. INC.)

Page 4 of 5 inspection report

11246	DENIVELLE PL	TUJUNGA	CA	91042
Address of Property Inspected		City	State	ZIP
07/06/2026	8027			
Date of Inspection	Corresponding Report No.	Escrow No.		

provided by owner..

SECTION II:

8B - Garages

FINDING - Roof Sheathing is damage to the area indicated on diagram.

RECOMMENDATION - I recommend having it evaluated by a qualified roofing contractor to determine the necessary repairs.

Thank you for selecting us to perform a structural pest control inspection on your property. Should you have any questions regarding this report, please call us directly by the contact information provided on the first page of the inspection report.

Our inspectors have determined that your property will benefit from a safe application of chemicals commonly used for structural pest control. In accordance with the laws and regulations of the State of California, we are required to provide you and your occupants with the following information prior to any application of chemicals to such property.

Please take a few moments to read and become familiar with the content. State law requires that you be given the following information:

CAUTION - PESTICIDES ARE TOXIC CHEMICALS. Structural pest control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on scientific evidence, there are no appreciable risks weighted by the benefits. The degree of risk depends on the degree of exposure, so exposure should be minimized.

If within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center and your pest control operator immediately.

For further information, contact any of the following:

HDX PEST CO INC: Hydrex Pest Control & Termite Co Office (818) 248-5186

County Health Department: Los Angeles County (213) 250-8055 (626) 430-5459, Orange County (714) 834-7700

County Agricultural Commissioner: Los Angeles County (626) 575-5466, Orange County (714) 447-7100

Structural Pest Control Board (916) 561-8700

2005 Evergreen Street, Ste.1500, Sacramento, CA 95815

Poison Control Center (800) 876-4766

THE FOLLOWING CHEMICALS MAY BE USED:

Tim-bor (EPA Reg. No. 64405-8 / Active Ingredient: Disodium Octaborate Tetrahydrate)

Termidor SC (EPA Reg. No. 7969-210 / Active Ingredient: Fipronil)

Bora-Care EPA #64405-1 (Disodium Octaborate Tetrahydrate 40%)

Termidor Foam EPA #499-563 (Fipronil - 0.005%)

Vikane (EPA Reg. No. 1015-78 / Active Ingredient: Sulfuryl Fluoride)

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his/her work or supplies, has a right to enforce a claim against your property. This means that, after a court hearing, your property could be sold by a court officer, and the proceeds of the sale will be used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if subcontractor, laborer, or suppliers remain unpaid.

Preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

HYDREX PEST & TERMITE (HDX PEST CO. INC.)

Page 5 of 5 inspection report

11246	DENIVELLE PL	TUJUNGA	CA	91042
Address of Property Inspected		City	State	ZIP
07/06/2026	8027			
Date of Inspection	Corresponding Report No.	Escrow No.		

Note: All repair bids on this report are to repair existing structures as noted on our report. It is the responsibility of the owner of this property to inform Hydrex Pest & Termite, Co. if some existing structure being repaired is not permitted or not built to code. It is the property owners responsibility prior to approving any repairs to check with the City Building Dept. to see if permits are required for the work estimated below. If required, the property owner will need to pull permits as an owner and notify Hydrex Pest & Termite, Co. Any additional work required by City Building Dept. and or field inspector s will be an additional cost.

PLEASE NOTE: It is the responsibility of the ESCROW COMPANY to notify us IMMEDIATELY, if for any reason the transaction falls out of escrow or is cancelled. If this should happen, the HOMEOWNER is responsible for paying the full invoiced amount, for any and all work completed, within 10 days of the cancelled escrow.

ADDITIONALLY: It is the AGENTS' responsibility to provide Hydrex Pest & Termite, Co. with any and all escrow information. If we do not receive any Escrow information, all reports and billing invoices will be sent to the agent ordering the inspection. It is then the AGENTS' responsibility to furnish any and all WDO/Termite inspections, completion, and billing documentation directly to Escrow. Unless other arrangements have been made and documented, Escrow should NOT close before WDO invoices are PAID IN FULL.



Hydrex Pest & Termite (HDX Pest Co. Inc.)

3252 Foothill Blvd.
La Crescenta CA 91214
(818) 248-5186
hydrexgb@gmail.com
www.hydrexglendale.com

Page 1 of 1

WORK AUTHORIZATION

Report #: 8027

No work will be performed until a signed copy of this agreement has been received.

Address of Property : 11246 DENIVELLE PL

City: TUJUNGA

State/ZIP: CA 91042

The inspection report of the company dated, **07/06/2026** is incorporated herein by reference as though fully set forth.

The company is authorized to proceed with the work outlined in the items circled below from the Termite Inspection Report for the property inspected, for a total sum of \$ _____.

This total amount is due and payable within **7 days** from completion repair work and/or chemical application.

THE COMPANY AGREES

To guarantee all repair completed by this company for one year from date of completion except for caulking, grouting, or plumbing, which is guaranteed for a period of **ninety (90) days**. We assume no responsibility for work performed by others, to be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed 30 days, to use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or roof.

THE OWNER OR OWNER'S AGENT AGREES

To pay for services rendered in any additional services requested upon completion of work to pay a service charge of one and one-half percent (1 1/2%) interest per month, or portion of any month, annual interest rate of eighteen percent (18%) on accounts exceeding the ten (10) day full payment schedule. The Owner grants to The Company a security interest in the property to secure payment sum for work and inspection fee completed. In case of non-payment by The owner, reasonable attorney fees and costs of collection shall be paid by owner, whether suit be filed or not.

ALL PARTIES AGREE

If any additional work is deemed necessary by the local building inspector, said work will not be performed without additional authorization from owner or owner's agent. This contract price does not include the charge of any Inspection Report fees. Circle the items you wish performed by The Company, below and enter total amount above:

NOTICE TO OWNER

Under the California Mechanics Lien Law, any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.

To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.

CONDITIONAL GUARANTEE

*Areas treated locally for subterranean termites are guaranteed for one (1) year. HDXSUB: Areas treated locally and preventatively treated for subterranean termites are guaranteed for three (3) years *Areas treated locally for drywood termites are guaranteed for one (1) year. *Areas treated with fumigation for drywood termites are guaranteed for two (2) years.* This company is not responsible for any future infestation, dry rot or adverse conditions beyond the time of inspection. NOTE: A new and/or extension of guarantee is never given for re-treatments done under original guarantee.

ITEMS				
Prefix	Section I	Section II	Further Inspection	Other
8B(Wood Repair-Wood Damaged/Roof Sheathing)	0.00	Owner To Do-A	0.00	0.00
8A/9A(Fumigation-Drywood Termite)	2,795.00	0.00	0.00	0.00
9B(Wood Repair-Drywood Termite Damaged)	2,250.00	0.00	0.00	0.00
9C/11A(Wood Repair-DryRot)	700.00	0.00	0.00	0.00
Total:	5,745.00	0.00	0.00	0.00
Grand Total:	5,745.00			

Owner or Buyer:

Date:

Inspected By:

Date:

11246 DENIVELLE PL
Address of Property Inspected

TUJUNGA
City

CA
State

91042
ZIP




Finding 8B



Finding 8B



Finding 8B

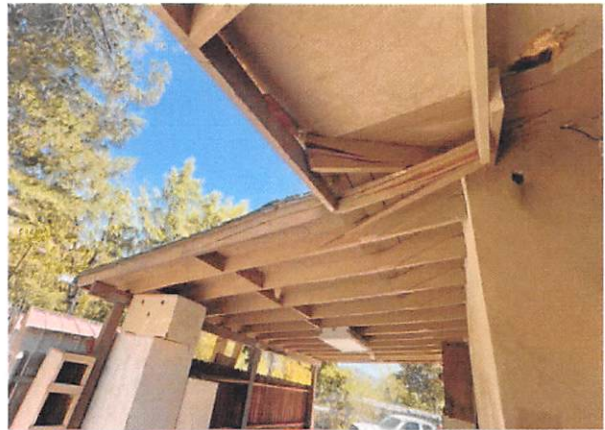

Finding 8B



Finding 8B



Finding 8B

11246 DENIVELLE PL
Address of Property Inspected

TUJUNGA
City

CA
State

91042
ZIP



Finding 9A



Finding 9A



Finding 9B



Finding 9B



Finding 9C



Finding 9C

11246 DENIVELLE PL
Address of Property Inspected

TUJUNGA
City

CA
State

91042
ZIP



Finding 9C



Finding 9C



Finding 9C



Finding 11A



INVOICE / STATEMENT
Hydrex Pest & Termite (HDX Pest Co. Inc.)
3252 Foothill Blvd.
La Crescenta CA 91214
(818) 248-5186
hydrexgb@gmail.com
www.hydrexglendale.com

Date: 07/06/2026
Report Number: 8027
Invoice Number: 8027-1
Escrow Number:

Property 11246 DENIVELLE PL
Inspected: TUJUNGA, CA 91042

Bill To: PATRICIA RAMSEY
11246 DENIVELLE PL
TUJUNGA, CA 91042

MOBILE: (818) 523-3645
TRISH.REALTOR@GMAIL.COM

Termite Inspection & Report: \$	150.00
Invoice Total: \$	150.00
Payments: \$	150.00
Total Due: \$	0.00

Description of Service
Termite Inspection & Report

RETAIN THIS COPY FOR YOUR RECORDS
THANK YOU FOR YOUR BUSINESS.

CUT HERE

CUT HERE

CUT HERE



INVOICE / STATEMENT
Hydrex Pest & Termite (HDX Pest Co. Inc.)
3252 Foothill Blvd.
La Crescenta CA 91214
(818) 248-5186
hydrexgb@gmail.com
www.hydrexglendale.com

Date: 07/06/2026
Report Number: 8027
Invoice Number: 8027-1
Escrow Number:

Property 11246 DENIVELLE PL
Inspected: TUJUNGA, CA 91042

Bill To: PATRICIA RAMSEY
11246 DENIVELLE PL
TUJUNGA, CA 91042

MOBILE: (818) 523-3645
TRISH.REALTOR@GMAIL.COM

Termite Inspection & Report: \$	150.00
Invoice Total: \$	150.00
Payments: \$	150.00
Total Due: \$	0.00

Description of Service
Termite Inspection & Report

RETURN THIS COPY WITH REMITTANCE
THANK YOU FOR YOUR BUSINESS.