

STANDARD NOTICE OF WORK COMPLETED AND NOT COMPLETED

NOTICE - All recommendations may not have been completed - See below - Recommendations not completed.
This form is prescribed by the Structural Pest Control Board.

Building No. 1226	Street Main St Spc 11	City Cambria	Zip 93428-3311	Date of Completion 05/18/26
KEY TERMITE and PEST CONTROL PO Box 969, Atascadero, CA 93423-0969 805-466-2451 / 805-466-8026 fax / 800-548-5599			 A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. ANY QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER. Report #: 113363	
Ordered by:		Property Owner and Party of Interest: Sandy & Mark Rayburn 1226 Main St Spc 11 Cambria, CA 93428-3311		Completion sent to:

The following recommendations on the above designated property, as outlined in the Wood Destroying Pests and Organisms Inspection Report dated 05/05/26 have been and/or have not been completed.

Recommendations completed by this firm that are in accordance with the Structural Pest Control Board's Rules and Regulations: 1A, 1B, 3A.									
Recommendations completed by this firm that are considered secondary and substandard measures under Section 1992 of the Structural Pest Control Board's Rules and Regulations including person requesting secondary measure:									
Cost of work completed: <table><tr><td>Cost: \$</td><td><u>2,353.00</u></td></tr><tr><td>Inspection Fee: \$</td><td><u>89.00</u></td></tr><tr><td>Other: \$</td><td><u>0.00</u></td></tr><tr><td>Total: \$</td><td><u>2,442.00</u></td></tr></table>		Cost: \$	<u>2,353.00</u>	Inspection Fee: \$	<u>89.00</u>	Other: \$	<u>0.00</u>	Total: \$	<u>2,442.00</u>
Cost: \$	<u>2,353.00</u>								
Inspection Fee: \$	<u>89.00</u>								
Other: \$	<u>0.00</u>								
Total: \$	<u>2,442.00</u>								
Recommendations not completed by this firm: 4A. <table><tr><td>Estimated Cost: \$</td><td><u>300.00</u></td></tr></table>		Estimated Cost: \$	<u>300.00</u>						
Estimated Cost: \$	<u>300.00</u>								
Remarks: THIS IS TO CERTIFY THAT THE PROPERTY DESCRIBED HEREIN IS NOW FREE OF EVIDENCE OF ACTIVE INFESTATION OR INFECTION IN THE VISIBLE AND ACCESSIBLE AREAS INSPECTED.									

Signature  _____

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA, 95815-3831
NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (REV. 10/01)



Account Statement	
Account #:	59571
Statement Date:	05/19/2026
Total Amount Due:	2,353.00
Page 1 of 1	

Sandy Rayburn
1226 Main St Spc 11
Cambria, CA 93428-3311

Date	Invoice #	Description	Amount	Tax	Balance
Service Address: *seller* 1226 Main St Spc 11, Cambria, CA 93428-3311					
05/14/2026	395450	Repair	1,326.00	0.00	1,326.00
05/15/2026	395451	Subterranean Termite Treatment-5 year warranty	1,027.00	0.00	1,027.00

Payment Receipt. Please Return with Payment Remittance

Bill-To: Sandy Rayburn
1226 Main St Spc 11
Cambria, CA 93428-3311

Account #: 59571 Date: 05/19/2026

Total Due: 2,353.00

Amount Paid: _____

Check No. _____

Remit-To: Key Termite & Pest Control
PO BOX 969
Atascadero, CA 93423
805-466-2451

Thank you for choosing Key Termite and Pest Control. Feel free to contact us if you have any questions.

Current	Over 30	Over 60	Over 90	Total
2,353.00	0.00	0.00	0.00	2,353.00



Building No.	Street	City	Zip	Date
1226	Main St Spc 11	Cambria	93428-3311	05/08/26

Report #: 113363

Ordered by: Jack Posemsky Real Estate Jack Posemsky 718 Main Street Cambria, CA 93428	Property Owner and/or Party of Interest: Sandy Rayburn 1226 Main St Spc 11 Cambria, CA 93428-3311	Completion sent to:
---	--	---------------------

SECTION I		SECTION II		SECTION NOT DETERMINED OR FURTHER INSPECTION RECOMMENDED	
1A	\$1,027.00	4A	\$300.00		
1B	\$306.00				
3A	\$1,020.00				
Total Section I: \$2,353.00		Total Section II: \$300.00			

1A, 1B, 3A

Thank you for choosing Key Termite and Pest Control for your pest control needs. Feel free to call our office to answer any questions you may have concerning the Inspection Report, the Work to be completed or the Terms of this Contract. PLEASE INITIAL THIS PAGE AND RETURN BOTH PAGES OF THIS AGREEMENT TO OUR OFFICE.

WORK ORDER AGREEMENT (PAGE 2 OF 2)

Building No.	Street	City	Zip	Date
1226	Main St Spc 11	Cambria	93428-3311	05/08/26

*****State law requires that you be given the following information*****

CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation Agency and the United States Environmental Protection Agency. Registration is granted when the State finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or Poison Control Center and Key Termite and Pest Control, Inc. (805) 466-2451 immediately. For further information contact any of the following:

For health questions: The County Health Department (805) 781-5500

For application information: The County Agricultural Commissioner (805) 781-5910

For regulatory information: The Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815-3831, (916) 561-8700

Prices for structural repair include replacement of damaged wood members visible at the time of inspection only. Structural improvements necessary to upgrade the existing construction to current building code or corrections of hidden conditions exposed during repairs will be completed at additional expense. This company assumes no liability for improper or non compliant structure(s) on which we complete repairs. Parties in interest should contact the county building department and/or qualified home inspector concerning the structures' compliance with building code. The property owner is responsible to pay for all costs associated with building permits and engineering fees needed and is not included in the repair bid. There will also be additional costs if upgrades are required by the local building department prior to or during the course of repairs. These costs should be determined and appropriated by parties in interest prior to the close of escrow. Reasonable effort will be taken to match existing material being replaced with the same or similar type. However, Key Termite and Pest Control Inc. does not guarantee new material will match the existing material. Special order materials may delay the completion of recommended work and certification date. Painted wood members that are replaced by this company (except stained or varnished wood, and redwood decking) will be painted unless otherwise requested and will be billed as quoted in report recommendation. This company makes no guarantee of color match. The buyer or seller is responsible to choose paint color prior to commencement of repairs. Structural repair recommendations not priced above may be completed upon request and will be billed at \$85.00 per hour which will include basic construction materials (doors, windows and redwood deck materials would be additional). Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes no liability for distribution of molds, dusts or other allergens as a result of repairs performed to the property. Parties in interest should contact a Certified Industrial Hygienist for further information and advice prior to commencement of repairs. We will exercise reasonable caution with adjacent plant growth during the completion of repairs, however, neither Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes any liability for damages to adjacent plant growth as a result of the completion of repairs. Prices authorized after 30 days from the date of issuance of the inspection report are void and must be re-bid. Our minimum job fee is \$145.00 (to cover trip costs and completion notice paperwork). If repairs completed total less than \$145.00, we will bill the \$145.00 minimum fee.

Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier, or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers, or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of person(s) who may have a right to file a lien against your property if they are not paid.

NOTICE: Invoices are due and payable within 30 days. 1.5% per month will be added to account balances beyond 30 days from the date of work completed. This is an annual percentage rate of 18%. (Interest charged pursuant to the Robinson-Patman Act). Interest amounts for balances billed to an Escrow Company as a course of a Real Estate sale will be waived up to 4 months from the date of work completed so long as the property remains in escrow. Should an Escrow transaction cancel, the full account balance is due and payable upon the Escrow cancellation date.

By executing this work authorization contract, customer acknowledges that he or she has been advised of the forgoing and has had the opportunity to consult with a qualified professional.

UNLESS OTHERWISE STATED IN THE INSPECTION REPORT OR THIS CONTRACT, ALL WORK COMPLETED BY KEY TERMITE AND PEST CONTROL IS GUARANTEED FOR TWO YEARS FROM THE DATE OF COMPLETION AGAINST DEFECTS IN MATERIALS AND/OR WORKMANSHIP. ELIMINATION OF REPORTED WOOD DESTROYING PESTS BY STRUCTURAL FUMIGATION AND "PERIMETER PLUS" SUBTERRANEAN TERMITE TREATMENT IS GUARANTEED FOR FIVE YEARS FROM THE DATE OF COMPLETION.

BY SIGNING BELOW, I ACKNOWLEDGE THAT I HAVE READ, UNDERSTAND AND AGREE TO THE TERMS OF THIS CONTRACT AND THE REPORT IT REFERS TO.

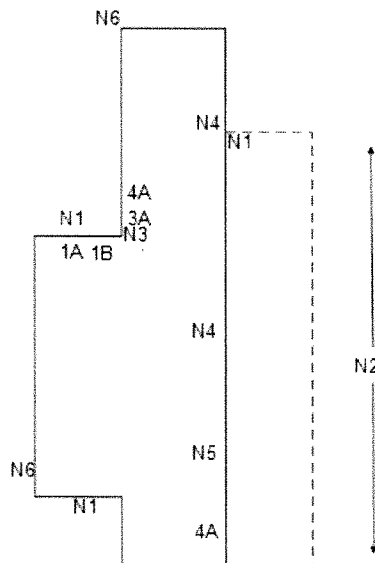
BY OWNER/AGENT/BUYER		Key Termite & Pest Control	
PHONE:	_____	By:	Austin Bennett
SIGNATURE:	<u>jack</u>	Signature:	
PRINT NAME:	_____	Lic. #:	FR71066
NOTE: WORK WILL NOT COMMENCE UNTIL DELIVERY OF YOUR WOOD DESTROYING PESTS AND ORGANISMS REPORT. FOR DETAILS REGARDING THE ABOVE RECOMMENDATIONS PLEASE REFER TO YOUR INSPECTION REPORT.			

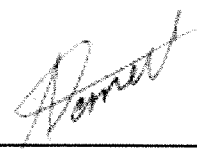
WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No. 1226	Street Main St Spc 11	City Cambria	Zip 93428-3311	Date of Inspection 05/05/2026	Number of Pages 1 of 5
 KEY TERMITE and PEST CONTROL PO Box 969, Atascadero, CA 93423-0969 805-466-2451 / 805-466-8026 fax / 800-548-5599			A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER. Report #: 113363		
Ordered by: Jack Posemsky Real Estate Jack Posemsky 718 Main Street Cambria, CA 93428		Property Owner and Party of Interest: Sandy Rayburn 1226 Main St Spc 11 Cambria, CA 93428-3311		Report sent to:	
COMPLETE REPORT ☒ LIMITED REPORT ☐ SUPPLEMENTAL REPORT ☐ REINSPECTION REPORT ☐					
General Description: Mobile home; Vinyl siding; Flat roof; Furnished and occupied.				Inspection Tag Posted: WATER HEATER CLOSET	
				Other Tags Posted:	
An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.					
Subterranean Termites ☒ Drywood Termites ☐ Fungus/Dryrot ☒ Other Findings ☒ Further Inspection ☐					
If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.					

Complete Inspection Report

Diagram not to scale
Finding locations approximate



Inspected By: Austin Bennett State License No.: FR71066 Signature: 

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815

NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.

43M-41 (REV. 04/2015)

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1226	Main St Spc 11	Cambria	93428-3311	05/05/2026	3 of 5

This is a separated report which is defined as Section I/Section II conditions evident on the date of the inspection. Section I contains items where there is visible evidence of active infestation, infection or conditions that have resulted in or from infestation of infection. Section II items are conditions deemed likely to lead to infestation or infection but where no visible evidence of such was found. Further inspection items are defined as recommendations to inspect area(s) which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.

Description of Findings

SECTION: I SUBTERRANEAN TERMITES

Finding: 1A Evidence of Subterranean Termite infestation was found at the substructure and indicates an infestation in the soil below the structure.

Recommendation: Drill through the concrete slab in areas of infestation and chemically treat soil below using Taurus SC (fipronil). Fill in the holes with concrete. Remove all the accessible evidence of Subterranean Termite infestation. In addition, an application will be made to the soil adjacent to the exterior wall around the complete perimeter of the structure. Holes may be drilled through concrete, paving or masonry adjacent to the foundation in areas such as, but not limited to; patios, sidewalks, porches and driveways, to allow for chemical treatment of the soil below. We will exercise reasonable caution when drilling but assume no liability for damage to hidden plumbing, electrical, or other utility below these areas. The location of such utilities should be identified prior to our arrival. Regardless of locations of Subterranean Termite infestation found, control of the entire structure is guaranteed. Control is guaranteed by Key Termite and Pest Control for a period of 5 years from the date of treatment. NOTE: Any exterior storage must be moved away at least 3 feet from the perimeter of the structure prior to our arrival.

Price: \$1,027.00

Finding: 1B Subterranean Termite damage was noted at the mud plate.

Recommendation: Make the necessary corrections to eliminate the leakage at the mud plate water supply valve.

Price: \$306.00

FUNGUS/DRYROT

Finding: 3A Fungus damage has occurred to the water heater closet framing and substructure floor due to leakage at the water heater.

Recommendation: Remove and replace the damaged portions of the water heater closet framing and substructure floor as needed to eliminate the fungus infection. Make necessary corrections to the water heater to eliminate the excessive moisture condition.

Price: \$1,020.00

SECTION: II OTHER FINDINGS

Finding: 4A The toilet was found to be loosely bolted to the floor. This creates a potential source of leakage.

Recommendation: Reset the toilet using a new wax seal and bolts. Additional costs may apply if the toilet flange is found to be damaged or if existing supply line/valve cannot be reused.

Price: \$300.00

Section I Total: \$2,353.00
Section II Total: \$300.00

Grand Total: \$2,653.00 (totals include items priced above only)

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1226	Main St Spc 11	Cambria	93428-3311	05/05/2026	4 of 5

Informational Items

INFORMATIONAL ITEM> N1 : The steps are not attached and was not included in this report.

INFORMATIONAL ITEM> N2 : The metal awning was not inspected. Parties in interest should satisfy themselves as to this condition prior to the close of escrow.

INFORMATIONAL ITEM> N3 : Water stains were noted at the water heater closet. It appears to have been caused by a previous leak. This leak may have already been corrected. It was not possible to determine the activity or cause of leakage at the time of inspection.

INFORMATIONAL ITEM> N4 : Water stains were noted at the interior wall paneling. It appears to have been caused by a previous leak. This leak may have already been corrected. It was not possible to determine the activity or cause of leakage at the time of inspection.

INFORMATIONAL ITEM> N5 : water stains were noted at the ceiling. It appears to have been caused by a previous leak. This leak may have already been corrected. It was not possible to determine the activity or cause of leakage at the time of inspection.

INFORMATIONAL ITEM> N6 : The attached/abutted wood fences were not included in this inspection.

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1226	Main St Spc 11	Cambria	93428-3311	05/05/2026	2 of 5

General Comments

THIS IS A COMPLETE INSPECTION and includes structure(s) of the property as described on page one of this report. The inspection is limited to visible and accessible areas of the structure(s) drawn in diagram space. Other structures of the property were not included in this report. See the statements on the final page of this report for further information as to the scope of this inspection.

NOTE: Prices quoted on this report reflect all work being completed at the same time. If individual items are requested the price for those items are subject to change to our minimum job price in order to account for the appropriate labor and materials cost. This applies to repair items only.

NOTE: All prices quoted on this report reflect cash/check pricing, any credit or debit card payments made will incur a 3% processing fee.

NOTE: This structure was furnished at the time of this inspection. Areas covered by normal storage or furnishings were not accessible for visual inspection. Further inspection will be completed upon request after storage has been removed by others. There may be a fee charged for this reinspection.

NOTE: The substructure framing below the mobile home was completely inaccessible for inspection due to insulation and the insulation cover. If further inspection of framing is desired, all or desired portions of the insulation and the cover must be removed to allow for access to inspect these areas. A reinspection fee will be charged.

NOTE: All plant growth at the perimeter of the structure must be cut back to allow 12"-18" of clearance for tarp fumigation. Tree branches must be cut back 4 - 5 feet up from the roof surface if overhanging onto the roof. Plant growth growing on or against the structure which cannot be adequately pulled away from the structure may be covered by the tarp and die as a result of the fumigation process. Additional charges may apply if these preparations are not completed prior to the fumigation date. Labor will be billed at \$135 per hour for preparations.

NOTE: To minimize escape of the fumigant through the soil, remove all ground cover (bark, gravel, decorative rock, etc.), remove storage away from building perimeter and wet the soil adjacent to the structure prior to the fumigation. Labor will be billed at \$135 per hour for preparations. will be billed to the homeowner for ground preparations completed by Key Termite and Pest Control.

NOTE: Portions of the eaves were inaccessible due to boxed eave construction.

NOTE : Attached metal awnings, carport and/or window awnings were not inspected.

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building No.	Street	City	Zip	Date of Inspection	Number of Pages
1226	Main St Spc 11	Cambria	93428-3311	05/05/2026	5 of 5

1. This inspection is limited to the visible and accessible portions of the structure as noted on the diagram only. Although a full diagram may be drawn for reference purposes, all areas may not have been inspected. Please read the entire report to determine the limitations of the inspection. All findings will pertain to infestation and/or infection by wood destroying pests and/or organisms and does not include reference to other structural pests such as, but not limited to; Rats, Mice, Bats, Fleas, Cockroaches, Ants, Etc.. This inspection does not include opinions as to the condition of plumbing, roofing, electrical, gas, heating, air conditioning, or other such structural elements. If such information is desired, we suggest that a qualified Home Inspector and Contractors be contacted. Inspection of fences is not included in this report unless otherwise stated. The exterior surface of the roof was not inspected. If you want the water tightness of the roof determined, you should contact a roofing contractor who is licensed by the Contractors' State License Board.
2. The following areas were not inspected, as indicated in Section #1990, paragraph (j) of the Structural Pest Control Act and Rules and Regulations: Portions of furnished interiors concealed by personal property, inaccessible attics, insulated attics, and portions thereof; the interior of hollow walls; spaces between a floor or porch deck and the ceiling or soffit below; stall showers over finished ceilings: such structural segments as porte-cocheres, enclosed bay windows, buttresses and similar areas to which there is no access without defacing or tearing out lumber, masonry and finished work; built-in cabinet work, floor beneath coverings; areas where storage conditions or locks makes inspection impractical; portions of the structure covered by plant growth. The inspector did not move storage or furnishings during inspection. NEITHER KEY TERMITE AND PEST CONTROL, INC. NOR ITS EMPLOYEES OR SUBCONTRACTORS MAKES ANY GUARANTEE AGAINST FUTURE OR HIDDEN INFESTATION(S), INFECTION(S), OR ADVERSE CONDITION(S) PRESENT BUT NOT EVIDENT AT THE TIME OF INSPECTION(S). Routine inspection does not include opening windows, opening all exterior doors or inspecting interior of cabinets. Further inspection of these areas may be completed upon request and at additional expense.
3. CERTIFICATION applies to visible and accessible areas of the structure observed at the time of original inspection. This certification does not constitute a guarantee that parties in interest will not inherit hidden infestations, infections or adverse conditions. Key Termite and Pest Control, Inc. assumes no liability for such hidden conditions. If a problem is discovered that was not disclosed during our inspections, do not disturb the area. Contact our office immediately to inspect the problem area and allow proper determination.
4. REINSPECTIONS: "This Company will reinspect repairs done by others within 4 months of the Original inspection. A charge, if any can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs." Consultation appointments will be made upon request. On site appointments will be billed at a minimum of \$45.00 per appointment. Telephone calls to discuss the report findings are no charge.
5. The structure was inspected from the ground level only. Portions of the structure that extend more than 10 feet from the ground level were visually inspected only. Accuracy above this point cannot be guaranteed. Wood members showing visible signs of infestation or infection were pick-tested to determine the nature and extent of the finding. The inspector did not get up on the roof to inspect wood members accessible from the roof.
6. NOTICE: The structural Pest Control Board encourages competitive business practices among registered companies. Reports on this structure prepared by various companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.). However, recommendations to correct these findings may vary company to company. You have a right to seek a second opinion from another company.
7. NOTICE: The charge for service that this company subcontracts to another person or entity may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. YOU MAY ACCEPT KEY TERMITE & PEST CONTROL'S BID OR YOU MAY CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY LICENSED TO PERFORM THE WORK. IF YOU CHOOSE TO CONTRACT DIRECTLY WITH ANOTHER REGISTERED COMPANY, KEY TERMITE & PEST CONTROL WILL NOT BE RESPONSIBLE FOR ANY ACT OR OMISSION IN THE PERFORMANCE OF WORK THAT YOU DIRECTLY CONTRACT WITH ANOTHER TO PERFORM.
8. This property WAS NOT inspected for the presence or absence of health related molds or fungi. By California Law, we are neither qualified, authorized nor licensed to inspect for health related molds. If you desire information about the presence or absence of health related molds, contact the California Department of Health Related Services. A link may be found in our web site at the following web address <http://www.keytermite.com/Realtors/mold.html>
9. Pesticides are the products Key Termite & Pest Control uses to control the target pests listed in your Inspection Report. Pesticides are indispensable tools our industry uses to control disease carrying pests and wood destroying insects, thus protecting your health and property. When properly used, pesticides pose minimal risk to humans or the environment. Your Technician is a State certified applicator whose knowledge is constantly being upgraded through regularly scheduled training sessions. If you have any questions, please call us at: 805-466-2451 or write to: Key Termite & Pest Control, PO BOX 969, Atascadero, CA 93423. Key Termite & Pest Control will not apply any compound not authorized for use in California. Please refer to the Inspection Report above for proposed materials to be used.
10. CAUTION: PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Operators are licensed and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the State finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized. If within 24 hours following an application you experience symptoms similar to common seasonal illness, comparable to the flu, contact Key Termite & Pest Control (805-466-2451), your physician, and/or your Poison Control Center. For the Poison Control Center, contact the following: (1-800-876-4766). FURTHER INFORMATION: Contact any of the following: Your pest control operator is Key Termite & Pest Control, (805-466-2451); for Regulatory Information call the Structural Pest Control Board (916-561-8708), or write 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815. For answers to your health questions, call the County Health Department; Santa Barbara County Health Dept (805-681-5102); San Luis Obispo County Health Dept (805-781-5544); and for application information, contact the County Agriculture Commissioner; Santa Barbara County Agricultural Commissioner (805-681-5600); San Luis Obispo County Agricultural Commissioner (805-781-5910).
11. Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, laborer, supplier or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers or suppliers remain unpaid.
12. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. It's purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.
13. NOTICE: Invoices are due and payable within 30 days. 1.5% per month will be added to account balances beyond 30 days from the date of work completed. This is an annual percentage rate of 18%. (Interest charged pursuant to the Robinson-Patman Act). Interest amounts for balances billed to an Escrow Company as a course of a Real Estate sale will be waived up to 4 months from the date of work completed so long as the property remains in escrow. Should an Escrow transaction cancel, the full account balance is due and payable upon the Escrow cancellation date.

WORK ORDER AGREEMENT (PAGE 1 OF 2)

Building No.	Street	City	Zip	Date
1226	Main St Spc 11	Cambria	93428-3311	05/07/26
			A LICENSED PEST CONTROL OPERATOR IS AN EXPERT IN HIS/HER FIELD. ANY QUESTIONS RELATIVE TO THIS REPORT SHOULD BE REFERRED TO HIM/HER.	
PO Box 969, Atascadero, CA 93423-0969 805-466-2451 / 805-466-8026 fax / 800-548-5599			Report #: 113363	
Ordered by: Jack Posemsky Real Estate Jack Posemsky 718 Main Street Cambria, CA 93428		Property Owner and/or Party of Interest: Sandy Rayburn 1226 Main St Spc 11 Cambria, CA 93428-3311		Completion sent to:

COST FOR WORK RECOMMENDED FOR TERMITE REPORT #: 113363 (please circle desired item numbers)		
SECTION I	SECTION II	SECTION NOT DETERMINED OR FURTHER INSPECTION RECOMMENDED
1A \$1,027.00 1B \$306.00 3A \$1,020.00	4A \$300.00	
Total Section I: \$2,353.00	Total Section II: \$300.00	

I HEREBY AUTHORIZE KEY TERMITE & PEST CONTROL TO PERFORM THE FOLLOWING ITEMS: (please list item numbers below)

PLEASE INITIAL HERE USE SPACE BELOW TO DESCRIBE FURTHER INSTRUCTIONS:

Thank you for choosing Key Termite and Pest Control for your pest control needs. Feel free to call our office to answer any questions you may have concerning the Inspection Report, the Work to be completed or the Terms of this Contract. PLEASE INITIAL THIS PAGE AND RETURN BOTH PAGES OF THIS AGREEMENT TO OUR OFFICE.

WORK ORDER AGREEMENT (PAGE 2 OF 2)

Building No.	Street	City	Zip	Date
1226	Main St Spc 11	Cambria	93428-3311	05/07/26

*****State law requires that you be given the following information*****

CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation Agency and the United States Environmental Protection Agency. Registration is granted when the State finds that, based on existing scientific evidence, there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized." If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or Poison Control Center and Key Termite and Pest Control, Inc. (805) 466-2451 immediately. For further information contact any of the following;

For health questions: The County Health Department (805) 781-5500

For application information: The County Agricultural Commissioner (805) 781-5910

For regulatory information: The Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815-3831, (916) 561-8700

Prices for structural repair include replacement of damaged wood members visible at the time of inspection only. Structural improvements necessary to upgrade the existing construction to current building code or corrections of hidden conditions exposed during repairs will be completed at additional expense. This company assumes no liability for improper or non compliant structure(s) on which we complete repairs. Parties in interest should contact the county building department and/or qualified home inspector concerning the structures' compliance with building code. The property owner is responsible to pay for all costs associated with building permits and engineering fees needed and is not included in the repair bid. There will also be additional costs if upgrades are required by the local building department prior to or during the course of repairs. These costs should be determined and appropriated by parties in interest prior to the close of escrow. Reasonable effort will be taken to match existing material being replaced with the same or similar type. However, Key Termite and Pest Control Inc. does not guarantee new material will match the existing material. Special order materials may delay the completion of recommended work and certification date. Painted wood members that are replaced by this company (except stained or varnished wood, and redwood decking) will be painted unless otherwise requested and will be billed as quoted in report recommendation. This company makes no guarantee of color match. The buyer or seller is responsible to choose paint color prior to commencement of repairs. Structural repair recommendations not priced above may be completed upon request and will be billed at \$85.00 per hour which will include basic construction materials (doors, windows and redwood deck materials would be additional). Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes no liability for distribution of molds, dusts or other allergens as a result of repairs performed to the property. Parties in interest should contact a Certified Industrial Hygienist for further information and advice prior to commencement of repairs. We will exercise reasonable caution with adjacent plant growth during the completion of repairs, however, neither Key Termite and Pest Control, Inc. nor its employees or subcontractors assumes any liability for damages to adjacent plant growth as a result of the completion of repairs. Prices authorized after 30 days from the date of issuance of the inspection report are void and must be re-bid. Our minimum job fee is \$145.00 (to cover trip costs and completion notice paperwork). If repairs completed total less than \$145.00, we will bill the \$145.00 minimum fee.


Under the California Mechanics Lien Law any structural pest control company which contracts to do work for you, any contractor, subcontractor, laborer, supplier, or other person who helps to improve your property, but is not paid for his or her work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your structural pest control company in full if the subcontractor, laborers, or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice." Prime contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of person(s) who may have a right to file a lien against your property if they are not paid.

NOTICE: Invoices are due and payable within 30 days. 1.5% per month will be added to account balances beyond 30 days from the date of work completed. This is an annual percentage rate of 18%. (Interest charged pursuant to the Robinson-Patman Act). Interest amounts for balances billed to an Escrow Company as a course of a Real Estate sale will be waived up to 4 months from the date of work completed so long as the property remains in escrow. Should an Escrow transaction cancel, the full account balance is due and payable upon the Escrow cancellation date.

By executing this work authorization contract, customer acknowledges that he or she has been advised of the forgoing and has had the opportunity to consult with a qualified professional.

UNLESS OTHERWISE STATED IN THE INSPECTION REPORT OR THIS CONTRACT, ALL WORK COMPLETED BY KEY TERMITE AND PEST CONTROL IS GUARANTEED FOR TWO YEARS FROM THE DATE OF COMPLETION AGAINST DEFECTS IN MATERIALS AND/OR WORKMANSHIP. ELIMINATION OF REPORTED WOOD DESTROYING PESTS BY STRUCTURAL FUMIGATION AND "PERIMETER PLUS" SUBTERRANEAN TERMITE TREATMENT IS GUARANTEED FOR FIVE YEARS FROM THE DATE OF COMPLETION.

BY SIGNING BELOW, I ACKNOWLEDGE THAT I HAVE READ, UNDERSTAND AND AGREE TO THE TERMS OF THIS CONTRACT AND THE REPORT IT REFERS TO.

BY OWNER/AGENT/BUYER		Key Termite & Pest Control	
PHONE: _____		By: _____	Austin Bennett
SIGNATURE: _____		Signature: _____	
PRINT NAME: _____		Lic. #: _____	FR71066
NOTE: WORK WILL NOT COMMENCE UNTIL DELIVERY OF YOUR WOOD DESTROYING PESTS AND ORGANISMS REPORT. FOR DETAILS REGARDING THE ABOVE RECOMMENDATIONS PLEASE REFER TO YOUR INSPECTION REPORT.			

KEY

TERMITE and PEST CONTROLPO Box 969, Atascadero, CA 93423-0969
805-466-2451 / 805-466-8026 fax / 800-548-5599Key Termite & Pest Control
PO BOX 969
Atascadero, CA 93423
805-466-2451**Invoice # 393852****Invoice** 05/05/2026**Date:** Tuesday**Time:** 02:30 PM**Bill-To:** 59571**Location:** 59571Sandy Rayburn
1226 Main St Spc 11
Cambria, CA 93428-3311*seller*
Sandy Rayburn
1226 Main St Spc 11
Cambria, CA 93428-3311

Service Description	Quantity	Price
---------------------	----------	-------

Complete WDO Inspection	1.00	\$89.00
-------------------------	------	---------

SUBTOTAL	\$89.00
-----------------	---------

TAX	\$0.00
------------	--------

AMT PAID	(\$89.00)
-----------------	-----------

TOTAL	\$0.00
--------------	--------

AMOUNT DUE	\$0.00
-------------------	---------------

Material	%	UOM	Amount	Material	%	UOM	Amount
----------	---	-----	--------	----------	---	-----	--------

Payment Receipt. Please Return with Payment RemittanceBill-To: Sandy Rayburn
1226 Main St Spc 11
Cambria, CA 93428-3311

Account #: 59571

Date: 05/05/2026

PO Number:

Invoice #: 393852

Terms: NET 30

Amount Paid: _____

Check No.: _____

Remit-To: Key Termite & Pest Control
PO BOX 969
Atascadero, CA 93423
805-466-2451