

Radon Inspection Report

Test Location:

460 B Ave W
Walford, IA 52351

Test For:

Honor Radon Mitigation

Inspected By:

Craig Shadle
6825 Bowman Ln NE
Cedar Rapids, IA 52402
319-373-0834
Lic/Cert. # RNTST09123

Bldg. Type: Residential Single Family

Type: Post-Mitigation



Test Result: Pass

Overall Average:

0.9 pCi/l

EPA Average:

0.9 pCi/l

Test Device Details:

SunRADON CRM:	1028
Serial Number:	97346020
Last Calibration:	03/18/2026
Next Calibration:	03/18/2027
Cal-Factors:	2.48
Motion Error:	No

Test Site Condition:

Mitigation Sys:	Installed and Active
-----------------	----------------------

Test Summary:

CRM Location:	Start	Stop	Interval	Duration
Basement family room	07/22/2026 11:52 AM	07/24/2026 11:52 AM	1 hr	48 hr

Test Details:

*First 4 hrs of data excluded	Min	Max	Average	Units
Radon Concentration	0.0	3.2	0.9	pCi/l


Comments:

Craig A. Shadle

Lic/Cert Signature

Inspection Report Date: 07/24/2026

Radon Inspection Chart

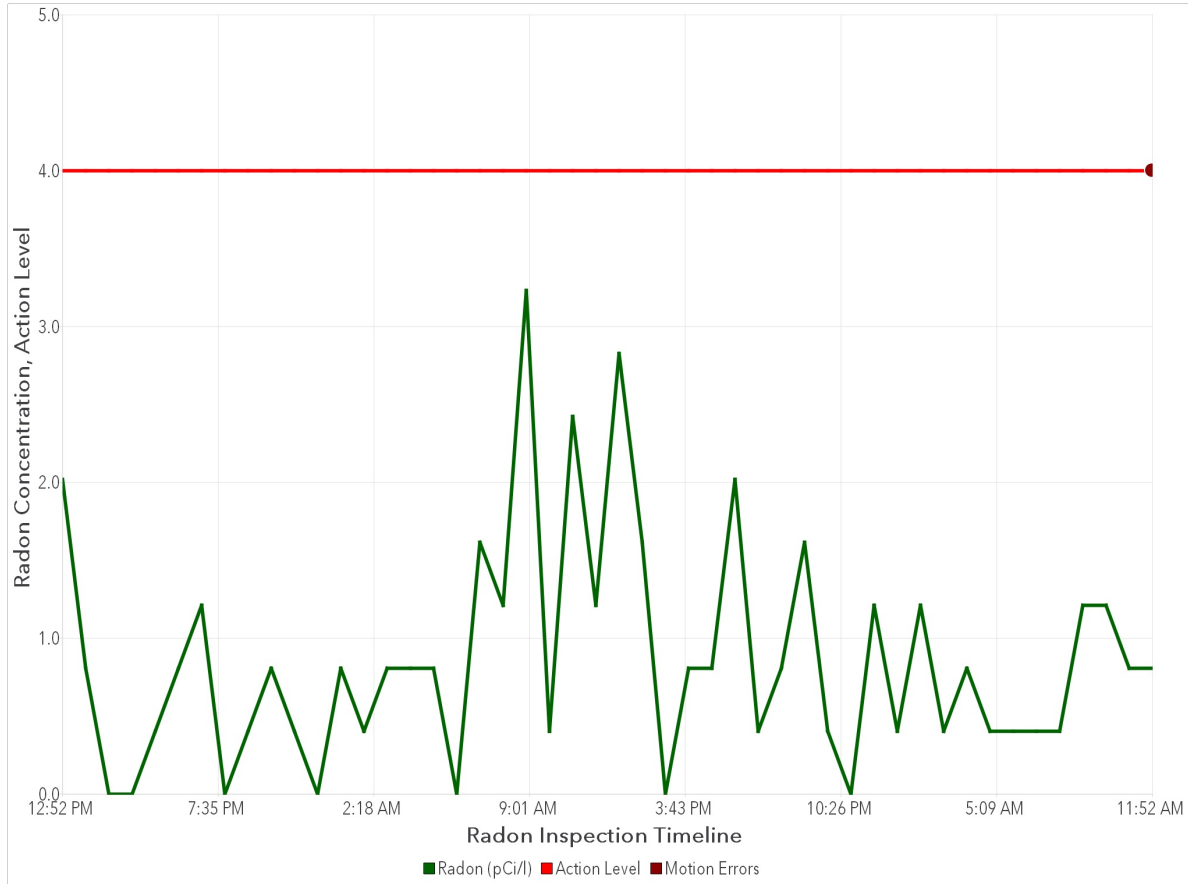

Test Result: Pass

Test Location: 460 B Ave W Walford, IA 52351

Inspection Report Date: 07/24/2026

Test device manufactured by SunRADON, LLC

Test Checklist

- ☒ The location of the detector was selected so the detector was not to be disturbed during testing.
- ☒ The monitor was not placed in an area of high humidity such as: Kitchen, laundry room, cellar, spa room, garage, crawl space or sump area.
- ☒ The detector was not located near drafts caused by HVAC vents, windows and doors.
- ☒ The detector was not placed near areas of excessive heat, such as a fireplace or in direct sunlight.
- ☒ The detector was placed within the breathing zone of at least 20 inches to 6 feet above the floor and at least 1 foot below the ceiling if suspended.
- ☒ The detector was not placed within 1 foot of outside walls of the home or within 3 feet of any windows or doors to the exterior of the home.
- ☒ Ceiling fans, portable dehumidifiers, portable humidifiers, portable air filters, and all window air conditioners are not operated within 20 feet of the detector.

Test Result: Pass

Test Location: 460 B Ave W Walford, IA 52351

Inspection Report Date: 07/24/2026

Test device manufactured by SunRADON, LLC

Test Table

* Data from first 4 hours excluded from EPA calculations

Date/Time	Radon(pCi/l)	Flags
07/22/26 12:52 PM	2.0	-
07/22/26 01:52 PM	0.8	-
07/22/26 02:52 PM	0.0	-
07/22/26 03:52 PM	0.0	-
07/22/26 04:52 PM	0.4	-
07/22/26 05:52 PM	0.8	-
07/22/26 06:52 PM	1.2	-
07/22/26 07:52 PM	0.0	-
07/22/26 08:52 PM	0.4	-
07/22/26 09:52 PM	0.8	-
07/22/26 10:52 PM	0.4	-
07/22/26 11:52 PM	0.0	-
07/23/26 12:52 AM	0.8	-
07/23/26 01:52 AM	0.4	-
07/23/26 02:52 AM	0.8	-
07/23/26 03:52 AM	0.8	-
07/23/26 04:52 AM	0.8	-
07/23/26 05:52 AM	0.0	-
07/23/26 06:52 AM	1.6	-
07/23/26 07:52 AM	1.2	-
07/23/26 08:52 AM	3.2	-
07/23/26 09:52 AM	0.4	-
07/23/26 10:52 AM	2.4	-
07/23/26 11:52 AM	1.2	-
07/23/26 12:52 PM	2.8	-
07/23/26 01:52 PM	1.6	-
07/23/26 02:52 PM	0.0	-
07/23/26 03:52 PM	0.8	-
07/23/26 04:52 PM	0.8	-
07/23/26 05:52 PM	2.0	-
07/23/26 06:52 PM	0.4	-
07/23/26 07:52 PM	0.8	-
07/23/26 08:52 PM	1.6	-
07/23/26 09:52 PM	0.4	-
07/23/26 10:52 PM	0.0	-
07/23/26 11:52 PM	1.2	-
07/24/26 12:52 AM	0.4	-
07/24/26 01:52 AM	1.2	-
07/24/26 02:52 AM	0.4	-
07/24/26 03:52 AM	0.8	-
07/24/26 04:52 AM	0.4	-
07/24/26 05:52 AM	0.4	-
07/24/26 06:52 AM	0.4	-
07/24/26 07:52 AM	0.4	-
07/24/26 08:52 AM	1.2	-
07/24/26 09:52 AM	1.2	-
07/24/26 10:52 AM	0.8	-
07/24/26 11:52 AM	0.8	-

Test Result: Pass

Test Location: 460 B Ave W Walford, IA 52351

Inspection Report Date: 07/24/2026

Test device manufactured by SunRADON, LLC

Radon Test Information

Radon Risk Information

Radon causes lung cancer by means of the decay of its daughter products after breathing in air contaminated with higher levels of Radon. The World Health Organization (WHO) estimates that 15% of lung cancers worldwide are caused by exposure to elevated indoor levels of Radon. Overall, radon is the second leading cause of lung cancer responsible for about 21,000 lung cancer deaths every year in the US alone. Radon gas is the number one cause of lung cancer among non-smokers. The U.S. Environmental Protection Agency (EPA), the U.S. Surgeon General, and the Center for Disease Control and Prevention (CDC) strongly recommend that ALL homebuyers have an indoor radon test performed prior to purchase or taking occupancy and recommend having the radon levels professionally mitigated if elevated radon concentrations are found.

Understanding Radon Test Results

Recommended Action Levels vary by country and typically range from 3 pCi/l (100 Bq/m³) to 8 pCi/l (300 Bq/m³). Recommendations below are based on test results by a Continuous Radon Monitor (CRM) Test of at least 48h duration and are based on recommendations by the EPA.

Measured Average Radon Level:

- At or above 4.0 pCi/l (148 Bq/m³): Corrective measures to reduce exposure to radon gas is strongly recommended (ANSI MAH2014)
- Between 2-4 pCi/l (74-148 Bq/m³): Consider mitigation or periodic retest as indoor Radon levels vary by season and weather conditions
- Below 2 pCi/l (74 Bq/m³): Consider bi-annual retest or whenever significant changes to the home structure or mechanical systems occurred

Test Result: Pass

Test Location: 460 B Ave W Walford, IA 52351

Inspection Report Date: 07/24/2026

Test device manufactured by SunRADON, LLC